

P4909 Inner West PAMP
Detailed Works Program
All Issues
8 April 2021

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
AC1	Booth Street	Annandale	Regional Road	Strategic Route	access	stairs only access to crossing	-33.8805803	151.1681292	1		further investigation required	AN21	Primary	HIGH	-
AC8	Young Street	Annandale	Regional Road	Strategic Route	access	stairs only access to crossing	-33.8806697	151.1682027	1		install kerb extension	AN21	Primary	HIGH	\$ 10,000
AC11	Darling Street	Balmain	Local Road		access	stairs only access to park	-33.8582303	151.1836585	1		install accessible ramp	BA28	Primary	HIGH	\$ 10,000
AC12	Jane Street	Balmain	Local Road		access	stairs only access	-33.8583959	151.1844019	1		no action	BA44	Primary	HIGH	\$ -
AC21	Railway Terrace	Lewisham	State Road	Strategic Route	access	stairs only access to station underpass	-33.8935638	151.1476422	1		refer to Transport for NSW	LW24	Primary	HIGH	\$ -
AC22	Thomas Street	Lewisham	Local Road	Strategic Route	access	stairs only access to station underpass	-33.8930581	151.1476937	1		refer to Transport for NSW	LW30	Primary	HIGH	\$ -
AC32	Trafalgar Street	Petersham	Regional Road		access	stairs only access to station underpass	-33.8944949	151.154246	1		refer to Transport for NSW	PE62	Primary	HIGH	\$ -
AC38	Victoria Road	Rozelle	State Road	Strategic Route	access	stairs only access	-33.8664559	151.1744708	1		install accessible ramp	RO74	Primary	HIGH	\$ 10,000
AC39	Stanmore Road	Stanmore	State Road		access	stairs only access	-33.8964769	151.1635558	1		refer to Transport for NSW on installir	SM35	Primary	HIGH	\$ -
AC40	Trafalgar Street	Stanmore	Regional Road		access	stairs only access to station underpass	-33.8946318	151.1643748	1		refer to Transport for NSW	SM34	Primary	HIGH	\$ -
AC41	Carlton Crescent	Summer Hill	Regional Road	Strategic Route	access	steep crossfall	-33.890565	151.1387618	1		further investigation required	SH3	Primary	HIGH	-
CD2	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8781222	151.1705847	1		install new kerb ramp - pair	AN8	Primary	HIGH	\$ 5,000
CD24	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8809815	151.1693188	1		install new kerb ramp	AN25	Primary	HIGH	\$ 2,500
CD29	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8800892	151.1687512	1		install new tgsi	AN22	Primary	HIGH	\$ 650
CD3	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.8781133	151.1705863	1		re-construct refuge island	AN8	Primary	HIGH	\$ 15,000
CD30	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8794526	151.1698846	1		install new kerb ramp	AN9	Primary	HIGH	\$ 2,500
CD31	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8786626	151.1702084	1		install new tgsi	AN8	Primary	HIGH	\$ 650
CD32	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.8781156	151.1705952	1		re-construct refuge island	AN8	Primary	HIGH	\$ 15,000
CD33	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8781163	151.1705891	1		install new kerb ramp - pair	AN8	Primary	HIGH	\$ 5,000
CD4	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8809385	151.1693582	1		install new kerb ramp - pair	AN25	Primary	HIGH	\$ 5,000
CD5	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.8809394	151.1693509	1		re-construct refuge island	AN25	Primary	HIGH	\$ 15,000
CD47	Booth Street	Annandale	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8819557	151.1721811	1		install new kerb ramp - pair	AN26	Primary	HIGH	\$ 5,000
CD48	Booth Street	Annandale	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.882189	151.1728474	1		install new kerb ramp - pair	AN26	Primary	HIGH	\$ 5,000
CD49	Booth Street	Annandale	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8823303	151.1735847	1		install new kerb ramp - pair	AN65	Primary	HIGH	\$ 5,000
CD50	Booth Street	Annandale	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8815984	151.1717557	1		install new kerb ramp	AN20	Primary	HIGH	\$ 2,500
CD51	Booth Street	Annandale	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8816703	151.1714094	1		install new kerb ramp - pair	AN20	Primary	HIGH	\$ 5,000
CD52	Booth Street	Annandale	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8804365	151.1675258	1		install new kerb ramp - pair	AN21	Primary	HIGH	\$ 5,000
CD53	Booth Street	Annandale	Regional Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8806094	151.1680975	1		install new kerb ramp	AN21	Primary	HIGH	\$ 2,500
CD54	Booth Street	Annandale	Regional Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8806529	151.1682531	1		install new kerb ramp	AN22	Primary	HIGH	\$ 2,500
CD55	Booth Street	Annandale	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8807007	151.1683391	1		install new kerb ramp	AN22	Primary	HIGH	\$ 2,500
CD56	Booth Street	Annandale	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8806987	151.1683209	1		install new kerb ramp	AN22	Primary	HIGH	\$ 2,500
CD57	Booth Street	Annandale	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8809246	151.1691484	1		install new kerb ramp	AN22	Primary	HIGH	\$ 2,500
CD60	Booth Street	Annandale	Regional Road	Strategic Route	crossing deficiency	potential build-out to improve crossing and slow vehicles	-33.8805757	151.168162	1		install kerb extension - pair	AN21	Primary	HIGH	\$ 20,000
CD61	Bridge Road	Annandale	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8876459	151.1714712	1		install new kerb ramp - pair	AN81	Primary	HIGH	\$ 5,000
CD62	Catherine Street	Annandale	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp construction	-33.880795	151.1701457	1		install new kerb ramp	AN25	Primary	HIGH	\$ 2,500
CD66	Chester Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8843285	151.1732797	1		install new kerb ramp - pair	AN31	Primary	HIGH	\$ 5,000
CD67	Chester Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.8842702	151.1733143	1		install new tgsi - pair	AN31	Primary	HIGH	\$ 1,300
CD105	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8874163	151.1679403	1		install new kerb ramp - pair	AN55	Primary	HIGH	\$ 5,000
CD92	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8763143	151.1729756	1		install new kerb ramp - pair	AN46	Primary	HIGH	\$ 5,000
CD93	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8763463	151.1729688	1		install new tgsi	AN46	Primary	HIGH	\$ 650
CD94	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8783785	151.1721981	1		install new kerb ramp	AN48	Primary	HIGH	\$ 2,500
CD95	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.878765	151.1720748	1		install new kerb ramp	AN49	Primary	HIGH	\$ 2,500
CD96	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	narrow kerb ramp	-33.8780249	151.1722362	1		install new kerb ramp	AN48	Primary	HIGH	\$ 2,500
CD98	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8813955	151.1708283	1		install new kerb ramp	AN20	Primary	HIGH	\$ 2,500
CD99	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8835441	151.1697736	1		install new kerb ramp - pair	AN53	Primary	HIGH	\$ 5,000
CD110	Nelson Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8820031	151.1737782	1		install new kerb ramp	AN65	Primary	HIGH	\$ 2,500
CD115	Nelson Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8842645	151.1728264	1		install new kerb ramp - pair	AN71	Primary	HIGH	\$ 5,000
CD116	Nelson Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8841213	151.1728679	1		install new tgsi	AN31	Primary	HIGH	\$ 650
CD117	Parramatta Road	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8867997	151.1764977	1		install new kerb ramp - pair	CA23	Primary	HIGH	\$ 5,000
CD121	Parramatta Road	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8881201	151.1648273	1		install new kerb ramp - pair	AN74	Primary	HIGH	\$ 5,000
CD123	Parramatta Road	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8872426	151.1744434	1		install new kerb ramp - pair	AN85	Primary	HIGH	\$ 5,000
CD124	Parramatta Road	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8874028	151.1732842	1		install new kerb ramp - pair	AN83	Primary	HIGH	\$ 5,000
CD125	Parramatta Road	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8875333	151.1712671	1		install new kerb ramp - pair	AN81	Primary	HIGH	\$ 5,000
CD126	Parramatta Road	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8876933	151.1697363	1		install new kerb ramp - pair	AN80	Primary	HIGH	\$ 5,000
CD143	Railway Parade	Annandale	Local Road		crossing deficiency	misaligned kerb ramp	-33.8720405	151.1722203	1		install new kerb ramp	AN40	Primary	HIGH	\$ 2,500
CD144	Railway Parade	Annandale	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8720411	151.1721793	1		install new kerb ramp	AN40	Primary	HIGH	\$ 2,500
CD145	Railway Parade	Annandale	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8720725	151.1720931	1		install new kerb ramp	AN40	Primary	HIGH	\$ 2,500
CD153	The Crescent	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8739951	151.1748977	1		install new kerb ramp	AN98	Primary	HIGH	\$ 2,500
CD154	The Crescent	Annandale	State Road	Strategic Route	crossing deficiency	potential mid block crossing point - kerb extensions	-33.8748156	151.1749676	1		refer to Transport for NSW	AN98	Primary	HIGH	\$ -
CD155	Trafalgar Street	Annandale	Regional Road		crossing deficiency	missing crossing point	-33.8819593	151.172193	1		install new kerb ramp - pair	AN26	Primary	HIGH	\$ 5,000
CD163	Trafalgar Street	Annandale	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8792511	151.1733305	1		install new kerb ramp - pair	AN100	Primary	HIGH	\$ 5,000
CD164	Trafalgar Street	Annandale	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8790973	151.1734722	1		install new kerb ramp	AN100	Primary	HIGH	\$ 2,500
CD165	Trafalgar Street	Annandale	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8790899	151.173452	1		install new kerb ramp	AN100	Primary	HIGH	\$ 2,500
CD166	Trafalgar Street	Annandale	Regional Road		crossing deficiency	at grade crossing missing tgsi	-33.8790109	151.173499	1		install new tgsi	AN100	Primary	HIGH	\$ 650
CD180	White Creek Lane	Annandale	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8881604	151.1627672	1		install new kerb ramp - pair	AN73	Primary	HIGH	\$ 5,000
CD207	Alt Street	Ashfield	Local Road		crossing deficiency	narrow refuge island	-33.8855113	151.1230051	1		install new refuge island	AF54	Primary	HIGH	\$ 15,000
CD213	Arthur Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8918283	151.1253468	1		install new kerb ramp - pair	AF86	Primary	HIGH	\$ 5,000
CD214	Arthur Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8917665	151.125357	1		install new kerb ramp - pair	AF85	Primary	HIGH	\$ 5,000
CD221	Brown Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8883631	151.1265662	1		install new kerb ramp - pair	AF31	Primary	HIGH	\$ 5,000
CD222	Brown Street	Ashfield	Local Road		crossing deficiency	missing crossing point	-33.887628	151.1250218	1		install new kerb ramp - pair	AF22	Primary	HIGH	\$ 5,000
CD224	Cavill Avenue	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8870739	151.1219934	1		install new kerb ramp	AF33	Primary	HIGH	\$ 2,500
CD225	Cavill Avenue	Ashfield	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8870227	151.1219491	1		install new kerb ramp - pair	AF33	Primary	HIGH	\$ 5,000
CD226	Cavill Avenue	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8871127	151.1219596	1		install new tgsi	AF33	Primary	HIGH	\$ 650
CD227	Charlotte Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8852025	151.1269704	1		install new kerb ramp - pair	AF35	Primary	HIGH	\$ 5,000
CD247	Elizabeth Street	Ashfield	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8870695	151.126729	1		install new kerb ramp - pair	AF52	Primary	HIGH	\$ 5,000
CD248	Elizabeth Street	Ashfield	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8867059	151.1258118	1		install new kerb ramp	AF59	Primary	HIGH	\$ 2,500
CD249	Elizabeth Street	Ashfield	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8866803	151.1258604	1		install new kerb ramp	AF39	Primary	HIGH	\$ 2,500

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD250	Elizabeth Street	Ashfield	Regional Road		crossing deficiency	missing kerb ramp	-33.8861981	151.1248596	1		install new kerb ramp	AF17	Primary	HIGH	\$ 2,500
CD251	Elizabeth Street	Ashfield	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8863185	151.1248893	1		install new kerb ramp - pair	AF59	Primary	HIGH	\$ 5,000
CD252	Elizabeth Street	Ashfield	Regional Road		crossing deficiency	missing kerb ramp - pair	-33.8862052	151.124785	1		install new kerb ramp - pair	AF60	Primary	HIGH	\$ 5,000
CD253	Elizabeth Street	Ashfield	Regional Road		crossing deficiency	crossing within roundabout	-33.885391	151.1231094	1		install new kerb ramp - pair	AF10	Primary	HIGH	\$ 5,000
CD254	Elizabeth Street	Ashfield	Regional Road		crossing deficiency	missing kerb ramp - pair	-33.8854714	151.1231569	1		install new kerb ramp - pair	AF53	Primary	HIGH	\$ 5,000
CD255	Elizabeth Street	Ashfield	Regional Road		crossing deficiency	missing kerb ramp - pair	-33.8854235	151.1229726	1		install new kerb ramp - pair	AF54	Primary	HIGH	\$ 5,000
CD256	Elizabeth Street	Ashfield	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8848412	151.1216213	1		install new kerb ramp - pair	AF55	Primary	HIGH	\$ 5,000
CD257	Elizabeth Street	Ashfield	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8863197	151.1248103	1		install new kerb ramp - pair	AF16	Primary	HIGH	\$ 5,000
CD258	Elizabeth Street	Ashfield	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8862229	151.1249141	1		install new kerb ramp	AF17	Primary	HIGH	\$ 2,500
CD259	Elizabeth Street	Ashfield	Regional Road		crossing deficiency	missing refuge island	-33.8854579	151.1231438	1		install new refuge island	AF53	Primary	HIGH	\$ 15,000
CD260	Elizabeth Street	Ashfield	Regional Road		crossing deficiency	missing refuge island	-33.8853848	151.1231301	1		install new refuge island	AF10	Primary	HIGH	\$ 15,000
CD261	Elizabeth Street	Ashfield	Regional Road		crossing deficiency	missing refuge island	-33.8853884	151.1229832	1		install new refuge island	AF54	Primary	HIGH	\$ 15,000
CD263	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8872487	151.1184295	1		install new kerb ramp	AF67	Primary	HIGH	\$ 2,500
CD264	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8857301	151.1191615	1		install new kerb ramp - pair	AF77	Primary	HIGH	\$ 5,000
CD265	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8779493	151.1275115	1		install new tgsi	AF69	Primary	HIGH	\$ 650
CD267	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8789228	151.1254396	1		install new tgsi	AF69	Primary	HIGH	\$ 650
CD268	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8798617	151.1235351	1		install new kerb ramp - pair	AF70	Primary	HIGH	\$ 5,000
CD269	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8799416	151.1234574	1		install new kerb ramp - pair	AF71	Primary	HIGH	\$ 5,000
CD270	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8805809	151.122653	1		install new kerb ramp - pair	AF72	Primary	HIGH	\$ 5,000
CD271	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8831774	151.1208425	1		install new kerb ramp - pair	AF66	Primary	HIGH	\$ 5,000
CD272	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8835816	151.1205374	1		install new kerb ramp - pair	AF66	Primary	HIGH	\$ 5,000
CD273	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	shallow kerb ramp - pair	-33.8836026	151.1204686	1		install new tgsi	AF66	Primary	HIGH	\$ 650
CD278	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8835487	151.1207218	1		install new kerb ramp - pair	AF66	Primary	HIGH	\$ 5,000
CD279	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8821681	151.1216315	1		install new kerb ramp	AF73	Primary	HIGH	\$ 2,500
CD282	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8779931	151.1275894	1		install new kerb ramp - pair	AF69	Primary	HIGH	\$ 5,000
CD283	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8775706	151.1285525	1		install new kerb ramp - pair	AF69	Primary	HIGH	\$ 5,000
CD284	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8775062	151.1286935	1		install new kerb ramp - pair	AF68	Primary	HIGH	\$ 5,000
CD285	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	raised kerb ramp lip	-33.8774323	151.1288401	1		install new kerb ramp	AF68	Primary	HIGH	\$ 2,500
CD286	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8771014	151.1296497	1		install new kerb ramp - pair	AF68	Primary	HIGH	\$ 5,000
CD287	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8770048	151.1292736	1		install new kerb ramp - pair	AF68	Primary	HIGH	\$ 5,000
CD288	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8778331	151.1276229	1		install new kerb ramp	AF69	Primary	HIGH	\$ 2,500
CD290	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.882199	151.1216309	1		re-construct refuge island	AF73	Primary	HIGH	\$ 15,000
CD292	Georges River Drive	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8900103	151.1171348	1		install new kerb ramp - pair	AF114	Primary	HIGH	\$ 5,000
CD293	Georges River Drive	Ashfield	Local Road		crossing deficiency	missing crossing point	-33.8900897	151.1172042	1		install new kerb ramp - pair	AF114	Primary	HIGH	\$ 5,000
CD294	Georges River Drive	Ashfield	Local Road		crossing deficiency	missing kerb ramp	-33.8899656	151.1172633	1		install new kerb ramp	AF114	Primary	HIGH	\$ 2,500
CD295	Georges River Drive	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8899754	151.1172871	1		install new kerb ramp - pair	AF114	Primary	HIGH	\$ 5,000
CD296	Georges River Drive	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8905494	151.1172501	1		install new kerb ramp - pair	AF114	Primary	HIGH	\$ 5,000
CD305	Holden Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8904532	151.1254833	1		install new kerb ramp - pair	AF84	Primary	HIGH	\$ 5,000
CD306	Holden Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8917718	151.1254162	1		install new kerb ramp - pair	AF85	Primary	HIGH	\$ 5,000
CD307	Holden Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8910374	151.1253935	1		install new kerb ramp	AF85	Primary	HIGH	\$ 2,500
CD308	Holden Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8918205	151.1254161	1		install new kerb ramp - pair	AF86	Primary	HIGH	\$ 5,000
CD313	Hugh Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8893886	151.1225183	1		install new kerb ramp - pair	AF119	Primary	HIGH	\$ 5,000
CD315	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8895055	151.1259573	1		install new kerb ramp	AF30	Primary	HIGH	\$ 2,500
CD316	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8884355	151.1176335	1		install new kerb ramp	AF107	Primary	HIGH	\$ 2,500
CD317	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.88853	151.1174392	1		install new kerb ramp	AF112	Primary	HIGH	\$ 2,500
CD318	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8884254	151.117458	1		install new kerb ramp	AF78	Primary	HIGH	\$ 2,500
CD319	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8884823	151.1173786	1		install new kerb ramp	AF91	Primary	HIGH	\$ 2,500
CD320	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8891647	151.1324923	1		install new kerb ramp - pair	SH45	Primary	HIGH	\$ 5,000
CD321	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8884067	151.134269	1		install new kerb ramp - pair	AF95	Primary	HIGH	\$ 5,000
CD322	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8884064	151.1342974	1		install new kerb ramp	AF95	Primary	HIGH	\$ 2,500
CD323	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8873677	151.1365897	1		install new kerb ramp	SH47	Primary	HIGH	\$ 2,500
CD324	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.887243	151.1367615	1		install new kerb ramp	AF92	Primary	HIGH	\$ 2,500
CD325	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8869546	151.1372437	1		install new kerb ramp - pair	AF92	Primary	HIGH	\$ 5,000
CD327	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8903285	151.1296905	1		install new kerb ramp	AF100	Primary	HIGH	\$ 2,500
CD328	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8879474	151.1232517	1		install new kerb ramp - pair	AF93	Primary	HIGH	\$ 5,000
CD329	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8879783	151.1233629	1		install new kerb ramp - pair	AF105	Primary	HIGH	\$ 5,000
CD330	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	narrow kerb ramp	-33.8884466	151.1174534	1		install new kerb ramp	AF91	Primary	HIGH	\$ 2,500
CD331	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8902929	151.1283115	1		install new kerb ramp - pair	AF100	Primary	HIGH	\$ 5,000
CD332	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8904316	151.1282385	1		install new kerb ramp - pair	AF150	Primary	HIGH	\$ 5,000
CD333	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8902332	151.1297351	1		install new kerb ramp	AF100	Primary	HIGH	\$ 2,500
CD334	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8900004	151.1303593	1		install new kerb ramp - pair	AF99	Primary	HIGH	\$ 5,000
CD335	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8898883	151.1306805	1		install new kerb ramp - pair	AF98	Primary	HIGH	\$ 5,000
CD336	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	missing crossing point	-33.8896097	151.131469	1		install new kerb ramp - pair	AF97	Primary	HIGH	\$ 5,000
CD339	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8895975	151.1318377	1		install new kerb ramp - pair	AF97	Primary	HIGH	\$ 5,000
CD340	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8899321	151.1273689	1		install new kerb ramp - pair	AF101	Primary	HIGH	\$ 5,000
CD341	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8903059	151.1281807	1		install new kerb ramp - pair	AF150	Primary	HIGH	\$ 5,000
CD343	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8876026	151.1220899	1		install new kerb ramp - pair	AF106	Primary	HIGH	\$ 5,000
CD344	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8874312	151.1218165	1		install new kerb ramp - pair	AF106	Primary	HIGH	\$ 5,000
CD345	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8881338	151.1201089	1		install new kerb ramp - pair	AF109	Primary	HIGH	\$ 5,000
CD346	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8903151	151.1297663	1		install new kerb ramp	AF100	Primary	HIGH	\$ 2,500
CD348	Markham Place	Ashfield	Local Road		crossing deficiency	missing kerb ramp	-33.8872755	151.1226093	1		install new kerb ramp	AF33	Primary	HIGH	\$ 2,500
CD350	Milton Street	Ashfield	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8914331	151.1170196	1		install new kerb ramp - pair	AF115	Primary	HIGH	\$ 5,000
CD361	Norton Street	Ashfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8913261	151.1280061	1		install new kerb ramp - pair	AF123	Primary	HIGH	\$ 5,000
CD362	Norton Street	Ashfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8912173	151.1278495	1		install new kerb ramp - pair	AF122	Primary	HIGH	\$ 5,000
CD363	Norton Street	Ashfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8912007	151.1274648	1		install new kerb ramp - pair	AF122	Primary	HIGH	\$ 5,000
CD364	Norton Street	Ashfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8908796	151.1264539	1		install new kerb ramp - pair	AF121	Primary	HIGH	\$ 5,000
CD365	Norton Street	Ashfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8905489	151.1255293	1		install new kerb ramp - pair	AF121	Primary	HIGH	\$ 5,000
CD366	Norton Street	Ashfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8898799	151.1238903	1		install new kerb ramp - pair	AF120	Primary	HIGH	\$ 5,000
CD367	Norton Street	Ashfield	Regional Road	Strategic Route	crossing deficiency	long crossing	-33.8898505	151.1238528	1		install kerb extension - pair	AF120	Primary	HIGH	\$ 20,000
CD368	Norton Street	Ashfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8893547	151.1225965	1		install new kerb ramp - pair	AF119	Primary	HIGH	\$ 5,000
CD369	Norton Street	Ashfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8893866	151.122789	1		install new kerb ramp	AF119	Primary	HIGH	\$ 2,500
CD370	Norton Street	Ashfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.890461	151.1254559	1		install new kerb ramp - pair	AF117	Primary	HIGH	\$ 5,000

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD371	Norton Street	Ashfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8904572	151.1255729	1		install new kerb ramp - pair	AF121	Primary	HIGH	\$ 5,000
CD372	Norton Street	Ashfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8915047	151.1311595	1		install new kerb ramp - pair	AF125	Primary	HIGH	\$ 5,000
CD373	Norton Street	Ashfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8914036	151.130186	1		install new kerb ramp	AF125	Primary	HIGH	\$ 2,500
CD374	Norton Street	Ashfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8913707	151.1299857	1		install new kerb ramp - pair	AF124	Primary	HIGH	\$ 5,000
CD375	Old Canterbury Road	Ashfield	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9038949	151.1290813	1		install new kerb ramp - pair	AF130	Primary	HIGH	\$ 5,000
CD378	Orpington Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8866697	151.1288228	1		install new kerb ramp - pair	AF133	Primary	HIGH	\$ 5,000
CD383	Parramatta Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.884816	151.1354903	1		install new kerb ramp	HA72	Primary	HIGH	\$ 2,500
CD384	Parramatta Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.884816	151.1354903	1		install new kerb ramp	HA72	Primary	HIGH	\$ 2,500
CD389	Parramatta Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8860833	151.1386419	1		install new kerb ramp - pair	HA75	Primary	HIGH	\$ 5,000
CD394	Queen Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8912097	151.1280046	1		install new kerb ramp - pair	AF150	Primary	HIGH	\$ 5,000
CD400	Station Street	Ashfield	Local Road		crossing deficiency	missing crossing point	-33.8874068	151.1264226	1		install new kerb ramp - pair	AF138	Primary	HIGH	\$ 5,000
CD402	The Esplanade	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8875425	151.1240518	1		install new tgsi	AF32	Primary	HIGH	\$ 650
CD407	Tideswell Street	Ashfield	State Road	Strategic Route	crossing deficiency	long crossing	-33.8868671	151.137366	1		install kerb extension - pair	AF92	Primary	HIGH	\$ 20,000
CD408	Victoria Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8903592	151.1297981	1		install new kerb ramp - pair	AF160	Primary	HIGH	\$ 5,000
CD448	Birchgrove Road	Balmain	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8534355	151.1775439	1		install new tgsi	BA46	Primary	HIGH	\$ 650
CD449	Booth Street	Balmain	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8582466	151.1822096	1		install new tgsi	BA13	Primary	HIGH	\$ 650
CD452	Booth Street	Balmain	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8600489	151.1819115	1		install new kerb ramp	BA16	Primary	HIGH	\$ 2,500
CD453	Curtis Road	Balmain	Local Road		crossing deficiency	narrow kerb ramp - pair	-33.8580587	151.1839028	1		install new kerb ramp - pair	BA20	Primary	HIGH	\$ 5,000
CD454	Curtis Road	Balmain	Local Road		crossing deficiency	missing crossing point	-33.8571931	151.1832558	1		install new kerb ramp - pair	BA20	Primary	HIGH	\$ 5,000
CD465	Curtis Road	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8570107	151.1832926	1		install new kerb ramp - pair	BA20	Primary	HIGH	\$ 5,000
CD466	Darling Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8581964	151.1720655	1		install new kerb ramp	RO19	Primary	HIGH	\$ 2,500
CD467	Darling Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8565328	151.1726599	1		install new kerb ramp	BA36	Primary	HIGH	\$ 2,500
CD468	Darling Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8559506	151.1741337	1		install new kerb ramp	BA35	Primary	HIGH	\$ 2,500
CD469	Darling Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8558809	151.174867	1		install new kerb ramp	BA34	Primary	HIGH	\$ 2,500
CD474	Darling Street	Balmain	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8565762	151.1728598	1		install new tgsi	BA35	Primary	HIGH	\$ 650
CD475	Darling Street	Balmain	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8566695	151.17277	1		install new kerb ramp - pair	BA36	Primary	HIGH	\$ 5,000
CD476	Darling Street	Balmain	Local Road		crossing deficiency	misaligned kerb ramp	-33.8574335	151.1724648	1		install new kerb ramp	BA37	Primary	HIGH	\$ 2,500
CD477	Darling Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8582364	151.1721922	1		install new kerb ramp	RO19	Primary	HIGH	\$ 2,500
CD478	Darling Street	Balmain	Local Road		crossing deficiency	misaligned kerb ramp	-33.8570472	151.1801836	1		install new kerb ramp	BA30	Primary	HIGH	\$ 2,500
CD479	Darling Street	Balmain	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8573041	151.1806097	1		install new kerb ramp - pair	BA30	Primary	HIGH	\$ 5,000
CD480	Darling Street	Balmain	Local Road		crossing deficiency	mismatched kerb ramps	-33.8576704	151.1820979	1		install new kerb ramp	BA29	Primary	HIGH	\$ 2,500
CD481	Darling Street	Balmain	Local Road		crossing deficiency	mismatched kerb ramps	-33.8578051	151.1827296	1		install new kerb ramp	BA28	Primary	HIGH	\$ 2,500
CD482	Darling Street	Balmain	Local Road		crossing deficiency	long crossing point	-33.858145	151.1849671	1		install new refuge island	BA27	Primary	HIGH	\$ 15,000
CD483	Darling Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8581911	151.1849568	1		install new kerb ramp - pair	BA27	Primary	HIGH	\$ 5,000
CD484	Darling Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8581049	151.1861457	1		install new kerb ramp - pair	BA26	Primary	HIGH	\$ 5,000
CD485	Darling Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8581668	151.1870435	1		install new kerb ramp	BA26	Primary	HIGH	\$ 2,500
CD486	Darling Street	Balmain	Local Road		crossing deficiency	steep kerb ramp	-33.8582638	151.1862276	1		install new kerb ramp - pair	BA26	Primary	HIGH	\$ 5,000
CD487	Darling Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8582938	151.1855262	1		install new kerb ramp - pair	BA26	Primary	HIGH	\$ 5,000
CD488	Darling Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8579525	151.1827859	1		install new kerb ramp	BA28	Primary	HIGH	\$ 2,500
CD489	Darling Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8574669	151.1724215	1		install new kerb ramp	BA37	Primary	HIGH	\$ 2,500
CD490	Darvall Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8595464	151.1823499	1		install new kerb ramp	BA39	Primary	HIGH	\$ 2,500
CD491	Eaton Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.85838	151.1837568	1		install new kerb ramp	BA40	Primary	HIGH	\$ 2,500
CD492	Eaton Street	Balmain	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8587098	151.1837635	1		install new tgsi - pair	BA40	Primary	HIGH	\$ 1,300
CD493	Eaton Street	Balmain	Local Road		crossing deficiency	missing kerb ramp	-33.8586987	151.1838052	1		install new kerb ramp	BA40	Primary	HIGH	\$ 2,500
CD494	Eaton Street	Balmain	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8589652	151.183796	1		install new kerb ramp - pair	BA40	Primary	HIGH	\$ 5,000
CD512	Jane Street	Balmain	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8587881	151.1843832	1		install new tgsi - pair	BA44	Primary	HIGH	\$ 1,300
CD513	Jane Street	Balmain	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8587864	151.1844523	1		install new kerb ramp - pair	BA44	Primary	HIGH	\$ 5,000
CD514	Jane Street	Balmain	Local Road		crossing deficiency	missing kerb ramp	-33.8587296	151.1844284	1		install new kerb ramp	BA44	Primary	HIGH	\$ 2,500
CD515	Macquarie Terrace	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8538962	151.1780658	1		install new kerb ramp - pair	BA46	Primary	HIGH	\$ 5,000
CD516	Macquarie Terrace	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8540358	151.1782351	1		install new kerb ramp - pair	BA46	Primary	HIGH	\$ 5,000
CD525	Mullens Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8612039	151.176843	1		install new kerb ramp	BA60	Primary	HIGH	\$ 2,500
CD526	Mullens Street	Balmain	Local Road		crossing deficiency	missing kerb ramp	-33.8612769	151.1767608	1		install new kerb ramp	BA51	Primary	HIGH	\$ 2,500
CD527	Mullens Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8612522	151.1766926	1		install new kerb ramp	BA51	Primary	HIGH	\$ 2,500
CD528	Mullens Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8624626	151.1764267	1		install new kerb ramp - pair	BA52	Primary	HIGH	\$ 5,000
CD529	Mullens Street	Balmain	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8620571	151.1763002	1		install new tgsi	BA52	Primary	HIGH	\$ 650
CD543	Robert Street	Balmain	Local Road		crossing deficiency	missing kerb ramp	-33.8613258	151.1771119	1		install new kerb ramp	BA60	Primary	HIGH	\$ 2,500
CD544	Rowntree Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8545433	151.1785992	1		install new kerb ramp	BA46	Primary	HIGH	\$ 2,500
CD545	Terry Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.858177	151.1711651	1		install new kerb ramp	RO64	Primary	HIGH	\$ 2,500
CD546	Terry Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8575801	151.171032	1		install new kerb ramp	RO64	Primary	HIGH	\$ 2,500
CD553	Wortley Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8614509	151.1771423	1		install new kerb ramp - pair	BA60	Primary	HIGH	\$ 5,000
CD565	Darling Street	Balmain East	Local Road		crossing deficiency	steep kerb ramp	-33.8577622	151.1905085	1		install new kerb ramp - pair	BE6	Primary	HIGH	\$ 5,000
CD566	Darling Street	Balmain East	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8573207	151.1935936	1		install new kerb ramp	BE2	Primary	HIGH	\$ 2,500
CD567	Darling Street	Balmain East	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8572142	151.1943157	1		install new kerb ramp	BE2	Primary	HIGH	\$ 2,500
CD568	Darling Street	Balmain East	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.857127	151.1953322	1		install new kerb ramp - pair	BE1	Primary	HIGH	\$ 5,000
CD569	Darling Street	Balmain East	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8573937	151.1937638	1		install new kerb ramp	BE2	Primary	HIGH	\$ 2,500
CD601	Mallett Street	Camperdown	Local Road		crossing deficiency	misaligned kerb ramp	-33.8908846	151.1782405	1		install new kerb ramp	CA12	Primary	HIGH	\$ 2,500
CD602	Mallett Street	Camperdown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8872418	151.1766749	1		install new kerb ramp	CA11	Primary	HIGH	\$ 2,500
CD603	Parramatta Road	Camperdown	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8875302	151.1726527	1		install new kerb ramp - pair	AN83	Primary	HIGH	\$ 5,000
CD604	Parramatta Road	Camperdown	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8874803	151.1735438	1		install new kerb ramp - pair	AN83	Primary	HIGH	\$ 5,000
CD634	Elizabeth Street	Croydon	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8831304	151.1181178	1		install new kerb ramp	CR21	Primary	HIGH	\$ 2,500
CD635	Elizabeth Street	Croydon	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8830011	151.1178383	1		install new kerb ramp - pair	CR21	Primary	HIGH	\$ 5,000
CD636	Elizabeth Street	Croydon	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8829373	151.1176166	1		install new kerb ramp	CR21	Primary	HIGH	\$ 2,500
CD638	Holborrow Street	Croydon	State Road	Strategic Route	crossing deficiency	long crossing	-33.8872574	151.1139191	1		install kerb extension - pair	CR23	Primary	HIGH	\$ 20,000
CD639	Liverpool Road	Croydon	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8874666	151.1145175	1		install new kerb ramp - pair	CR24	Primary	HIGH	\$ 5,000
CD640	Liverpool Road	Croydon	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8879301	151.1153988	1		install new kerb ramp - pair	CR25	Primary	HIGH	\$ 5,000
CD641	Liverpool Road	Croydon	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8880661	151.1154697	1		install new kerb ramp	CR25	Primary	HIGH	\$ 2,500
CD642	Liverpool Road	Croydon	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8872557	151.1138831	1		install new kerb ramp	CR23	Primary	HIGH	\$ 2,500
CD643	Liverpool Road	Croydon	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8869257	151.1132556	1		install new kerb ramp	CR23	Primary	HIGH	\$ 2,500
CD693	Constitution Road	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9024719	151.1388249	1		install new kerb ramp	DH10	Primary	HIGH	\$ 2,500
CD697	Dulwich Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.901945	151.1402596	1		install new kerb ramp - pair	DH25	Primary	HIGH	\$ 5,000
CD698	Dulwich Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9032345	151.1423793	1		install new kerb ramp - pair	DH26	Primary	HIGH	\$ 5,000
CD702	Ewart Street	Dulwich Hill	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9100156	151.137808	1		install new tgsi	DH31	Primary	HIGH	\$ 650

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD703	Ewart Street	Dulwich Hill	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9099323	151.1378586	1		install new kerb ramp	DH31	Primary	HIGH	\$ 2,500
CD704	Ewart Street	Dulwich Hill	Local Road	Strategic Route	crossing deficiency	missing crossing point	-33.9106492	151.1389759	1		install new kerb ramp - pair	DH29	Primary	HIGH	\$ 5,000
CD705	Ewart Street	Dulwich Hill	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9110475	151.1390848	1		install new kerb ramp	DH29	Primary	HIGH	\$ 2,500
CD707	Ewart Street	Dulwich Hill	Local Road	Strategic Route	crossing deficiency	missing crossing point	-33.9103024	151.1382507	1		install new kerb ramp - pair	DH31	Primary	HIGH	\$ 5,000
CD722	Hill Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9015975	151.1404375	1		install new kerb ramp	DH22	Primary	HIGH	\$ 2,500
CD728	Lewisham Street	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.901548	151.1405773	1		install new tgsi - pair	DH22	Primary	HIGH	\$ 1,300
CD731	Marrickville Road	Dulwich Hill	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9054446	151.1444157	1		install new kerb ramp	DH79	Primary	HIGH	\$ 2,500
CD732	Marrickville Road	Dulwich Hill	Regional Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.905309	151.1443335	1		install new tgsi - pair	DH75	Primary	HIGH	\$ 1,300
CD733	Marrickville Road	Dulwich Hill	Regional Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9041979	151.1433734	1		install new tgsi - pair	DH78	Primary	HIGH	\$ 1,300
CD734	Marrickville Road	Dulwich Hill	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9042717	151.1434513	1		install new kerb ramp	DH78	Primary	HIGH	\$ 2,500
CD737	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.9016317	151.1447087	1		re-construct refuge island	DH94	Primary	HIGH	\$ 15,000
CD738	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9033123	151.1423923	1		install new kerb ramp - pair	DH97	Primary	HIGH	\$ 5,000
CD739	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9033258	151.1424555	1		install new kerb ramp	DH97	Primary	HIGH	\$ 2,500
CD740	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9033835	151.1423718	1		install new kerb ramp	DH76	Primary	HIGH	\$ 2,500
CD741	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp construction	-33.9033604	151.1423286	1		install new kerb ramp	DH97	Primary	HIGH	\$ 2,500
CD742	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9038219	151.1410527	1		install new kerb ramp - pair	DH98	Primary	HIGH	\$ 5,000
CD743	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9038254	151.1410543	1		install new kerb ramp	DH98	Primary	HIGH	\$ 2,500
CD744	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	narrow kerb ramp	-33.9039709	151.1409562	1		install new kerb ramp	DH98	Primary	HIGH	\$ 2,500
CD745	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9039529	151.1409041	1		install new kerb ramp	DH98	Primary	HIGH	\$ 2,500
CD746	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9047962	151.1387624	1		install new kerb ramp	DH41	Primary	HIGH	\$ 2,500
CD747	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9058577	151.1359325	1		install new kerb ramp	DH86	Primary	HIGH	\$ 2,500
CD748	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9058678	151.134424	1		install new kerb ramp - pair	DH87	Primary	HIGH	\$ 5,000
CD749	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9052134	151.1333256	1		install new kerb ramp	DH89	Primary	HIGH	\$ 2,500
CD750	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.9051718	151.1332766	1		install new kerb ramp - pair	DH89	Primary	HIGH	\$ 5,000
CD753	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.9051893	151.133517	1		install new kerb ramp	DH89	Primary	HIGH	\$ 2,500
CD754	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9057121	151.1353665	1		install new kerb ramp	DH87	Primary	HIGH	\$ 2,500
CD755	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9050344	151.1377066	1		install new kerb ramp	DH84	Primary	HIGH	\$ 2,500
CD756	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9038196	151.1408563	1		install new kerb ramp - pair	DH98	Primary	HIGH	\$ 5,000
CD757	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9038108	151.1408416	1		install new kerb ramp	DH98	Primary	HIGH	\$ 2,500
CD758	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	steep kerb ramp	-33.9038173	151.1408557	1		install new kerb ramp - pair	DH98	Primary	HIGH	\$ 5,000
CD759	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.903803	151.141045	1		install new kerb ramp	DH98	Primary	HIGH	\$ 2,500
CD760	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9035862	151.141435	1		install new kerb ramp	DH98	Primary	HIGH	\$ 2,500
CD761	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9032564	151.1424544	1		install new kerb ramp	DH96	Primary	HIGH	\$ 2,500
CD762	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9029438	151.143025	1		install new kerb ramp - pair	DH96	Primary	HIGH	\$ 5,000
CD763	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	narrow kerb ramp - pair	-33.9028617	151.1438093	1		install new kerb ramp - pair	DH95	Primary	HIGH	\$ 5,000
CD764	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.90255	151.1439623	1		re-construct refuge island	DH95	Primary	HIGH	\$ 15,000
CD765	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9032742	151.1423225	1		install new kerb ramp - pair	DH97	Primary	HIGH	\$ 5,000
CD766	Old Canterbury Road	Dulwich Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8960903	151.1379487	1		install new kerb ramp - pair	SH56	Primary	HIGH	\$ 5,000
CD775	Old Canterbury Road	Dulwich Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9013708	151.1316068	1		install new kerb ramp - pair	AF126	Primary	HIGH	\$ 5,000
CD776	Old Canterbury Road	Dulwich Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9024161	151.1306735	1		install new kerb ramp - pair	AF128	Primary	HIGH	\$ 5,000
CD777	Old Canterbury Road	Dulwich Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9035053	151.1297188	1		install new kerb ramp - pair	AF129	Primary	HIGH	\$ 5,000
CD778	Old Canterbury Road	Dulwich Hill	State Road		crossing deficiency	long crossing point	-33.9035786	151.1296527	1		install kerb extension / refuge island	AF129	Primary	HIGH	\$ 10,000
CD779	Old Canterbury Road	Dulwich Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9046722	151.1286932	1		install new kerb ramp - pair	DH82	Primary	HIGH	\$ 5,000
CD783	Piggott Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9025363	151.1439903	1		install new kerb ramp - pair	DH95	Primary	HIGH	\$ 5,000
CD799	Wardell Road	Dulwich Hill	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9088016	151.1433583	1		install new kerb ramp - pair	MV239	Primary	HIGH	\$ 5,000
CD800	Wardell Road	Dulwich Hill	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.911207	151.1411733	1		install new kerb ramp - pair	MV64	Primary	HIGH	\$ 5,000
CD801	Wardell Road	Dulwich Hill	Regional Road		crossing deficiency	misaligned kerb ramp - pair	-33.9102288	151.1419041	1		install new kerb ramp - pair	DH125	Primary	HIGH	\$ 5,000
CD802	Wardell Road	Dulwich Hill	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9089166	151.1432305	1		install new kerb ramp - pair	DH126	Primary	HIGH	\$ 5,000
CD804	Wardell Road	Dulwich Hill	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9097423	151.1424993	1		install new kerb ramp	DH126	Primary	HIGH	\$ 2,500
CD805	Wardell Road	Dulwich Hill	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.9102491	151.1420526	1		install new kerb ramp	DH125	Primary	HIGH	\$ 2,500
CD821	Edgeware Road	Enmore	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8997335	151.1712719	1		install new kerb ramp - pair	EN1	Primary	HIGH	\$ 5,000
CD822	Edgeware Road	Enmore	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9021319	151.1718955	1		install new kerb ramp	EN3	Primary	HIGH	\$ 2,500
CD823	Enmore Road	Enmore	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8995207	151.1708157	1		install new kerb ramp	EN13	Primary	HIGH	\$ 2,500
CD824	Enmore Road	Enmore	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8995953	151.1707703	1		install new kerb ramp	EN8	Primary	HIGH	\$ 2,500
CD825	Enmore Road	Enmore	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.9009274	151.1702238	1		install new kerb ramp	MV63	Primary	HIGH	\$ 2,500
CD826	Enmore Road	Enmore	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9000729	151.1707198	1		install new kerb ramp	EN8	Primary	HIGH	\$ 2,500
CD827	Enmore Road	Enmore	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8995713	151.1709823	1		install new kerb ramp	EN8	Primary	HIGH	\$ 2,500
CD828	Enmore Road	Enmore	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8994566	151.171042	1		install new kerb ramp	EN6	Primary	HIGH	\$ 2,500
CD829	Enmore Road	Enmore	State Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.8991375	151.1714804	1		re-construct refuge island	EN6	Primary	HIGH	\$ 15,000
CD830	Enmore Road	Enmore	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8991535	151.1720568	1		install new kerb ramp	EN7	Primary	HIGH	\$ 2,500
CD831	Enmore Road	Enmore	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8989831	151.172875	1		install new kerb ramp	EN7	Primary	HIGH	\$ 2,500
CD832	Enmore Road	Enmore	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8989486	151.1728251	1		install new kerb ramp	EN7	Primary	HIGH	\$ 2,500
CD833	Enmore Road	Enmore	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8994613	151.1710766	1		install new tgsi	EN6	Primary	HIGH	\$ 650
CD834	Enmore Road	Enmore	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8991491	151.1714563	1		install new kerb ramp	EN6	Primary	HIGH	\$ 2,500
CD842	Stanmore Road	Enmore	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8988894	151.1695985	1		install new kerb ramp	EN13	Primary	HIGH	\$ 2,500
CD844	Stanmore Road	Enmore	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8987855	151.1689519	1		install new kerb ramp	EN14	Primary	HIGH	\$ 2,500
CD845	Stanmore Road	Enmore	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8992777	151.1702466	1		install new kerb ramp	EN13	Primary	HIGH	\$ 2,500
CD863	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8812695	151.1381514	1		install new kerb ramp - pair	HA35	Primary	HIGH	\$ 5,000
CD864	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8804585	151.138738	1		install new kerb ramp - pair	HA90	Primary	HIGH	\$ 5,000
CD865	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.88034	151.1388851	1		install new kerb ramp - pair	HA34	Primary	HIGH	\$ 5,000
CD866	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.8798606	151.1391707	1		install new tgsi - pair	HA34	Primary	HIGH	\$ 1,300
CD867	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.877708	151.1407375	1		install new kerb ramp	HA32	Primary	HIGH	\$ 2,500
CD871	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8789104	151.1400238	1		install new kerb ramp - pair	HA32	Primary	HIGH	\$ 5,000
CD872	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8797093	151.1394903	1		install new kerb ramp - pair	HA30	Primary	HIGH	\$ 5,000
CD873	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	long crossing point	-33.8797789	151.1394198	1		install kerb extension - pair	HA30	Primary	HIGH	\$ 20,000
CD874	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8804935	151.138989	1		install new kerb ramp - pair	HA93	Primary	HIGH	\$ 5,000
CD875	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.880622	151.1388508	1		install new kerb ramp - pair	HA93	Primary	HIGH	\$ 5,000
CD876	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.8809554	151.1385888	1		install new tgsi - pair	HA35	Primary	HIGH	\$ 1,300
CD889	Hawthorn Parade	Haberfield	Local Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.8893949	151.1444439	1		install kerb extension	HA65	Primary	HIGH	\$ 10,000
CD891	Marion Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8841909	151.1439716	1		install new kerb ramp - pair	HA61	Primary	HIGH	\$ 5,000
CD892	Marion Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8844681	151.1421337	1		install new kerb ramp	HA60	Primary	HIGH	\$ 2,500
CD893	Marion Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8840805	151.1441794	1		install new kerb ramp	HA61	Primary	HIGH	\$ 2,500

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD903	Parramatta Road	Haberfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8770286	151.1299526	1		install new kerb ramp - pair	HA66	Primary	HIGH	\$ 5,000
CD904	Parramatta Road	Haberfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8771922	151.1300188	1		install new kerb ramp - pair	HA66	Primary	HIGH	\$ 5,000
CD905	Parramatta Road	Haberfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8780804	151.1306375	1		install new kerb ramp - pair	HA67	Primary	HIGH	\$ 5,000
CD906	Parramatta Road	Haberfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8839101	151.1346051	1		install new kerb ramp - pair	AF147	Primary	HIGH	\$ 5,000
CD908	Parramatta Road	Haberfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8874862	151.1417233	1		install new kerb ramp - pair	HA78	Primary	HIGH	\$ 5,000
CD909	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	missing crossing point	-33.8813718	151.1396953	1		install new kerb ramp - pair	HA85	Primary	HIGH	\$ 5,000
CD910	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	missing crossing point	-33.8814292	151.1397624	1		install new kerb ramp - pair	HA85	Primary	HIGH	\$ 5,000
CD911	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	missing crossing point	-33.8821537	151.1403681	1		install new kerb ramp - pair	HA95	Primary	HIGH	\$ 5,000
CD912	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8824242	151.1403482	1		install new kerb ramp - pair	HA95	Primary	HIGH	\$ 5,000
CD913	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8794369	151.1379312	1		install new kerb ramp - pair	HA86	Primary	HIGH	\$ 5,000
CD914	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8785884	151.1372388	1		install new kerb ramp - pair	HA89	Primary	HIGH	\$ 5,000
CD918	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8761509	151.1352815	1		install new kerb ramp - pair	HA83	Primary	HIGH	\$ 5,000
CD921	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8768413	151.1359911	1		install new kerb ramp - pair	HA88	Primary	HIGH	\$ 5,000
CD922	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8785247	151.1373507	1		install new kerb ramp - pair	HA89	Primary	HIGH	\$ 5,000
CD923	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	missing crossing point	-33.8786425	151.1373723	1		install new kerb ramp - pair	HA86	Primary	HIGH	\$ 5,000
CD924	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.8795057	151.1381817	1		re-construct refuge island	HA90	Primary	HIGH	\$ 15,000
CD925	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.8798539	151.1383829	1		install new tgsi - pair	HA90	Primary	HIGH	\$ 1,300
CD958	New Canterbury Road	Hurlstone Park	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9048542	151.1286714	1		install new kerb ramp - pair	DH82	Primary	HIGH	\$ 5,000
CD960	Old Canterbury Road	Hurlstone Park	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9062077	151.1273022	1		install new kerb ramp - pair	HP5	Primary	HIGH	\$ 5,000
CD961	Old Canterbury Road	Hurlstone Park	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9061254	151.1272029	1		install new kerb ramp - pair	HP5	Primary	HIGH	\$ 5,000
CD962	Old Canterbury Road	Hurlstone Park	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9063675	151.1271462	1		install new kerb ramp - pair	HP6	Primary	HIGH	\$ 5,000
CD964	Old Canterbury Road	Hurlstone Park	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9066693	151.1266197	1		install new kerb ramp - pair	HP6	Primary	HIGH	\$ 5,000
CD965	Old Canterbury Road	Hurlstone Park	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9062482	151.1270641	1		install new kerb ramp - pair	HP6	Primary	HIGH	\$ 5,000
CD979	Balmain Road	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp	-33.8782394	151.1596979	1		install new kerb ramp	LH13	Primary	HIGH	\$ 2,500
CD981	Balmain Road	Leichhardt	Local Road		crossing deficiency	missing kerb ramp	-33.8791034	151.1594889	1		install new kerb ramp	LH12	Primary	HIGH	\$ 2,500
CD982	Balmain Road	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8797321	151.1592964	1		install new tgsi - pair	LH11	Primary	HIGH	\$ 1,300
CD983	Balmain Road	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.881095	151.1589229	1		install new kerb ramp	LH10	Primary	HIGH	\$ 2,500
CD984	Balmain Road	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8797966	151.1593122	1		install new kerb ramp - pair	LH11	Primary	HIGH	\$ 5,000
CD985	Balmain Road	Leichhardt	Local Road		crossing deficiency	driveway as kerb ramp	-33.8817216	151.1588778	1		further investigation required	LH21	Primary	HIGH	-
CD986	Balmain Road	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8826834	151.1589652	1		install new kerb ramp	LH21	Primary	HIGH	\$ 2,500
CD987	Balmain Road	Leichhardt	Local Road		crossing deficiency	missing kerb ramp	-33.8826841	151.1589142	1		install new kerb ramp	LH21	Primary	HIGH	\$ 2,500
CD988	Balmain Road	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8827361	151.1589898	1		install new kerb ramp	LH17	Primary	HIGH	\$ 2,500
CD989	Balmain Road	Leichhardt	Local Road		crossing deficiency	missing kerb ramp	-33.8826826	151.1589839	1		install new kerb ramp	LH21	Primary	HIGH	\$ 2,500
CD990	Balmain Road	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8837799	151.1590078	1		install new kerb ramp - pair	LH9	Primary	HIGH	\$ 5,000
CD991	Balmain Road	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8850788	151.159123	1		install new kerb ramp	LH20	Primary	HIGH	\$ 2,500
CD992	Balmain Road	Leichhardt	Local Road		crossing deficiency	steep kerb ramp	-33.8850672	151.1591387	1		install new kerb ramp - pair	LH20	Primary	HIGH	\$ 5,000
CD994	Balmain Road	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp	-33.8874364	151.1591948	1		install new kerb ramp	LH18	Primary	HIGH	\$ 2,500
CD995	Balmain Road	Leichhardt	Local Road		crossing deficiency	driveway as kerb ramp	-33.8873518	151.1591734	1		no action	LH18	Primary	HIGH	\$ -
CD996	Balmain Road	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8870311	151.1592163	1		install new kerb ramp - pair	LH18	Primary	HIGH	\$ 5,000
CD1011	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	missing crossing point	-33.880067	151.1638174	1		install new kerb ramp - pair	LH24	Primary	HIGH	\$ 5,000
CD1012	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8792844	151.1640916	1		install new kerb ramp	LH24	Primary	HIGH	\$ 2,500
CD1013	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8792307	151.1640926	1		install new kerb ramp	LH107	Primary	HIGH	\$ 2,500
CD1014	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8792337	151.1641132	1		install new kerb ramp	LH107	Primary	HIGH	\$ 2,500
CD1015	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp construction	-33.8791904	151.1642827	1		install new kerb ramp	LH108	Primary	HIGH	\$ 2,500
CD1019	Darley Road	Leichhardt	State Road		crossing deficiency	poor kerb ramp alignment	-33.8751936	151.1553252	1		install new kerb ramp	LH114	Primary	HIGH	\$ 2,500
CD1035	Derbyshire Road	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8810975	151.158805	1		install new kerb ramp - pair	LH44	Primary	HIGH	\$ 5,000
CD1055	Elswick Street	Leichhardt	Local Road		crossing deficiency	traffic post narrows kerb ramp	-33.8842485	151.1499389	1		refer to Transport for NSW	LH95	Primary	HIGH	\$ -
CD1056	Elswick Street	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp	-33.8842201	151.1476415	1		install new kerb ramp	LH94	Primary	HIGH	\$ 2,500
CD1057	Elswick Street	Leichhardt	Local Road		crossing deficiency	missing kerb ramp	-33.8841954	151.1476604	1		install new kerb ramp	LH94	Primary	HIGH	\$ 2,500
CD1066	Flood Street	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp	-33.8898135	151.1489798	1		install new kerb ramp	LH135	Primary	HIGH	\$ 2,500
CD1071	Flood Street	Leichhardt	Local Road		crossing deficiency	narrow kerb ramp	-33.8856905	151.1497494	1		install new kerb ramp	LH89	Primary	HIGH	\$ 2,500
CD1082	Foster Street	Leichhardt	State Road		crossing deficiency	at grade crossing missing tgsi	-33.8853102	151.1476873	1		install new tgsi	LH68	Primary	HIGH	\$ 650
CD1096	Marion Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8835728	151.1589393	1		install new kerb ramp - pair	LH102	Primary	HIGH	\$ 5,000
CD1097	Marion Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.883871	151.156191	1		install new kerb ramp	LH101	Primary	HIGH	\$ 2,500
CD1098	Marion Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8857931	151.1548949	1		install new kerb ramp	LH100	Primary	HIGH	\$ 2,500
CD1105	Marion Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8841564	151.1499701	1		install new kerb ramp	LH95	Primary	HIGH	\$ 2,500
CD1106	Marion Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8841304	151.1487551	1		install new kerb ramp - pair	LH95	Primary	HIGH	\$ 5,000
CD1107	Marion Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8841453	151.1476543	1		install new kerb ramp	LH94	Primary	HIGH	\$ 2,500
CD1108	Marion Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	narrow kerb ramp	-33.8842112	151.1475726	1		install new kerb ramp	LH72	Primary	HIGH	\$ 2,500
CD1109	Marion Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8841301	151.1475341	1		install new kerb ramp	LH71	Primary	HIGH	\$ 2,500
CD1111	Moore Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8793094	151.1641581	1		install new kerb ramp	LH108	Primary	HIGH	\$ 2,500
CD1112	Moore Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8793115	151.1641376	1		install new kerb ramp	LH24	Primary	HIGH	\$ 2,500
CD1116	Moore Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8791604	151.163623	1		install new kerb ramp - pair	LH107	Primary	HIGH	\$ 5,000
CD1122	Norton Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8838555	151.1570859	1		install new kerb ramp - pair	LH128	Primary	HIGH	\$ 5,000
CD1123	Norton Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8837707	151.1571565	1		install new kerb ramp - pair	LH103	Primary	HIGH	\$ 5,000
CD1124	Norton Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8837119	151.1570664	1		install new kerb ramp - pair	LH119	Primary	HIGH	\$ 5,000
CD1125	Norton Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8837492	151.1570157	1		install new kerb ramp - pair	LH101	Primary	HIGH	\$ 5,000
CD1126	Norton Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8838575	151.1570361	1		install new kerb ramp	LH128	Primary	HIGH	\$ 2,500
CD1127	Norton Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8820043	151.1568091	1		install new tgsi	LH121	Primary	HIGH	\$ 650
CD1128	Norton Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8808876	151.156716	1		install new tgsi	LH122	Primary	HIGH	\$ 650
CD1129	Norton Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8800585	151.1566758	1		install new kerb ramp - pair	LH122	Primary	HIGH	\$ 5,000
CD1132	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8878797	151.1613673	1		install new kerb ramp	LH145	Primary	HIGH	\$ 2,500
CD1133	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8898301	151.1465807	1		install new kerb ramp	LH132	Primary	HIGH	\$ 2,500
CD1135	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8881623	151.1577237	1		install new kerb ramp - pair	LH142	Primary	HIGH	\$ 5,000
CD1136	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8878931	151.1612424	1		install new kerb ramp - pair	LH144	Primary	HIGH	\$ 5,000
CD1137	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8877464	151.16008	1		install new kerb ramp - pair	LH143	Primary	HIGH	\$ 5,000
CD1138	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8877815	151.1592855	1		install new kerb ramp - pair	LH18	Primary	HIGH	\$ 5,000
CD1139	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.887877	151.1590669	1		install new kerb ramp - pair	LH142	Primary	HIGH	\$ 5,000
CD1140	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.888066	151.157645	1		install new kerb ramp - pair	LH115	Primary	HIGH	\$ 5,000
CD1141	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8881627	151.1575143	1		install new kerb ramp - pair	LH141	Primary	HIGH	\$ 5,000
CD1142	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8883117	151.1568184	1		install new kerb ramp - pair	LH141	Primary	HIGH	\$ 5,000
CD1143	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8886005	151.1553199	1		install new kerb ramp - pair	LH139	Primary	HIGH	\$ 5,000

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD1144	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8889911	151.1531453	1		install new kerb ramp - pair	LH138	Primary	HIGH	\$ 5,000
CD1145	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8893785	151.1509962	1		install new kerb ramp - pair	LH136	Primary	HIGH	\$ 5,000
CD1148	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8899766	151.1474777	1		install new kerb ramp - pair	LH133	Primary	HIGH	\$ 5,000
CD1149	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8899119	151.1468717	1		install new kerb ramp - pair	LH133	Primary	HIGH	\$ 5,000
CD1155	Renwick Street	Leichhardt	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8879721	151.1567067	1		install new kerb ramp - pair	LH141	Primary	HIGH	\$ 5,000
CD1180	William Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8772026	151.1599566	1		install new kerb ramp - pair	LH13	Primary	HIGH	\$ 5,000
CD1199	Hudson Street	Lewisham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8940196	151.1439948	1		install new kerb ramp	LW5	Primary	HIGH	\$ 2,500
CD1200	Hudson Street	Lewisham	Local Road		crossing deficiency	missing kerb ramp	-33.8940291	151.1439263	1		install new kerb ramp	LW5	Primary	HIGH	\$ 2,500
CD1201	Hudson Street	Lewisham	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8937148	151.1439035	1		install new tgsi	LW5	Primary	HIGH	\$ 650
CD1202	Hunter Street	Lewisham	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8968481	151.1493604	1		install new kerb ramp	LW11	Primary	HIGH	\$ 2,500
CD1208	Hunter Street	Lewisham	Local Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8944679	151.1487091	1		install new kerb ramp	LW7	Primary	HIGH	\$ 2,500
CD1209	Hunter Street	Lewisham	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8937605	151.1483781	1		install new kerb ramp	LW24	Primary	HIGH	\$ 2,500
CD1210	New Canterbury Road	Lewisham	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.897633	151.1470276	1		install new kerb ramp	LW14	Primary	HIGH	\$ 2,500
CD1211	New Canterbury Road	Lewisham	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.89686	151.1492869	1		install new kerb ramp	LW11	Primary	HIGH	\$ 2,500
CD1212	New Canterbury Road	Lewisham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8969229	151.1493331	1		install new kerb ramp - pair	LW38	Primary	HIGH	\$ 5,000
CD1213	New Canterbury Road	Lewisham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.896847	151.1493514	1		install new kerb ramp	LW11	Primary	HIGH	\$ 2,500
CD1214	New Canterbury Road	Lewisham	State Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.8999326	151.1450294	1		re-construct refuge island	LW17	Primary	HIGH	\$ 15,000
CD1215	New Canterbury Road	Lewisham	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8973045	151.1493138	1		install new tgsi	LW38	Primary	HIGH	\$ 650
CD1218	Old Canterbury Road	Lewisham	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8941631	151.1451677	1		install new kerb ramp - pair	LW19	Primary	HIGH	\$ 5,000
CD1219	Old Canterbury Road	Lewisham	State Road		crossing deficiency	poor kerb ramp alignment	-33.8948839	151.1446058	1		install new kerb ramp	LW19	Primary	HIGH	\$ 2,500
CD1220	Old Canterbury Road	Lewisham	State Road		crossing deficiency	missing kerb ramp	-33.8954184	151.1454388	1		install new kerb ramp	LW36	Primary	HIGH	\$ 2,500
CD1226	Parramatta Road	Lewisham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8899977	151.1464787	1		install new kerb ramp - pair	LH132	Primary	HIGH	\$ 5,000
CD1227	Parramatta Road	Lewisham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8901576	151.1474839	1		install new kerb ramp - pair	LH133	Primary	HIGH	\$ 5,000
CD1229	Railway Terrace	Lewisham	State Road	Strategic Route	crossing deficiency	narrow pedestrian waiting area	-33.8940309	151.1497961	1		refer to Transport for NSW	LW23	Primary	HIGH	\$ -
CD1231	Thomas Street	Lewisham	Local Road	Strategic Route	crossing deficiency	missing crossing point	-33.8916754	151.1479948	1		install new kerb ramp - pair	LW33	Primary	HIGH	\$ 5,000
CD1233	Toothill Street	Lewisham	Regional Road		crossing deficiency	missing kerb ramp	-33.8955544	151.1450633	1		install new kerb ramp	LW36	Primary	HIGH	\$ 2,500
CD1234	Toothill Street	Lewisham	Regional Road		crossing deficiency	missing kerb ramp	-33.8955266	151.1451141	1		install new kerb ramp	LW36	Primary	HIGH	\$ 2,500
CD1235	Toothill Street	Lewisham	Regional Road		crossing deficiency	at grade crossing missing tgsi	-33.8963455	151.1456735	1		install new tgsi	LW37	Primary	HIGH	\$ 650
CD1239	Toothill Street	Lewisham	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8975852	151.1471063	1		install new kerb ramp	LW13	Primary	HIGH	\$ 2,500
CD1240	Toothill Street	Lewisham	Regional Road		crossing deficiency	narrow kerb ramp	-33.8975841	151.1471203	1		install new kerb ramp	LW13	Primary	HIGH	\$ 2,500
CD1243	Trafalgar Street	Lewisham	Regional Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8935725	151.1477279	1		install new tgsi - pair	LW24	Primary	HIGH	\$ 1,300
CD1244	Trafalgar Street	Lewisham	Regional Road		crossing deficiency	narrow kerb ramp	-33.8929773	151.1459461	1		install new kerb ramp	LW26	Primary	HIGH	\$ 2,500
CD1245	Trafalgar Street	Lewisham	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8929118	151.1458769	1		install new kerb ramp	LW22	Primary	HIGH	\$ 2,500
CD1248	Trafalgar Street	Lewisham	Regional Road		crossing deficiency	misaligned kerb ramp	-33.8929254	151.1449628	1		install new kerb ramp	LW27	Primary	HIGH	\$ 2,500
CD1253	West Street	Lewisham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8903522	151.1488674	1		install new kerb ramp	LW31	Primary	HIGH	\$ 2,500
CD1254	West Street	Lewisham	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8904726	151.1489284	1		install new kerb ramp - pair	LW31	Primary	HIGH	\$ 5,000
CD1255	Balmain Road	Lilyfield	Local Road		crossing deficiency	narrow kerb ramp	-33.8766218	151.160461	1		install new kerb ramp	LH14	Primary	HIGH	\$ 2,500
CD1256	Balmain Road	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8667777	151.1657025	1		install new kerb ramp	LF5	Primary	HIGH	\$ 2,500
CD1257	Balmain Road	Lilyfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8664647	151.16609	1		install new tgsi	LF3	Primary	HIGH	\$ 650
CD1258	Balmain Road	Lilyfield	Local Road		crossing deficiency	missing kerb ramp	-33.8664291	151.1659502	1		install new kerb ramp	LF3	Primary	HIGH	\$ 2,500
CD1259	Balmain Road	Lilyfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8666416	151.1657105	1		install new tgsi	LF3	Primary	HIGH	\$ 650
CD1260	Balmain Road	Lilyfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8678252	151.1646478	1		install new tgsi	LF4	Primary	HIGH	\$ 650
CD1261	Balmain Road	Lilyfield	Local Road		crossing deficiency	long crossing	-33.8675958	151.1649286	1		install kerb extension	LF5	Primary	HIGH	\$ 10,000
CD1262	Balmain Road	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8695348	151.1627357	1		install new kerb ramp - pair	LF2	Primary	HIGH	\$ 5,000
CD1265	Balmain Road	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8707406	151.1613923	1		install new kerb ramp - pair	LF7	Primary	HIGH	\$ 5,000
CD1266	Balmain Road	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8711385	151.1609916	1		install new kerb ramp - pair	LF7	Primary	HIGH	\$ 5,000
CD1267	Balmain Road	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8715527	151.1597166	1		install new kerb ramp - pair	LF6	Primary	HIGH	\$ 5,000
CD1269	Balmain Road	Lilyfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8712719	151.1605054	1		install new tgsi	LF6	Primary	HIGH	\$ 650
CD1270	Balmain Road	Lilyfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8708507	151.161068	1		install new tgsi	LF7	Primary	HIGH	\$ 650
CD1272	Balmain Road	Lilyfield	Local Road		crossing deficiency	missing kerb ramp	-33.8737327	151.1603914	1		install new kerb ramp	LF9	Primary	HIGH	\$ 2,500
CD1273	Balmain Road	Lilyfield	Local Road		crossing deficiency	missing kerb ramp	-33.8729177	151.1600518	1		install new kerb ramp	LF9	Primary	HIGH	\$ 2,500
CD1274	Balmain Road	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8726624	151.1600338	1		install new kerb ramp	LF10	Primary	HIGH	\$ 2,500
CD1275	Balmain Road	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8731561	151.1601643	1		install new kerb ramp	LF9	Primary	HIGH	\$ 2,500
CD1276	Balmain Road	Lilyfield	Local Road		crossing deficiency	raised kerb ramp lip	-33.871968	151.1599948	1		install new kerb ramp	LF10	Primary	HIGH	\$ 2,500
CD1277	Balmain Road	Lilyfield	Local Road		crossing deficiency	missing crossing point	-33.8724774	151.159942	1		install new kerb ramp - pair	LF10	Primary	HIGH	\$ 5,000
CD1279	Catherine Street	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8765323	151.1648631	1		install new kerb ramp - pair	LF39	Primary	HIGH	\$ 5,000
CD1283	City West Link Bridge	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.874937	151.1561107	1		install new kerb ramp	LH114	Primary	HIGH	\$ 2,500
CD1284	City West Link Bridge	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8749333	151.1561168	1		install new kerb ramp	LH114	Primary	HIGH	\$ 2,500
CD1285	City West Link Bridge	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8749028	151.1558705	1		install new kerb ramp	LH114	Primary	HIGH	\$ 2,500
CD1288	Darley Road	Lilyfield	State Road		crossing deficiency	poor kerb ramp alignment	-33.875036	151.1552832	1		install new kerb ramp	LH114	Primary	HIGH	\$ 2,500
CD1314	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8733262	151.1644304	1		install new kerb ramp - pair	LF68	Primary	HIGH	\$ 5,000
CD1316	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8736297	151.1626391	1		install new kerb ramp	LF70	Primary	HIGH	\$ 2,500
CD1317	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8732684	151.1642572	1		install new kerb ramp	LF68	Primary	HIGH	\$ 2,500
CD1323	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8737553	151.1559427	1		install new kerb ramp - pair	LF65	Primary	HIGH	\$ 5,000
CD1324	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	missing refuge island	-33.8737478	151.1559728	1		install new refuge island	LF65	Primary	HIGH	\$ 15,000
CD1333	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8737438	151.156417	1		install new kerb ramp	LF65	Primary	HIGH	\$ 2,500
CD1351	Norton Street	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8751589	151.1559547	1		install new kerb ramp	LH114	Primary	HIGH	\$ 2,500
CD1352	Norton Street	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.875128	151.1559602	1		install new kerb ramp	LH114	Primary	HIGH	\$ 2,500
CD1362	Piper Street	Lilyfield	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8764871	151.1648868	1		install new kerb ramp - pair	LF40	Primary	HIGH	\$ 5,000
CD1379	Addison Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9022103	151.1635119	1		install new kerb ramp	MV8	Primary	HIGH	\$ 2,500
CD1397	Calvert Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9137207	151.1588509	1		install new tgsi - pair	MV226	Primary	HIGH	\$ 1,300
CD1424	Dudley Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9114476	151.1422221	1		install new kerb ramp	MV46	Primary	HIGH	\$ 2,500
CD1427	Edgeware Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9055591	151.173464	1		install new tgsi	MV47	Primary	HIGH	\$ 650
CD1428	Edinburgh Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9056686	151.1671138	1		install new kerb ramp	MV213	Primary	HIGH	\$ 2,500
CD1431	Enmore Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9034086	151.1688445	1		install new kerb ramp - pair	MV61	Primary	HIGH	\$ 5,000
CD1432	Enmore Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9031918	151.1689623	1		install new kerb ramp	MV62	Primary	HIGH	\$ 2,500
CD1433	Enmore Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9029923	151.1688799	1		install new kerb ramp	MV62	Primary	HIGH	\$ 2,500
CD1434	Enmore Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9025131	151.1693681	1		install new kerb ramp	MV62	Primary	HIGH	\$ 2,500
CD1436	Enmore Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9041891	151.168359	1		install new kerb ramp	MV59	Primary	HIGH	\$ 2,500
CD1437	Enmore Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9056665	151.1673935	1		install new kerb ramp	MV213	Primary	HIGH	\$ 2,500
CD1439	Ewart Street	Marrickville	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9120679	151.1399878	1		install new kerb ramp - pair	MV237	Primary	HIGH	\$ 5,000
CD1440	Ewart Street	Marrickville	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9121162	151.140145	1		install new kerb ramp - pair	MV66	Primary	HIGH	\$ 5,000

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD1441	Ewart Street	Marrickville	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9128235	151.1408134	1		install new kerb ramp - pair	MV67	Primary	HIGH	\$ 5,000
CD1445	Ewart Street	Marrickville	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9135639	151.1418293	1		install new tgsi - pair	MV65	Primary	HIGH	\$ 1,300
CD1446	Ewart Street	Marrickville	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9128872	151.1410593	1		install new tgsi - pair	MV67	Primary	HIGH	\$ 1,300
CD1447	Ewart Street	Marrickville	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9123825	151.1405639	1		install new kerb ramp - pair	MV66	Primary	HIGH	\$ 5,000
CD1448	Ewart Street	Marrickville	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9120654	151.1401741	1		install new kerb ramp - pair	MV238	Primary	HIGH	\$ 5,000
CD1473	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9101708	151.1566333	1		install new tgsi - pair	MV88	Primary	HIGH	\$ 1,300
CD1475	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.914347	151.1526254	1		install new kerb ramp	MV230	Primary	HIGH	\$ 2,500
CD1476	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9143571	151.152771	1		install new kerb ramp	MV189	Primary	HIGH	\$ 2,500
CD1482	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9124785	151.1433695	1		install new kerb ramp - pair	MV103	Primary	HIGH	\$ 5,000
CD1483	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9216361	151.1432699	1		install new kerb ramp	MV103	Primary	HIGH	\$ 2,500
CD1484	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9216405	151.1434031	1		install new tgsi - pair	MV103	Primary	HIGH	\$ 1,300
CD1487	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9172329	151.1487486	1		install new kerb ramp - pair	MV98	Primary	HIGH	\$ 5,000
CD1488	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9154113	151.1511937	1		install new kerb ramp - pair	MV94	Primary	HIGH	\$ 5,000
CD1489	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.914967	151.1519108	1		install new kerb ramp - pair	MV94	Primary	HIGH	\$ 5,000
CD1490	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.914745	151.1523816	1		install new kerb ramp - pair	MV93	Primary	HIGH	\$ 5,000
CD1491	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9151108	151.1517383	1		install new kerb ramp - pair	MV94	Primary	HIGH	\$ 5,000
CD1492	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9126767	151.1540942	1		install new kerb ramp - pair	MV90	Primary	HIGH	\$ 5,000
CD1493	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9124458	151.154119	1		install new kerb ramp - pair	MV90	Primary	HIGH	\$ 5,000
CD1494	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.911826	151.1549464	1		install new kerb ramp	MV90	Primary	HIGH	\$ 2,500
CD1495	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9104958	151.1563256	1		install new kerb ramp - pair	MV140	Primary	HIGH	\$ 5,000
CD1496	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9108855	151.1561133	1		install new tgsi - pair	MV89	Primary	HIGH	\$ 1,300
CD1497	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9128637	151.1537978	1		install new kerb ramp - pair	MV91	Primary	HIGH	\$ 5,000
CD1498	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	uneven crossing surface	-33.9129985	151.1538239	1		install new pavement surface	MV91	Primary	HIGH	\$ 300
CD1499	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	missing crossing point	-33.911641	151.1552486	1		install new kerb ramp - pair	MV90	Primary	HIGH	\$ 5,000
CD1501	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9014739	151.1534841	1		install new kerb ramp	PE27	Primary	HIGH	\$ 2,500
CD1502	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9014831	151.1534911	1		install new kerb ramp	PE27	Primary	HIGH	\$ 2,500
CD1504	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	steep kerb ramp	-33.9059697	151.1532244	1		install new kerb ramp - pair	MV113	Primary	HIGH	\$ 5,000
CD1505	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	steep roadway crossing point	-33.9067679	151.153026	1		no action	MV114	Primary	HIGH	\$ -
CD1507	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9086656	151.1525131	1		install new kerb ramp	MV138	Primary	HIGH	\$ 2,500
CD1508	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9087805	151.1524673	1		install new kerb ramp - pair	MV138	Primary	HIGH	\$ 5,000
CD1509	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9084489	151.1524363	1		install new tgsi - pair	MV107	Primary	HIGH	\$ 1,300
CD1511	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9063146	151.1529361	1		install new tgsi - pair	MV113	Primary	HIGH	\$ 1,300
CD1514	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.9048195	151.1531017	1		re-construct refuge island	MV111	Primary	HIGH	\$ 15,000
CD1515	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9016462	151.1533667	1		install new kerb ramp	MV108	Primary	HIGH	\$ 2,500
CD1516	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9015399	151.153318	1		install new kerb ramp	MV108	Primary	HIGH	\$ 2,500
CD1519	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	missing crossing point	-33.9137231	151.1465873	1		install new kerb ramp - pair	MV117	Primary	HIGH	\$ 5,000
CD1520	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9107597	151.1497721	1		install new tgsi - pair	MV121	Primary	HIGH	\$ 1,300
CD1521	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.911171	151.1488707	1		install new tgsi - pair	MV106	Primary	HIGH	\$ 1,300
CD1522	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9114489	151.1485796	1		install new kerb ramp - pair	MV122	Primary	HIGH	\$ 5,000
CD1523	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	long crossing	-33.9114339	151.1484957	1		install kerb extension - pair	MV122	Primary	HIGH	\$ 20,000
CD1524	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9121008	151.1478624	1		install new tgsi - pair	MV116	Primary	HIGH	\$ 1,300
CD1525	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9127523	151.1472123	1		install new tgsi	MV116	Primary	HIGH	\$ 650
CD1527	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9125727	151.1475543	1		install new tgsi	MV116	Primary	HIGH	\$ 650
CD1528	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9120287	151.1480871	1		install new tgsi	MV122	Primary	HIGH	\$ 650
CD1529	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9120005	151.1481137	1		install new kerb ramp	MV122	Primary	HIGH	\$ 2,500
CD1530	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.910797	151.1498347	1		install new kerb ramp	MV121	Primary	HIGH	\$ 2,500
CD1531	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9105351	151.1504893	1		install new kerb ramp	MV120	Primary	HIGH	\$ 2,500
CD1532	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9086957	151.152205	1		install new kerb ramp - pair	MV145	Primary	HIGH	\$ 5,000
CD1533	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9104428	151.1505418	1		install new kerb ramp	MV120	Primary	HIGH	\$ 2,500
CD1540	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9087812	151.1524577	1		install new kerb ramp	MV138	Primary	HIGH	\$ 2,500
CD1541	Marrickville Road	Marrickville	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.9086755	151.1523806	1		install new kerb ramp	MV138	Primary	HIGH	\$ 2,500
CD1545	Marrickville Road	Marrickville	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.9085778	151.1523686	1		install new kerb ramp	MV107	Primary	HIGH	\$ 2,500
CD1546	Marrickville Road	Marrickville	Regional Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9144173	151.1633147	1		install new tgsi - pair	MV130	Primary	HIGH	\$ 1,300
CD1547	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9135162	151.1621535	1		install new kerb ramp	MV129	Primary	HIGH	\$ 2,500
CD1548	Marrickville Road	Marrickville	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.913449	151.1619229	1		install new kerb ramp - pair	MV129	Primary	HIGH	\$ 5,000
CD1549	Marrickville Road	Marrickville	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.9124081	151.1601483	1		install new kerb ramp	MV132	Primary	HIGH	\$ 2,500
CD1550	Marrickville Road	Marrickville	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.9123309	151.1599938	1		install new kerb ramp - pair	MV136	Primary	HIGH	\$ 5,000
CD1551	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9112956	151.1580772	1		install new kerb ramp	MV135	Primary	HIGH	\$ 2,500
CD1552	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9112962	151.1578968	1		install new kerb ramp	MV135	Primary	HIGH	\$ 2,500
CD1553	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9110609	151.1576254	1		install new kerb ramp	MV135	Primary	HIGH	\$ 2,500
CD1554	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp - pair	-33.9105034	151.1565578	1		install new kerb ramp - pair	MV134	Primary	HIGH	\$ 5,000
CD1555	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9105589	151.1564852	1		install new kerb ramp	MV134	Primary	HIGH	\$ 2,500
CD1556	Marrickville Road	Marrickville	Regional Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9100477	151.1554262	1		install new tgsi - pair	MV140	Primary	HIGH	\$ 1,300
CD1557	Marrickville Road	Marrickville	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.9097085	151.1544185	1		install new kerb ramp - pair	MV137	Primary	HIGH	\$ 5,000
CD1558	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9095742	151.1543216	1		install new kerb ramp	MV139	Primary	HIGH	\$ 2,500
CD1559	Marrickville Road	Marrickville	Regional Road		crossing deficiency	at grade crossing missing tgsi	-33.9095721	151.1542351	1		install new tgsi	MV139	Primary	HIGH	\$ 650
CD1560	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9088456	151.1529554	1		install new kerb ramp	MV138	Primary	HIGH	\$ 2,500
CD1561	Marrickville Road	Marrickville	Regional Road		crossing deficiency	major driveway crossing missing tgsi - pair	-33.9089577	151.1532424	1		install new tgsi	MV138	Primary	HIGH	\$ 650
CD1562	Marrickville Road	Marrickville	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9095658	151.1543294	1		install new kerb ramp - pair	MV139	Primary	HIGH	\$ 5,000
CD1563	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9097347	151.1544445	1		install new kerb ramp	MV137	Primary	HIGH	\$ 2,500
CD1564	Marrickville Road	Marrickville	Regional Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9097637	151.1545821	1		install new tgsi - pair	MV137	Primary	HIGH	\$ 1,300
CD1565	Marrickville Road	Marrickville	Regional Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.910171	151.1554758	1		install new tgsi - pair	MV140	Primary	HIGH	\$ 1,300
CD1566	Marrickville Road	Marrickville	Regional Road		crossing deficiency	shallow kerb ramp	-33.9105342	151.1562759	1		install new kerb ramp	MV140	Primary	HIGH	\$ 2,500
CD1567	Marrickville Road	Marrickville	Regional Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9111756	151.157155	1		install new tgsi - pair	MV134	Primary	HIGH	\$ 1,300
CD1568	Marrickville Road	Marrickville	Regional Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9109462	151.1572655	1		install new tgsi - pair	MV134	Primary	HIGH	\$ 1,300
CD1569	Marrickville Road	Marrickville	Regional Road		crossing deficiency	at grade crossing missing tgsi	-33.9112748	151.1581317	1		install new tgsi	MV135	Primary	HIGH	\$ 650
CD1570	Marrickville Road	Marrickville	Regional Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9112876	151.1583009	1		install new tgsi - pair	MV135	Primary	HIGH	\$ 1,300
CD1571	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9121727	151.1600518	1		install new kerb ramp	MV136	Primary	HIGH	\$ 2,500
CD1572	Marrickville Road	Marrickville	Regional Road		crossing deficiency	narrow refuge island	-33.9121869	151.1600738	1		install new corner refuge island	MV136	Primary	HIGH	\$ 10,000
CD1573	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.912378	151.1601666	1		install new kerb ramp	MV132	Primary	HIGH	\$ 2,500
CD1574	Marrickville Road	Marrickville	Regional Road		crossing deficiency	narrow refuge island	-33.9122595	151.1602391	1		install new corner refuge island	MV220	Primary	HIGH	\$ 10,000
CD1575	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9122626	151.1602637	1		install new kerb ramp	MV220	Primary	HIGH	\$ 2,500

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD1576	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned refuge island	-33.9134034	151.1619925	1		re-construct refuge island	MV129	Primary	HIGH	\$ 15,000
CD1577	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp - pair	-33.9138229	151.1626158	1		install new kerb ramp - pair	MV129	Primary	HIGH	\$ 5,000
CD1578	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp - pair	-33.9150713	151.1645869	1		install new kerb ramp - pair	MV131	Primary	HIGH	\$ 5,000
CD1579	Marrickville Road	Marrickville	Regional Road		crossing deficiency	missing crossing point	-33.9116079	151.1552625	1		install new kerb ramp - pair	MV90	Primary	HIGH	\$ 5,000
CD1580	Marrickville Road	Marrickville	Regional Road		crossing deficiency	long crossing	-33.9134642	151.1621448	1		review when land use changes	MV129	Primary	HIGH	-
CD1581	Marrickville Road	Marrickville	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.9105431	151.1563094	1		install new kerb ramp	MV89	Primary	HIGH	\$ 2,500
CD1582	Marrickville Road	Marrickville	Regional Road		crossing deficiency	missing kerb ramp	-33.9085872	151.1523961	1		install new kerb ramp	MV107	Primary	HIGH	\$ 2,500
CD1583	Marrickville Road	Marrickville	Regional Road		crossing deficiency	missing kerb ramp	-33.9123931	151.1601182	1		install new kerb ramp	MV132	Primary	HIGH	\$ 2,500
CD1584	Murray Street	Marrickville	Local Road		crossing deficiency	missing crossing point	-33.9060606	151.1732762	1		install new kerb ramp - pair	MV47	Primary	HIGH	\$ 5,000
CD1587	Murray Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9072146	151.1726672	1		install new tgsi	MV49	Primary	HIGH	\$ 650
CD1588	Murray Street	Marrickville	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.907596	151.1725906	1		install new kerb ramp - pair	MV49	Primary	HIGH	\$ 5,000
CD1618	Railway Parade	Marrickville	Local Road		crossing deficiency	misaligned kerb ramp	-33.9138878	151.1665314	1		install new kerb ramp	MV165	Primary	HIGH	\$ 2,500
CD1640	Smidmore Street	Marrickville	Local Road		crossing deficiency	long crossing point	-33.9076885	151.1726079	1		install kerb extension - pair	MV49	Primary	HIGH	\$ 20,000
CD1642	Station Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9142374	151.1528806	1		install new kerb ramp - pair	MV189	Primary	HIGH	\$ 5,000
CD1645	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.909686	151.1623471	1		install new kerb ramp	MV200	Primary	HIGH	\$ 2,500
CD1646	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9097884	151.1622023	1		install new kerb ramp	MV219	Primary	HIGH	\$ 2,500
CD1656	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9052862	151.1570943	1		install new tgsi	MV197	Primary	HIGH	\$ 650
CD1657	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	long crossing point	-33.9057359	151.157333	1		install kerb extension - pair	MV197	Primary	HIGH	\$ 20,000
CD1658	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9040479	151.1559284	1		install new tgsi	MV190	Primary	HIGH	\$ 650
CD1659	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9034036	151.1552873	1		install new tgsi	MV190	Primary	HIGH	\$ 650
CD1660	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9033552	151.1552417	1		install new tgsi - pair	MV190	Primary	HIGH	\$ 1,300
CD1661	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9033652	151.155103	1		install new tgsi	MV190	Primary	HIGH	\$ 650
CD1662	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	long crossing point	-33.9024525	151.1542468	1		install kerb extension - pair	MV199	Primary	HIGH	\$ 20,000
CD1663	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9023833	151.154106	1		install new kerb ramp	MV199	Primary	HIGH	\$ 2,500
CD1667	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.913383	151.1668227	1		install new tgsi - pair	MV165	Primary	HIGH	\$ 1,300
CD1668	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9127022	151.1660514	1		install new kerb ramp - pair	MV203	Primary	HIGH	\$ 5,000
CD1669	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	unsafe crossing point	-33.9125303	151.1658749	1		review and install pedestrian crossing	MV203	Primary	HIGH	\$ 50,000
CD1674	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9103485	151.1630867	1		install new kerb ramp - pair	MV200	Primary	HIGH	\$ 5,000
CD1680	Victoria Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9056954	151.1731986	1		install new tgsi	MV47	Primary	HIGH	\$ 650
CD1684	Victoria Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9097604	151.1622215	1		install new kerb ramp	MV200	Primary	HIGH	\$ 2,500
CD1685	Victoria Road	Marrickville	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.9097506	151.1621375	1		install new kerb ramp	MV219	Primary	HIGH	\$ 2,500
CD1686	Victoria Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9130677	151.1593015	1		install new tgsi - pair	MV225	Primary	HIGH	\$ 1,300
CD1687	Victoria Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9126986	151.1597658	1		install new kerb ramp - pair	MV225	Primary	HIGH	\$ 5,000
CD1688	Victoria Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.912606	151.159884	1		install new tgsi - pair	MV225	Primary	HIGH	\$ 1,300
CD1690	Victoria Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9143198	151.1583441	1		install new kerb ramp - pair	MV227	Primary	HIGH	\$ 5,000
CD1691	Victoria Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9121919	151.1600695	1		install new tgsi	MV136	Primary	HIGH	\$ 650
CD1692	Warburton Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9141949	151.152302	1		install new kerb ramp - pair	MV230	Primary	HIGH	\$ 5,000
CD1693	Warburton Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9138989	151.151797	1		install new tgsi	MV230	Primary	HIGH	\$ 650
CD1695	Warburton Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9139435	151.1522269	1		install new tgsi - pair	MV230	Primary	HIGH	\$ 1,300
CD1705	Wardell Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9112627	151.1413237	1		install new kerb ramp	MV46	Primary	HIGH	\$ 2,500
CD1709	Warren Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9158421	151.1500938	1		install new kerb ramp - pair	MV242	Primary	HIGH	\$ 5,000
CD1710	Warren Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9158272	151.1502686	1		install new kerb ramp - pair	MV95	Primary	HIGH	\$ 5,000
CD1711	Warren Road	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9163372	151.1510414	1		install new tgsi - pair	MV246	Primary	HIGH	\$ 1,300
CD1717	Warren Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9159654	151.1502345	1		install new kerb ramp - pair	MV246	Primary	HIGH	\$ 5,000
CD1718	Warren Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9159343	151.150334	1		install new kerb ramp - pair	MV246	Primary	HIGH	\$ 5,000
CD1740	Alice Street	Newtown	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.9048666	151.173315	1		install new kerb ramp	NE23	Primary	HIGH	\$ 2,500
CD1741	Australia Street	Newtown	Local Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8971837	151.178577	1		install new kerb ramp - pair	NE12	Primary	HIGH	\$ 5,000
CD1742	Australia Street	Newtown	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8960192	151.1780566	1		install new kerb ramp	NE13	Primary	HIGH	\$ 2,500
CD1743	Bedford Street	Newtown	Local Road		crossing deficiency	misaligned kerb ramp	-33.8975146	151.1780043	1		install new kerb ramp	NE15	Primary	HIGH	\$ 2,500
CD1750	Bedwin Road	Newtown	Regional Road		crossing deficiency	steep kerb ramp	-33.9074965	151.1744935	1		install new kerb ramp - pair	NE21	Primary	HIGH	\$ 5,000
CD1751	Edgeware Road	Newtown	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9048754	151.173284	1		install new kerb ramp	NE23	Primary	HIGH	\$ 2,500
CD1752	Edgeware Road	Newtown	Regional Road	Strategic Route	crossing deficiency	steep kerb ramp	-33.905064	151.1732924	1		install new kerb ramp - pair	NE24	Primary	HIGH	\$ 5,000
CD1753	Enmore Road	Newtown	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8984866	151.176463	1		install new kerb ramp - pair	NE35	Primary	HIGH	\$ 5,000
CD1754	Enmore Road	Newtown	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8985541	151.1764078	1		install new kerb ramp - pair	NE35	Primary	HIGH	\$ 5,000
CD1755	Enmore Road	Newtown	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8985266	151.1765009	1		install new kerb ramp - pair	NE35	Primary	HIGH	\$ 5,000
CD1756	Enmore Road	Newtown	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.898674	151.1752864	1		install new kerb ramp	NE36	Primary	HIGH	\$ 2,500
CD1759	Enmore Road	Newtown	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8987942	151.173933	1		install new kerb ramp	NE37	Primary	HIGH	\$ 2,500
CD1760	Enmore Road	Newtown	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8977057	151.1783987	1		install new kerb ramp	NE33	Primary	HIGH	\$ 2,500
CD1762	Holt Street	Newtown	Local Road		crossing deficiency	missing kerb ramp - pair	-33.9001551	151.1776243	1		install new kerb ramp - pair	NE38	Primary	HIGH	\$ 5,000
CD1764	King Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9027828	151.1793616	1		install new kerb ramp	NE52	Primary	HIGH	\$ 2,500
CD1765	King Street	Newtown	Local Road		crossing deficiency	misaligned kerb ramp	-33.9018431	151.1788102	1		install new kerb ramp	NE51	Primary	HIGH	\$ 2,500
CD1766	King Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9002134	151.178	1		install new kerb ramp	NE49	Primary	HIGH	\$ 2,500
CD1767	King Street	Newtown	Local Road		crossing deficiency	misaligned kerb ramp	-33.8988317	151.1778366	1		install new kerb ramp	NE48	Primary	HIGH	\$ 2,500
CD1768	King Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9066631	151.1813277	1		install new kerb ramp	NE22	Primary	HIGH	\$ 2,500
CD1769	King Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9059153	151.1810084	1		install new kerb ramp	NE57	Primary	HIGH	\$ 2,500
CD1770	King Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9058301	151.1809778	1		install new kerb ramp	NE56	Primary	HIGH	\$ 2,500
CD1771	King Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9051768	151.1806913	1		install new kerb ramp - pair	NE56	Primary	HIGH	\$ 5,000
CD1772	King Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9038924	151.1799509	1		install new kerb ramp	NE54	Primary	HIGH	\$ 2,500
CD1773	King Street	Newtown	Local Road		crossing deficiency	missing crossing point	-33.9029839	151.1795067	1		install new kerb ramp - pair	NE53	Primary	HIGH	\$ 5,000
CD1778	Lord Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9075986	151.1778756	1		install new kerb ramp	NE28	Primary	HIGH	\$ 2,500
CD1779	Lord Street	Newtown	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9068553	151.1807956	1		install new tgsi	NE22	Primary	HIGH	\$ 650
CD1780	Lord Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9067818	151.1808101	1		install new kerb ramp	NE22	Primary	HIGH	\$ 2,500
CD1795	Audley Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8946715	151.1541618	1		install new kerb ramp	PE46	Primary	HIGH	\$ 2,500
CD1796	Audley Street	Petersham	Local Road		crossing deficiency	misaligned kerb ramp	-33.8953005	151.1543108	1		install new kerb ramp	PE46	Primary	HIGH	\$ 2,500
CD1802	Crystal Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8940498	151.1572883	1		install new kerb ramp	PE60	Primary	HIGH	\$ 2,500
CD1808	Crystal Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.88925	151.1585283	1		install new kerb ramp	PE17	Primary	HIGH	\$ 2,500
CD1809	Crystal Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8883064	151.1589297	1		install new kerb ramp	PE12	Primary	HIGH	\$ 2,500
CD1810	Crystal Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8890767	151.1587267	1		install new kerb ramp	PE17	Primary	HIGH	\$ 2,500
CD1811	Crystal Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8906751	151.1585761	1		install new kerb ramp	PE16	Primary	HIGH	\$ 2,500
CD1816	Hunter Street	Petersham	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8971499	151.1507455	1		install new kerb ramp - pair	PE35	Primary	HIGH	\$ 5,000
CD1817	Livingstone Road	Petersham	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9005933	151.1535343	1		install new tgsi	PE27	Primary	HIGH	\$ 650
CD1821	Livingstone Road	Petersham	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8988473	151.1534432	1		install new kerb ramp	PE25	Primary	HIGH	\$ 2,500

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD1822	Livingstone Road	Petersham	State Road	Strategic Route	crossing deficiency	long crossing point	-33.9006196	151.1535328	1		install kerb extension / refuge island	PE27	Primary	HIGH	\$ 10,000
CD1823	New Canterbury Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8969692	151.1514006	1		install new kerb ramp	PE28	Primary	HIGH	\$ 2,500
CD1824	New Canterbury Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.896869	151.1513636	1		install new kerb ramp - pair	PE28	Primary	HIGH	\$ 5,000
CD1825	New Canterbury Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8961814	151.1541708	1		install new kerb ramp	PE38	Primary	HIGH	\$ 2,500
CD1826	New Canterbury Road	Petersham	State Road	Strategic Route	crossing deficiency	narrow kerb ramp	-33.8961822	151.1541856	1		install new kerb ramp	PE38	Primary	HIGH	\$ 2,500
CD1827	New Canterbury Road	Petersham	State Road	Strategic Route	crossing deficiency	narrow kerb ramp	-33.8962087	151.1541929	1		install new kerb ramp	PE31	Primary	HIGH	\$ 2,500
CD1828	New Canterbury Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8962142	151.1541026	1		install new kerb ramp	PE32	Primary	HIGH	\$ 2,500
CD1829	New Canterbury Road	Petersham	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8959303	151.1554272	1		install new kerb ramp	PE30	Primary	HIGH	\$ 2,500
CD1830	New Canterbury Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.896546	151.1524922	1		install new kerb ramp - pair	PE33	Primary	HIGH	\$ 5,000
CD1831	New Canterbury Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8965818	151.1524238	1		install new kerb ramp	PE34	Primary	HIGH	\$ 2,500
CD1832	New Canterbury Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8965935	151.1524379	1		install new kerb ramp - pair	PE34	Primary	HIGH	\$ 5,000
CD1833	New Canterbury Road	Petersham	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8970072	151.1514665	1		install new kerb ramp	PE28	Primary	HIGH	\$ 2,500
CD1834	New Canterbury Road	Petersham	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8967462	151.1521035	1		install new kerb ramp	PE34	Primary	HIGH	\$ 2,500
CD1835	New Canterbury Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8966173	151.1525193	1		install new kerb ramp - pair	PE23	Primary	HIGH	\$ 5,000
CD1836	New Canterbury Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8965857	151.1525723	1		install new kerb ramp	PE23	Primary	HIGH	\$ 2,500
CD1837	New Canterbury Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8962398	151.1541822	1		install new kerb ramp - pair	PE31	Primary	HIGH	\$ 5,000
CD1847	Palace Street	Petersham	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8927966	151.1543377	1		install new kerb ramp	PE43	Primary	HIGH	\$ 2,500
CD1848	Palace Street	Petersham	Local Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8928942	151.15434	1		install new kerb ramp	PE43	Primary	HIGH	\$ 2,500
CD1849	Palace Street	Petersham	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8931542	151.1541588	1		install new kerb ramp	PE44	Primary	HIGH	\$ 2,500
CD1850	Palace Street	Petersham	Local Road	Strategic Route	crossing deficiency	missing crossing point	-33.893363	151.1541288	1		install new kerb ramp - pair	PE44	Primary	HIGH	\$ 5,000
CD1853	Palace Street	Petersham	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8896712	151.1543276	1		install new kerb ramp	PE41	Primary	HIGH	\$ 2,500
CD1856	Palace Street	Petersham	Local Road	Strategic Route	crossing deficiency	missing crossing point	-33.889706	151.1543933	1		install new kerb ramp - pair	PE41	Primary	HIGH	\$ 5,000
CD1857	Parramatta Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8880422	151.1589318	1		install new kerb ramp - pair	LH142	Primary	HIGH	\$ 5,000
CD1858	Parramatta Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.889983	151.1491277	1		install new kerb ramp	LH135	Primary	HIGH	\$ 2,500
CD1859	Parramatta Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8899332	151.1491577	1		install new kerb ramp - pair	LH135	Primary	HIGH	\$ 5,000
CD1860	Parramatta Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8898288	151.1494939	1		install new kerb ramp - pair	LH135	Primary	HIGH	\$ 5,000
CD1861	Parramatta Road	Petersham	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8894572	151.151466	1		install new kerb ramp - pair	LH136	Primary	HIGH	\$ 5,000
CD1862	Parramatta Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8885789	151.1565896	1		install new kerb ramp - pair	LH140	Primary	HIGH	\$ 5,000
CD1863	Parramatta Road	Petersham	State Road	Strategic Route	crossing deficiency	bollard narrows crossing	-33.8884864	151.1566914	1		relocate bollard	LH141	Primary	HIGH	\$ 2,500
CD1864	Parramatta Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8878625	151.1602589	1		install new kerb ramp - pair	LH144	Primary	HIGH	\$ 5,000
CD1865	Parramatta Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8879715	151.1611966	1		install new kerb ramp	LH144	Primary	HIGH	\$ 2,500
CD1874	Stanmore Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8956572	151.1567755	1		install new kerb ramp	PE29	Primary	HIGH	\$ 2,500
CD1876	Stanmore Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8967019	151.1602091	1		install new kerb ramp - pair	PE55	Primary	HIGH	\$ 5,000
CD1877	Stanmore Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8965245	151.1609019	1		install new kerb ramp	PE55	Primary	HIGH	\$ 2,500
CD1878	Terminus Street	Petersham	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8935479	151.1543002	1		install new kerb ramp - pair	PE59	Primary	HIGH	\$ 5,000
CD1880	Terminus Street	Petersham	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8933958	151.157152	1		install new tgsi	PE58	Primary	HIGH	\$ 650
CD1883	Trafalgar Street	Petersham	Regional Road		crossing deficiency	missing crossing point	-33.8946833	151.1514473	1		install new kerb ramp - pair	PE22	Primary	HIGH	\$ 5,000
CD1884	Trafalgar Street	Petersham	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8948944	151.1527443	1		install new kerb ramp - pair	PE63	Primary	HIGH	\$ 5,000
CD1885	Trafalgar Street	Petersham	Regional Road		crossing deficiency	poor crossing alignment	-33.8946124	151.1540812	1		re-align crossing and refuge island	PE62	Primary	HIGH	\$ 6,000
CD1890	West Street	Petersham	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8923967	151.1498719	1		install new tgsi	LW42	Primary	HIGH	\$ 650
CD1896	Darling Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.863695	151.1701422	1		install new kerb ramp	RO24	Primary	HIGH	\$ 2,500
CD1897	Darling Street	Rozelle	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8631223	151.1704388	1		install new tgsi	RO24	Primary	HIGH	\$ 650
CD1898	Darling Street	Rozelle	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8622448	151.1709207	1		install new kerb ramp - pair	RO23	Primary	HIGH	\$ 5,000
CD1899	Darling Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8616624	151.171225	1		install new kerb ramp	RO23	Primary	HIGH	\$ 2,500
CD1900	Darling Street	Rozelle	Local Road		crossing deficiency	mismatched kerb ramps	-33.8616138	151.1713803	1		install new kerb ramp	RO22	Primary	HIGH	\$ 2,500
CD1901	Darling Street	Rozelle	Local Road		crossing deficiency	missing crossing point	-33.8606053	151.1717627	1		install new kerb ramp - pair	RO21	Primary	HIGH	\$ 5,000
CD1902	Darling Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.859975	151.1717818	1		install new kerb ramp	RO21	Primary	HIGH	\$ 2,500
CD1903	Darling Street	Rozelle	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8588684	151.1720668	1		install new tgsi	RO19	Primary	HIGH	\$ 650
CD1905	Darling Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8618119	151.1713066	1		install new kerb ramp	RO23	Primary	HIGH	\$ 2,500
CD1906	Darling Street	Rozelle	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8631401	151.1706068	1		install new tgsi	RO24	Primary	HIGH	\$ 650
CD1907	Darling Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8638066	151.1702709	1		install new kerb ramp	RO24	Primary	HIGH	\$ 2,500
CD1908	Darling Street	Rozelle	Local Road		crossing deficiency	misaligned kerb ramp	-33.8648718	151.1685962	1		install new kerb ramp	RO25	Primary	HIGH	\$ 2,500
CD1909	Darling Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.864519	151.1690005	1		install new kerb ramp	RO26	Primary	HIGH	\$ 2,500
CD1910	Darling Street	Rozelle	Local Road		crossing deficiency	misaligned kerb ramp	-33.865187	151.1677967	1		install new kerb ramp	RO25	Primary	HIGH	\$ 2,500
CD1972	Mullens Street	Rozelle	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8630824	151.1764318	1		install new kerb ramp - pair	RO53	Primary	HIGH	\$ 5,000
CD1975	Mullens Street	Rozelle	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8634043	151.1765311	1		install new tgsi - pair	RO53	Primary	HIGH	\$ 1,300
CD1985	Terry Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8588627	151.1711224	1		install new kerb ramp	RO69	Primary	HIGH	\$ 2,500
CD1986	Terry Street	Rozelle	Local Road		crossing deficiency	missing kerb ramp	-33.8587695	151.1711519	1		install new kerb ramp	RO64	Primary	HIGH	\$ 2,500
CD1988	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8637123	151.1701088	1		install new kerb ramp	RO24	Primary	HIGH	\$ 2,500
CD1989	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8667448	151.1752692	1		install new tgsi	RO74	Primary	HIGH	\$ 650
CD1990	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8636491	151.1695529	1		install new tgsi	RO78	Primary	HIGH	\$ 650
CD1991	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8627898	151.1687241	1		install new kerb ramp - pair	RO80	Primary	HIGH	\$ 5,000
CD1992	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8628977	151.168732	1		install new kerb ramp	RO80	Primary	HIGH	\$ 2,500
CD1994	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8660043	151.1728788	1		install new kerb ramp	RO72	Primary	HIGH	\$ 2,500
CD1998	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8656964	151.1728928	1		install new kerb ramp - pair	RO72	Primary	HIGH	\$ 5,000
CD1999	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8652185	151.1722934	1		install new kerb ramp - pair	RO72	Primary	HIGH	\$ 5,000
CD2000	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8648433	151.1716045	1		install new kerb ramp - pair	RO76	Primary	HIGH	\$ 5,000
CD2001	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8645776	151.1712762	1		install new kerb ramp - pair	RO76	Primary	HIGH	\$ 5,000
CD2002	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8647726	151.1710727	1		install new kerb ramp	RO76	Primary	HIGH	\$ 2,500
CD2004	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8683272	151.1759768	1		install new kerb ramp	RO2	Primary	HIGH	\$ 2,500
CD2005	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	missing crossing point	-33.8670114	151.1751641	1		install new kerb ramp - pair	RO74	Primary	HIGH	\$ 5,000
CD2006	Wise Street	Rozelle	Local Road		crossing deficiency	missing kerb ramp	-33.8604954	151.1708416	1		install new kerb ramp	RO67	Primary	HIGH	\$ 2,500
CD2007	Wise Street	Rozelle	Local Road		crossing deficiency	missing crossing point	-33.8605841	151.1710162	1		install new kerb ramp - pair	RO67	Primary	HIGH	\$ 5,000
CD2009	Campbell Street	St Peters	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.9126053	151.179202	1		install new kerb ramp	SP16	Primary	HIGH	\$ 2,500
CD2013	Edith Street	St Peters	Local Road		crossing deficiency	missing kerb ramp	-33.9146077	151.1754732	1		install new kerb ramp	SP21	Primary	HIGH	\$ 2,500
CD2014	King Street	St Peters	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9079005	151.1812474	1		install new kerb ramp - pair	SP11	Primary	HIGH	\$ 5,000
CD2015	King Street	St Peters	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9070693	151.1813971	1		install new kerb ramp - pair	SP10	Primary	HIGH	\$ 5,000
CD2016	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9126913	151.1792195	1		install new kerb ramp	SP16	Primary	HIGH	\$ 2,500
CD2017	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9162249	151.1731356	1		install new kerb ramp - pair	SP24	Primary	HIGH	\$ 5,000
CD2021	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9192552	151.1693896	1		install new kerb ramp - pair	SP27	Primary	HIGH	\$ 5,000
CD2024	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	missing crossing point	-33.9155767	151.1743832	1		install new kerb ramp - pair	SP22	Primary	HIGH	\$ 5,000
CD2025	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9156239	151.1746635	1		install new kerb ramp - pair	SP22	Primary	HIGH	\$ 5,000

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD2026	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9155397	151.1748154	1		install new kerb ramp - pair	SP22	Primary	HIGH	\$ 5,000
CD2027	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9154536	151.1745016	1		install new kerb ramp - pair	SP22	Primary	HIGH	\$ 5,000
CD2029	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.910967	151.1801065	1		install new kerb ramp	SP9	Primary	HIGH	\$ 2,500
CD2030	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9088097	151.1810065	1		install new kerb ramp - pair	SP12	Primary	HIGH	\$ 5,000
CD2032	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9126498	151.1793266	1		install new kerb ramp - pair	SP16	Primary	HIGH	\$ 5,000
CD2033	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9128529	151.1792542	1		install new kerb ramp - pair	SP16	Primary	HIGH	\$ 5,000
CD2034	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9132491	151.1788062	1		install new kerb ramp - pair	SP17	Primary	HIGH	\$ 5,000
CD2035	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9137546	151.17835	1		install new kerb ramp - pair	SP18	Primary	HIGH	\$ 5,000
CD2036	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9149571	151.175744	1		install new kerb ramp - pair	SP21	Primary	HIGH	\$ 5,000
CD2037	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9148108	151.176419	1		install new kerb ramp - pair	SP20	Primary	HIGH	\$ 5,000
CD2038	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9141512	151.1774052	1		install new kerb ramp - pair	SP19	Primary	HIGH	\$ 5,000
CD2039	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9132795	151.1784405	1		install new kerb ramp - pair	SP17	Primary	HIGH	\$ 5,000
CD2040	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9124852	151.1790353	1		install new kerb ramp - pair	SP16	Primary	HIGH	\$ 5,000
CD2041	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.9088076	151.181159	1		install new kerb ramp	SP12	Primary	HIGH	\$ 2,500
CD2042	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.908812	151.1812073	1		install new refuge island	SP12	Primary	HIGH	\$ 15,000
CD2052	Douglas Street	Stanmore	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8940792	151.1642462	1		install new kerb ramp	SM34	Primary	HIGH	\$ 2,500
CD2053	Douglas Street	Stanmore	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8940676	151.1641509	1		install new kerb ramp	SM34	Primary	HIGH	\$ 2,500
CD2055	Douglas Street	Stanmore	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8935513	151.1614202	1		install new kerb ramp - pair	SM12	Primary	HIGH	\$ 5,000
CD2056	Douglas Street	Stanmore	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8934265	151.1615244	1		install new kerb ramp	SM12	Primary	HIGH	\$ 2,500
CD2057	Douglas Street	Stanmore	Regional Road		crossing deficiency	misaligned kerb ramp	-33.8936001	151.1620572	1		install new kerb ramp	SM12	Primary	HIGH	\$ 2,500
CD2058	Gordon Crescent	Stanmore	Local Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8942297	151.1629359	1		install new kerb ramp	SM18	Primary	HIGH	\$ 2,500
CD2061	Holt Street	Stanmore	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8963068	151.1636715	1		install new tgsi	SM35	Primary	HIGH	\$ 650
CD2062	Holt Street	Stanmore	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8960077	151.1638391	1		install new kerb ramp	SM35	Primary	HIGH	\$ 2,500
CD2063	Holt Street	Stanmore	Local Road		crossing deficiency	missing kerb ramp	-33.8958292	151.1637874	1		install new kerb ramp	SM35	Primary	HIGH	\$ 2,500
CD2064	Holt Street	Stanmore	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8958884	151.1637463	1		install new kerb ramp	SM35	Primary	HIGH	\$ 2,500
CD2078	Parramatta Road	Stanmore	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8880953	151.1614473	1		install new kerb ramp - pair	LH145	Primary	HIGH	\$ 5,000
CD2079	Parramatta Road	Stanmore	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8883289	151.1629985	1		install new kerb ramp - pair	AN73	Primary	HIGH	\$ 5,000
CD2082	Percival Road	Stanmore	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8939907	151.1641412	1		install new kerb ramp	SM41	Primary	HIGH	\$ 2,500
CD2083	Percival Road	Stanmore	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8935285	151.1642486	1		install new kerb ramp	SM33	Primary	HIGH	\$ 2,500
CD2084	Percival Road	Stanmore	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8932325	151.1643276	1		install new kerb ramp	SM32	Primary	HIGH	\$ 2,500
CD2085	Percival Road	Stanmore	Local Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.8907778	151.165047	1		re-construct refuge island	SM30	Primary	HIGH	\$ 15,000
CD2086	Percival Road	Stanmore	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8906321	151.1650333	1		install new kerb ramp	SM29	Primary	HIGH	\$ 2,500
CD2087	Percival Road	Stanmore	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8905384	151.1651436	1		install new kerb ramp	SM29	Primary	HIGH	\$ 2,500
CD2089	Percival Road	Stanmore	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8933234	151.1644461	1		install new kerb ramp	SM48	Primary	HIGH	\$ 2,500
CD2095	Railway Avenue	Stanmore	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8937371	151.1665219	1		install new tgsi	SM36	Primary	HIGH	\$ 650
CD2096	Railway Avenue	Stanmore	Local Road		crossing deficiency	missing kerb ramp	-33.893604	151.1655672	1		install new kerb ramp	SM36	Primary	HIGH	\$ 2,500
CD2097	Salisbury Road	Stanmore	Regional Road		crossing deficiency	missing kerb ramp	-33.8930743	151.1650406	1		install new kerb ramp	SM48	Primary	HIGH	\$ 2,500
CD2098	Salisbury Road	Stanmore	Regional Road		crossing deficiency	misaligned kerb ramp	-33.8926945	151.165874	1		install new kerb ramp	SM42	Primary	HIGH	\$ 2,500

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD2099	Salisbury Road	Stanmore	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8925801	151.1661499	1		install new kerb ramp	SM42	Primary	HIGH	\$ 2,500
CD2100	Salisbury Road	Stanmore	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8924745	151.166318	1		install new kerb ramp	SM47	Primary	HIGH	\$ 2,500
CD2101	Salisbury Road	Stanmore	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8920885	151.1672771	1		install new kerb ramp	SM46	Primary	HIGH	\$ 2,500
CD2102	Salisbury Road	Stanmore	Regional Road		crossing deficiency	misaligned kerb ramp	-33.891757	151.1680027	1		install new kerb ramp	SM46	Primary	HIGH	\$ 2,500
CD2105	Salisbury Road	Stanmore	Regional Road		crossing deficiency	narrow refuge island	-33.8918093	151.1680422	1		install new refuge island	SM46	Primary	HIGH	\$ 15,000
CD2108	Stanmore Road	Stanmore	State Road	Strategic Route	crossing deficiency	steep kerb ramp	-33.8964806	151.1632031	1		install new kerb ramp - pair	SM49	Primary	HIGH	\$ 5,000
CD2109	Stanmore Road	Stanmore	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8963203	151.1615081	1		install new kerb ramp	SM50	Primary	HIGH	\$ 2,500
CD2110	Stanmore Road	Stanmore	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8962812	151.1616462	1		install new kerb ramp - pair	SM50	Primary	HIGH	\$ 5,000
CD2111	Trafalgar Street	Stanmore	Regional Road		crossing deficiency	narrow pedestrian waiting area	-33.8946439	151.1643603	1		install kerb extension	SM34	Primary	HIGH	\$ 10,000
CD2113	Carlton Crescent	Summer Hill	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8904051	151.1384299	1		install new kerb ramp - pair	SH14	Primary	HIGH	\$ 5,000
CD2114	Carlton Crescent	Summer Hill	Regional Road	Strategic Route	crossing deficiency	raised kerb ramp lip	-33.8905642	151.1385271	1		install new kerb ramp	SH49	Primary	HIGH	\$ 2,500
CD2115	Carlton Crescent	Summer Hill	Regional Road	Strategic Route	crossing deficiency	raised kerb ramp lip	-33.890579	151.1385101	1		install new kerb ramp	SH49	Primary	HIGH	\$ 2,500
CD2124	Grosvenor Crescent	Summer Hill	Local Road		crossing deficiency	missing crossing point	-33.8901407	151.1389753	1		install new kerb ramp - pair	SH75	Primary	HIGH	\$ 5,000
CD2125	Hardie Avenue	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8909693	151.1382785	1		install new kerb ramp	SH33	Primary	HIGH	\$ 2,500
CD2132	Junction Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8955528	151.1384662	1		install new kerb ramp	SH56	Primary	HIGH	\$ 2,500
CD2142	Kensington Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8886579	151.1408424	1		install new kerb ramp - pair	SH76	Primary	HIGH	\$ 5,000
CD2143	Liverpool Road	Summer Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8875296	151.1366858	1		install new kerb ramp - pair	SH47	Primary	HIGH	\$ 5,000
CD2147	Norton Street	Summer Hill	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8914186	151.1323934	1		install new kerb ramp - pair	AF118	Primary	HIGH	\$ 5,000
CD2152	Old Canterbury Road	Summer Hill	State Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.895861	151.138048	1		install new tgsi - pair	SH56	Primary	HIGH	\$ 1,300
CD2153	Old Canterbury Road	Summer Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8955678	151.1385115	1		install new kerb ramp - pair	SH56	Primary	HIGH	\$ 5,000
CD2157	Old Canterbury Road	Summer Hill	State Road		crossing deficiency	misaligned kerb ramp	-33.895399	151.1417414	1		install new kerb ramp	DH100	Primary	HIGH	\$ 2,500
CD2158	Old Canterbury Road	Summer Hill	State Road		crossing deficiency	missing kerb ramp	-33.8954005	151.1416726	1		install new kerb ramp	DH100	Primary	HIGH	\$ 2,500
CD2159	Old Canterbury Road	Summer Hill	State Road		crossing deficiency	missing crossing point	-33.895442	151.1417055	1		install new kerb ramp - pair	DH100	Primary	HIGH	\$ 5,000
CD2160	Old Canterbury Road	Summer Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8954008	151.1416368	1		install new kerb ramp - pair	DH100	Primary	HIGH	\$ 5,000
CD2161	Parramatta Road	Summer Hill	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8876642	151.1418044	1		install new kerb ramp	HA78	Primary	HIGH	\$ 2,500
CD2162	Parramatta Road	Summer Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8876647	151.141684	1		install new kerb ramp - pair	SH77	Primary	HIGH	\$ 5,000
CD2163	Parramatta Road	Summer Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.889506	151.1443039	1		install new kerb ramp - pair	HA65	Primary	HIGH	\$ 5,000
CD2172	Prospect Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9007265	151.1320352	1		install new kerb ramp - pair	AF126	Primary	HIGH	\$ 5,000
CD2173	Sloane Street	Summer Hill	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8900256	151.1392244	1		install new kerb ramp - pair	SH78	Primary	HIGH	\$ 5,000
CD2174	Sloane Street	Summer Hill	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8885814	151.1406536	1		install new kerb ramp - pair	SH76	Primary	HIGH	\$ 5,000
CD2175	Sloane Street	Summer Hill	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8884864	151.1409117	1		install new kerb ramp - pair	SH76	Primary	HIGH	\$ 5,000
CD2176	Sloane Street	Summer Hill	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8884106	151.1406793	1		install new kerb ramp - pair	SH76	Primary	HIGH	\$ 5,000
CD2177	Sloane Street	Summer Hill	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8895602	151.1395033	1		install new kerb ramp - pair	SH78	Primary	HIGH	\$ 5,000
CD2178	Smith Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8918623	151.1378449	1		install new kerb ramp - pair	SH85	Primary	HIGH	\$ 5,000
CD2179	Smith Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8917478	151.1370025	1		install new kerb ramp - pair	SH84	Primary	HIGH	\$ 5,000
CD2181	Smith Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8916584	151.1372155	1		install new kerb ramp - pair	SH84	Primary	HIGH	\$ 5,000
CD2182	Smith Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8904409	151.1384907	1		install new kerb ramp	SH49	Primary	HIGH	\$ 2,500
CD2199	Smith Street	Summer Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8917001	151.1370743	1		install new tgsi - pair	SH84	Primary	HIGH	\$ 1,300
CD2200	Smith Street	Summer Hill	Local Road		crossing deficiency	missing crossing point	-33.8917834	151.138114	1		install new kerb ramp - pair	SH49	Primary	HIGH	\$ 5,000
CD2201	Burrows Avenue	Sydenham	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9150741	151.1664926	1		install new kerb ramp - pair	SY2	Primary	HIGH	\$ 5,000
CD2202	Burrows Avenue	Sydenham	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9152315	151.1661628	1		install new kerb ramp - pair	SY5	Primary	HIGH	\$ 5,000
CD2204	Gleeson Avenue	Sydenham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9157642	151.1661955	1		install new kerb ramp - pair	SY6	Primary	HIGH	\$ 5,000
CD2205	Gleeson Avenue	Sydenham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9152927	151.1661237	1		install new kerb ramp - pair	SY5	Primary	HIGH	\$ 5,000
CD2206	Gleeson Avenue	Sydenham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9151757	151.1661053	1		install new kerb ramp - pair	SY5	Primary	HIGH	\$ 5,000
CD2207	Gleeson Avenue	Sydenham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9150068	151.1661753	1		install new kerb ramp	SY2	Primary	HIGH	\$ 2,500
CD2212	Princes Highway	Sydenham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9183623	151.1702152	1		install new kerb ramp - pair	SP26	Primary	HIGH	\$ 5,000
CD2216	Railway Road	Sydenham	Local Road		crossing deficiency	steep kerb ramp	-33.9167981	151.166865	1		install new kerb ramp - pair	SY7	Primary	HIGH	\$ 5,000
CD2217	Unwins Bridge Road	Sydenham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9164225	151.1663628	1		install new kerb ramp	SY13	Primary	HIGH	\$ 2,500
CD2218	Cook Street	Tempe	Local Road		crossing deficiency	missing kerb ramp	-33.9265538	151.1581687	1		install new kerb ramp	TE34	Primary	HIGH	\$ 2,500
CD2219	Cook Street	Tempe	Local Road		crossing deficiency	missing kerb ramp - pair	-33.926535	151.1581344	1		install new kerb ramp - pair	TE34	Primary	HIGH	\$ 5,000
CD2226	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9234113	151.162336	1		install new kerb ramp	TE12	Primary	HIGH	\$ 2,500
CD2227	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9247748	151.1607329	1		install new kerb ramp	TE6	Primary	HIGH	\$ 2,500
CD2228	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9248637	151.1607764	1		install new kerb ramp	TE6	Primary	HIGH	\$ 2,500
CD2229	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9244974	151.1613015	1		install new kerb ramp	TE13	Primary	HIGH	\$ 2,500
CD2237	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9227493	151.1630383	1		install new kerb ramp - pair	TE5	Primary	HIGH	\$ 5,000
CD2239	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9235488	151.1623574	1		install new kerb ramp	TE12	Primary	HIGH	\$ 2,500
CD2240	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9242144	151.1615239	1		install new kerb ramp	TE13	Primary	HIGH	\$ 2,500
CD2241	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9239939	151.1617109	1		install new kerb ramp	TE13	Primary	HIGH	\$ 2,500
CD2242	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9234243	151.1624665	1		install new kerb ramp - pair	TE5	Primary	HIGH	\$ 5,000
CD2245	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9267892	151.1588872	1		install new kerb ramp - pair	TE34	Primary	HIGH	\$ 5,000
CD2246	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9269597	151.158771	1		install new kerb ramp - pair	TE34	Primary	HIGH	\$ 5,000
CD2247	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9268178	151.1586052	1		install new kerb ramp - pair	TE34	Primary	HIGH	\$ 5,000
CD2256	View Street	Tempe	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9266192	151.1581349	1		install new kerb ramp	TE34	Primary	HIGH	\$ 2,500
MP11	Frederick Street	Ashfield	State Road	Strategic Route	missing footpath	missing footpath section	-33.8778288	151.1279692		2	install new footpath	AF69	Primary	HIGH	\$ 400
MP14	Gladstone Street	Balmain	Local Road		missing footpath	missing footpath	-33.8587466	151.1840608	1		investigate shared zone implementation	BA40	Primary	HIGH	\$ 15,000
MP23	Prospect Street	Leichhardt	Local Road		missing footpath	missing footpath	-33.8845161	151.1597981		118	install new footpath	LH9	Primary	HIGH	\$ 23,600
MP24	Prospect Street	Leichhardt	Local Road		missing footpath	missing footpath	-33.8844637	151.1595822		78	install new footpath	LH9	Primary	HIGH	\$ 15,600
MP27	Hudson Street	Lewisham	Local Road		missing footpath	missing footpath	-33.8939762	151.1437637		34	install new footpath	LW5	Primary	HIGH	\$ 6,800
MP42	Enmore Park	Marrickville	Local Road		missing footpath	missing footpath	-33.9054033	151.1680748		32	install new footpath	MV224	Primary	HIGH	\$ 6,400
MP43	Ewart Lane	Marrickville	Local Road		missing footpath	missing footpath	-33.9107905	151.1395526		149	install new footpath	MV64	Primary	HIGH	\$ 29,800
MP48	Victoria Road	Marrickville	State Road	Strategic Route	missing footpath	missing footpath	-33.9145284	151.1582782		54	install new footpath	MV227	Primary	HIGH	\$ 10,800
SUBTOTAL (HIGH)															\$ 3,406,050

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
AC2	Nelson Street	Annandale	Local Road	Strategic Route	access	stairs only access	-33.8794841	151.1748311	1		install accessible ramp	AN68	Secondary	MED	\$ 10,000
AC4	Pritchard Street	Annandale	Local Road		access	stairs only access	-33.8741591	151.170476	1		install accessible ramp	AN122	Secondary	MED	\$ 10,000
AC5	Rose Street	Annandale	Local Road		access	stairs only access	-33.8776028	151.1765264	1		install accessible ramp	AN95	Secondary	MED	\$ 10,000
AC6	Trafalgar Street	Annandale	Regional Road		access	stairs only access	-33.8768924	151.1743546	1		install accessible ramp	AN103	Secondary	MED	\$ 10,000
AC14	Grove Street	Birchgrove	Local Road		access	stairs only access	-33.8501831	151.1832336	1		install ramp	BI1	Secondary	MED	\$ 5,000
AC15	Louisa Road	Birchgrove	Local Road		access	stairs only access to wharf	-33.8467252	151.1857299	1		refer to Transport for NSW	BI7	Secondary	MED	\$ -
AC16	Church Street	Croydon	Local Road		access	stairs only access	-33.8757074	151.1206515	1		install ramp	CR1	Secondary	MED	\$ 5,000
AC17	Constitution Road	Dulwich Hill	Local Road		access	stairs only access	-33.9024858	151.138001	1		no action	DH20	Secondary	MED	\$ -
AC18	Davis Street	Dulwich Hill	Local Road		access	stairs only access	-33.8993374	151.1403412	1		no action	DH116	Secondary	MED	\$ -
AC19	Boomerang Street	Haberfield	Local Road		access	stairs only access to park	-33.8714248	151.1444646	1		install accessible ramp	HA23	Secondary	MED	\$ 10,000
AC20	White Creek	Leichhardt	Local Road	Strategic Route	access	no ramp between different height footpaths	-33.8867155	151.1633439	1		install new kerb ramp	LH157	Secondary	MED	\$ 2,500
AC23	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	access	stairs only access	-33.8722206	151.1679879	1		install ramp	LF74	Secondary	MED	\$ 5,000
AC25	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	access	stairs only access	-33.8722515	151.1679658	1		install accessible ramp	LF74	Secondary	MED	\$ 10,000
AC27	Enmore Road	Marrickville	State Road	Strategic Route	access	no access to push button	-33.904041	151.168294	1		refer to Transport for NSW	MV11	Secondary	MED	\$ -
AC28	Illawarra Road	Marrickville	Regional Road	Strategic Route	access	stairs only access	-33.9184317	151.1469074	1		install accessible ramp	MV100	Secondary	MED	\$ 10,000
AC31	Bedford Street	Newtown	Local Road		access	stairs only access to underpass	-33.8961862	151.1735025	1		install accessible ramp	NE17	Secondary	MED	\$ 10,000
AC33	Anzac Bridge	Rozelle	State Road	Strategic Route	access	stairs only access	-33.8679431	151.1819696	1		no action	RO8	Secondary	MED	\$ -
AC34	Anzac Bridge	Rozelle	State Road	Strategic Route	access	stairs only access	-33.8681407	151.1811884	1		no action	RO7	Secondary	MED	\$ -
AC35	Evans Street	Rozelle	Local Road		access	stairs only access	-33.8673546	151.1691106	1		install accessible ramp	RO35	Secondary	MED	\$ 10,000
AC36	Victoria Road	Rozelle	State Road	Strategic Route	access	stairs only access	-33.8606928	151.1643525	1		refer to Transport for NSW on installin	RO84	Secondary	MED	\$ -
AC37	Victoria Road	Rozelle	State Road	Strategic Route	access	stairs only access	-33.8661147	151.1736605	1		install new kerb ramp - pair	RO73	Secondary	MED	\$ 5,000
AC42	View Street	Tempe	Local Road	Strategic Route	access	stairs only access	-33.9257978	151.156101	1		install accessible ramp	TE33	Secondary	MED	\$ 10,000
CD1	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.873888	151.1725471	1		install new kerb ramp	AN3	Secondary	MED	\$ 2,500
CD10	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8869703	151.1665124	1		install new tgsi	AN1	Secondary	MED	\$ 650
CD11	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8869879	151.1665033	1		install new kerb ramp	AN1	Secondary	MED	\$ 2,500
CD12	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp construction	-33.8847538	151.167648	1		install new kerb ramp	AN16	Secondary	MED	\$ 2,500
CD13	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8869703	151.1665261	1		install new kerb ramp - pair	AN1	Secondary	MED	\$ 5,000
CD14	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8846693	151.167662	1		install new kerb ramp - pair	AN15	Secondary	MED	\$ 5,000
CD15	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	missing crossing point	-33.8846506	151.1676233	1		install new kerb ramp - pair	AN15	Secondary	MED	\$ 5,000
CD16	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	missing crossing point	-33.8846928	151.1675936	1		install new kerb ramp - pair	AN15	Secondary	MED	\$ 5,000
CD17	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8846916	151.1675255	1		install new tgsi	AN15	Secondary	MED	\$ 650
CD18	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8847112	151.1675429	1		install new tgsi	AN16	Secondary	MED	\$ 650
CD19	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	missing refuge island	-33.8831197	151.168448	1		install new refuge island	AN35	Secondary	MED	\$ 15,000
CD20	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8831795	151.1682223	1		install new tgsi	AN14	Secondary	MED	\$ 650
CD21	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.882384	151.168704	1		install new kerb ramp - pair	AN12	Secondary	MED	\$ 5,000
CD22	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8831943	151.1682341	1		install new tgsi	AN14	Secondary	MED	\$ 650
CD25	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	narrow kerb ramp	-33.881	151.169297	1		install new kerb ramp	AN11	Secondary	MED	\$ 2,500
CD26	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8809857	151.1693067	1		install new kerb ramp	AN11	Secondary	MED	\$ 2,500
CD27	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8809201	151.1693268	1		install new kerb ramp	AN10	Secondary	MED	\$ 2,500
CD28	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.8804493	151.169603	1		install new tgsi - pair	AN10	Secondary	MED	\$ 1,300
CD34	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.878108	151.1705503	1		install new tgsi	AN89	Secondary	MED	\$ 650
CD35	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8780419	151.170576	1		install new tgsi	AN89	Secondary	MED	\$ 650
CD36	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8759093	151.1716588	1		install new kerb ramp	AN5	Secondary	MED	\$ 2,500
CD37	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8756174	151.1717107	1		install new kerb ramp	AN4	Secondary	MED	\$ 2,500
CD38	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.8758906	151.1716584	1		re-construct refuge island	AN5	Secondary	MED	\$ 15,000
CD39	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8735352	151.1725707	1		install new tgsi	AN2	Secondary	MED	\$ 650
CD40	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8734854	151.17257	1		install new tgsi	AN2	Secondary	MED	\$ 650
CD41	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	missing crossing point	-33.8725872	151.172545	1		install new kerb ramp - pair	AN2	Secondary	MED	\$ 5,000
CD42	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.873101	151.1725728	1		install new kerb ramp	AN2	Secondary	MED	\$ 2,500
CD43	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8880062	151.166082	1		install new kerb ramp - pair	AN76	Secondary	MED	\$ 5,000
CD45	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	driver confusion at unconventional crossing	-33.8758303	151.1716311	1		review and install pedestrian crossing	AN5	Secondary	MED	\$ 50,000
CD6	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp construction	-33.8831774	151.1683216	1		install new kerb ramp	AN35	Secondary	MED	\$ 2,500
CD7	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8870134	151.1665661	1		install new kerb ramp - pair	AN1	Secondary	MED	\$ 5,000
CD46	Booth Street	Annandale	Regional Road	Strategic Route	crossing deficiency	steep kerb ramp - pair	-33.8827601	151.174598	1		install new kerb ramp	AN24	Secondary	MED	\$ 2,500
CD58	Booth Street	Annandale	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8853772	151.1760705	1		install new kerb ramp - pair	AN91	Secondary	MED	\$ 5,000
CD59	Booth Street	Annandale	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.884288	151.1757613	1		install new kerb ramp - pair	AN28	Secondary	MED	\$ 5,000
CD63	Chester Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8856096	151.1749273	1		install new kerb ramp	AN38	Secondary	MED	\$ 2,500
CD64	Chester Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8855681	151.174957	1		install new kerb ramp - pair	AN38	Secondary	MED	\$ 5,000
CD65	Chester Street	Annandale	Local Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8850712	151.1744977	1		install new kerb ramp	AN30	Secondary	MED	\$ 2,500
CD68	Collins Street	Annandale	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8840099	151.1711101	1		install new tgsi	AN32	Secondary	MED	\$ 650
CD69	Collins Street	Annandale	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.88413	151.1712816	1		install new tgsi - pair	AN32	Secondary	MED	\$ 1,300
CD70	Collins Street	Annandale	Local Road		crossing deficiency	missing kerb ramp	-33.8839938	151.1704222	1		install new kerb ramp	AN36	Secondary	MED	\$ 2,500
CD71	Collins Street	Annandale	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8845307	151.1725489	1		install new tgsi	AN37	Secondary	MED	\$ 650
CD72	Collins Street	Annandale	Local Road		crossing deficiency	driveway as kerb ramp	-33.8846116	151.1726152	1		no action	AN37	Secondary	MED	\$ -
CD73	Collins Street	Annandale	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8846416	151.1724844	1		install new tgsi	AN37	Secondary	MED	\$ 650
CD74	Collins Street	Annandale	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8846525	151.1724879	1		install new tgsi	AN37	Secondary	MED	\$ 650
CD75	Collins Street	Annandale	Local Road		crossing deficiency	missing kerb ramp	-33.8846623	151.1725699	1		install new kerb ramp	AN37	Secondary	MED	\$ 2,500
CD79	Collins Street	Annandale	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8830396	151.1683108	1		install new kerb ramp	AN13	Secondary	MED	\$ 2,500
CD84	Hutchinson Street	Annandale	Local Road		crossing deficiency	missing kerb ramp	-33.8750048	151.1698809	1		install new kerb ramp	AN121	Secondary	MED	\$ 2,500
CD85	Hutchinson Street	Annandale	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8750239	151.1699096	1		install new kerb ramp	AN120	Secondary	MED	\$ 2,500
CD86	Hutchinson Street	Annandale	Local Road		crossing deficiency	missing kerb ramp	-33.875024	151.1699318	1		install new kerb ramp	AN121	Secondary	MED	\$ 2,500
CD87	Hutchinson Street	Annandale	Local Road		crossing deficiency	steep kerb ramp	-33.8751993	151.1704366	1		install new kerb ramp - pair	AN121	Secondary	MED	\$ 5,000
CD88	Hutchinson Street	Annandale	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8753051	151.1706709	1		install new kerb ramp - pair	AN121	Secondary	MED	\$ 5,000
CD89	Hutchinson Street	Annandale	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8753665	151.1708443	1		install new kerb ramp - pair	AN5	Secondary	MED	\$ 5,000
CD90	Hutchinson Street	Annandale	Local Road		crossing deficiency	misaligned kerb ramp	-33.8753458	151.1707383	1		install new kerb ramp	AN121	Secondary	MED	\$ 2,500
CD100	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.883622	151.1697563	1		install new kerb ramp - pair	AN36	Secondary	MED	\$ 5,000
CD101	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.883608	151.169656	1		install new kerb ramp	AN35	Secondary	MED	\$ 2,500
CD102	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8836366	151.1696613	1		install new kerb ramp - pair	AN54	Secondary	MED	\$ 5,000
CD103	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8850971	151.1689671	1		install new kerb ramp - pair	AN42	Secondary	MED	\$ 5,000
CD104	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	narrow kerb ramp	-33.885616	151.1687272	1		install new kerb ramp	AN42	Secondary	MED	\$ 2,500
CD106	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8836953	151.1696809	1		install new kerb ramp	AN54	Secondary	MED	\$ 2,500
CD107	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8857766	151.168895	1		install new kerb ramp	AN42	Secondary	MED	\$ 2,500

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD91	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8737352	151.1741572	1		install new kerb ramp	AN43	Secondary	MED	\$ 2,500
CD97	Johnston Street	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8785334	151.1719631	1		install new kerb ramp - pair	AN87	Secondary	MED	\$ 5,000
CD108	Mallett Street	Annandale	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8860991	151.1762354	1		install new kerb ramp	AN19	Secondary	MED	\$ 2,500
CD109	Mallett Street	Annandale	Local Road		crossing deficiency	poor kerb ramp construction	-33.8861586	151.1763035	1		install new kerb ramp	AN19	Secondary	MED	\$ 2,500
CD111	Nelson Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8821737	151.1748632	1		install new kerb ramp	AN59	Secondary	MED	\$ 2,500
CD118	Parramatta Road	Annandale	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8872676	151.1736938	1		install new kerb ramp	AN92	Secondary	MED	\$ 2,500
CD119	Parramatta Road	Annandale	State Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8872655	151.1735836	1		install new kerb ramp - pair	AN92	Secondary	MED	\$ 5,000
CD120	Parramatta Road	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8878414	151.1679651	1		install new kerb ramp	AN78	Secondary	MED	\$ 2,500
CD122	Parramatta Road	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8866413	151.1763983	1		install new kerb ramp - pair	AN64	Secondary	MED	\$ 5,000
CD127	Percival Road	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8880912	151.1649421	1		install new kerb ramp - pair	AN75	Secondary	MED	\$ 5,000
CD128	Piper Street	Annandale	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8775153	151.1686287	1		install new tgsi	AN116	Secondary	MED	\$ 650
CD129	Piper Street	Annandale	Local Road		crossing deficiency	missing kerb ramp	-33.8774376	151.1686449	1		install new kerb ramp	AN116	Secondary	MED	\$ 2,500
CD130	Piper Street	Annandale	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8774518	151.1686911	1		install new tgsi	AN116	Secondary	MED	\$ 650
CD132	Piper Street	Annandale	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8777356	151.1697151	1		install new tgsi	AN89	Secondary	MED	\$ 650
CD133	Piper Street	Annandale	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8775295	151.1687674	1		install new kerb ramp - pair	AN116	Secondary	MED	\$ 5,000
CD134	Pritchard Street	Annandale	Local Road		crossing deficiency	misaligned kerb ramp	-33.8721218	151.1730155	1		install new kerb ramp	AN18	Secondary	MED	\$ 2,500
CD135	Pritchard Street	Annandale	Local Road		crossing deficiency	missing kerb ramp	-33.873684	151.174284	1		install new kerb ramp	AN43	Secondary	MED	\$ 2,500
CD137	Pritchard Street	Annandale	Local Road		crossing deficiency	missing kerb ramp	-33.8749905	151.1698754	1		install new kerb ramp	AN121	Secondary	MED	\$ 2,500
CD138	Pymont Bridge Road	Annandale	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8863011	151.1747836	1		install new tgsi	AN90	Secondary	MED	\$ 650
CD139	Pymont Bridge Road	Annandale	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8866634	151.1742908	1		install new kerb ramp - pair	AN92	Secondary	MED	\$ 5,000
CD140	Pymont Bridge Road	Annandale	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8868061	151.1740295	1		install new kerb ramp - pair	AN92	Secondary	MED	\$ 5,000
CD141	Pymont Bridge Road	Annandale	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8866685	151.1742285	1		install new kerb ramp - pair	AN92	Secondary	MED	\$ 5,000
CD142	Pymont Bridge Road	Annandale	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8859683	151.1751285	1		install new kerb ramp	AN90	Secondary	MED	\$ 2,500
CD146	Railway Parade	Annandale	Local Road		crossing deficiency	long crossing point	-33.87502	151.1698868	1		install kerb extension / refuge island	AN120	Secondary	MED	\$ 10,000
CD147	Rose Street	Annandale	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8775061	151.1763183	1		install new tgsi	AN95	Secondary	MED	\$ 650
CD148	Rose Street	Annandale	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8773859	151.1759137	1		install new tgsi - pair	AN95	Secondary	MED	\$ 1,300
CD149	The Crescent	Annandale	State Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.8765524	151.176037	1		re-construct refuge island	AN96	Secondary	MED	\$ 15,000
CD150	The Crescent	Annandale	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8762839	151.1755387	1		install new kerb ramp	AN96	Secondary	MED	\$ 2,500
CD151	The Crescent	Annandale	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8756273	151.1749826	1		install new kerb ramp	AN99	Secondary	MED	\$ 2,500
CD156	Trafalgar Street	Annandale	Regional Road		crossing deficiency	misaligned kerb ramp - pair	-33.8859064	151.170216	1		install new kerb ramp - pair	AN101	Secondary	MED	\$ 5,000
CD157	Trafalgar Street	Annandale	Regional Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8862577	151.1700908	1		install new tgsi - pair	AN101	Secondary	MED	\$ 1,300
CD158	Trafalgar Street	Annandale	Regional Road		crossing deficiency	at grade crossing missing tgsi	-33.8866461	151.1698856	1		install new tgsi	AN101	Secondary	MED	\$ 650
CD159	Trafalgar Street	Annandale	Regional Road		crossing deficiency	missing kerb ramp	-33.8841835	151.1712089	1		install new kerb ramp	AN32	Secondary	MED	\$ 2,500
CD160	Trafalgar Street	Annandale	Regional Road		crossing deficiency	missing kerb ramp	-33.8867845	151.1698597	1		install new kerb ramp	AN101	Secondary	MED	\$ 2,500
CD161	Trafalgar Street	Annandale	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8867833	151.1698459	1		install new kerb ramp	AN101	Secondary	MED	\$ 2,500
CD162	Trafalgar Street	Annandale	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8867548	151.1700251	1		install new kerb ramp - pair	AN101	Secondary	MED	\$ 5,000
CD167	Trafalgar Street	Annandale	Regional Road		crossing deficiency	missing crossing point	-33.8789936	151.173511	1		install new kerb ramp - pair	AN104	Secondary	MED	\$ 5,000
CD168	Trafalgar Street	Annandale	Regional Road		crossing deficiency	missing kerb ramp - pair	-33.876816	151.1744132	1		install new kerb ramp - pair	AN103	Secondary	MED	\$ 5,000
CD169	Trafalgar Street	Annandale	Regional Road		crossing deficiency	missing kerb ramp	-33.8772218	151.1743378	1		install new kerb ramp	AN103	Secondary	MED	\$ 2,500
CD170	Trafalgar Street	Annandale	Regional Road		crossing deficiency	missing kerb ramp	-33.8768826	151.1744689	1		install new kerb ramp	AN103	Secondary	MED	\$ 2,500
CD172	Trafalgar Street	Annandale	Regional Road		crossing deficiency	misaligned refuge island	-33.8768588	151.1744486	1		re-construct refuge island	AN103	Secondary	MED	\$ 15,000
CD174	White Creek	Annandale	Local Road	Strategic Route	crossing deficiency	uneven pavement surface	-33.8784853	151.1682496	1		re-construct footpath pavement	AN115	Secondary	MED	\$ 200
CD175	White Creek	Annandale	Local Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.883921	151.1652062	1		install new kerb ramp - pair	LH161	Secondary	MED	\$ 5,000
CD176	White Creek	Annandale	Local Road	Strategic Route	crossing deficiency	narrow kerb ramp	-33.8863973	151.1641423	1		install new kerb ramp	LH158	Secondary	MED	\$ 2,500
CD177	White Creek	Annandale	Local Road	Strategic Route	crossing deficiency	missing crossing point	-33.8871908	151.1629356	1		install new kerb ramp - pair	AN112	Secondary	MED	\$ 5,000
CD178	White Creek	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8872184	151.1629433	1		install new tgsi	AN112	Secondary	MED	\$ 650
CD179	White Creek	Annandale	Local Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8877339	151.1628809	1		install new kerb ramp	AN112	Secondary	MED	\$ 2,500
CD181	Wisdom Street	Annandale	Local Road		crossing deficiency	raised kerb ramp lip	-33.8789584	151.1681705	1		install new kerb ramp	AN114	Secondary	MED	\$ 2,500
CD182	Wisdom Street	Annandale	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8789232	151.1682071	1		install new kerb ramp	AN114	Secondary	MED	\$ 2,500
CD183	Young Street	Annandale	Local Road		crossing deficiency	driveway as kerb ramp	-33.8753799	151.1706168	1		no action	AN121	Secondary	MED	\$ -
CD184	Young Street	Annandale	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8761272	151.1702534	1		install new kerb ramp - pair	AN119	Secondary	MED	\$ 5,000
CD185	Young Street	Annandale	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8768792	151.1700055	1		install new kerb ramp - pair	AN117	Secondary	MED	\$ 5,000
CD186	Young Street	Annandale	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8769038	151.1699036	1		install new kerb ramp	AN117	Secondary	MED	\$ 2,500
CD187	Hardy Street	Ashbury	Local Road		crossing deficiency	misaligned kerb ramp	-33.9030461	151.1254215	1		install new kerb ramp	AF82	Secondary	MED	\$ 2,500
CD188	Hardy Street	Ashbury	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9066243	151.1233419	1		install new kerb ramp - pair	HP2	Secondary	MED	\$ 5,000
CD190	Holden Street	Ashbury	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8959974	151.1250649	1		install new kerb ramp - pair	AF89	Secondary	MED	\$ 5,000
CD197	Alt Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8794125	151.1310478	1		install new kerb ramp - pair	AF6	Secondary	MED	\$ 5,000
CD198	Alt Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8834023	151.1243422	1		install new tgsi - pair	AF7	Secondary	MED	\$ 1,300
CD199	Alt Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8827245	151.1249368	1		install new tgsi - pair	AF9	Secondary	MED	\$ 1,300
CD200	Alt Street	Ashfield	Local Road		crossing deficiency	missing crossing point	-33.8826215	151.124953	1		install new kerb ramp - pair	AF9	Secondary	MED	\$ 5,000
CD201	Alt Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8823212	151.1252069	1		install new tgsi - pair	AF9	Secondary	MED	\$ 1,300
CD212	Armstrong Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9002937	151.1271523	1		install new kerb ramp - pair	AF11	Secondary	MED	\$ 5,000
CD223	Carlton Crescent	Ashfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8896967	151.1316541	1		install new kerb ramp - pair	SH8	Secondary	MED	\$ 5,000
CD231	Church Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.879462	151.125967	1		install new tgsi - pair	AF44	Secondary	MED	\$ 1,300
CD234	Clissold Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8957866	151.1309895	1		install new kerb ramp - pair	AF51	Secondary	MED	\$ 5,000
CD237	Clissold Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8958685	151.1311286	1		install new kerb ramp - pair	AF51	Secondary	MED	\$ 5,000
CD238	Clissold Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8958438	151.1304061	1		install new tgsi - pair	AF51	Secondary	MED	\$ 1,300
CD239	Clissold Street	Ashfield	Local Road		crossing deficiency	misaligned kerb ramp	-33.895727	151.1297602	1		install new kerb ramp	AF50	Secondary	MED	\$ 2,500
CD240	Clissold Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8955709	151.1274875	1		install new kerb ramp - pair	AF48	Secondary	MED	\$ 5,000
CD241	Clissold Street	Ashfield	Local Road		crossing deficiency	misaligned refuge island	-33.8956299	151.1275159	1		re-construct refuge island	AF48	Secondary	MED	\$ 15,000
CD242	Clissold Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8956011	151.1276328	1		install new kerb ramp - pair	AF49	Secondary	MED	\$ 5,000
CD243	Clissold Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8956545	151.1286329	1		install new kerb ramp - pair	AF49	Secondary	MED	\$ 5,000
CD244	Clissold Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8957503	151.128873	1		install new tgsi	AF50	Secondary	MED	\$ 650
CD245	Clissold Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8956012	151.1262991	1		install new kerb ramp	AF47	Secondary	MED	\$ 2,500
CD246	Clissold Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8955858	151.1251942	1		install new kerb ramp - pair	AF89	Secondary	MED	\$ 5,000
CD262	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8865949	151.1188635	1		install new kerb ramp - pair	AF157	Secondary	MED	\$ 5,000
CD266	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8788885	151.1255547	1		install new kerb ramp - pair	AF43	Secondary	MED	\$ 5,000
CD274	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8840199	151.1202446	1		install new kerb ramp	AF57	Secondary	MED	\$ 2,500
CD275	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8840342	151.1201712	1		install new kerb ramp - pair	AF57	Secondary	MED	\$ 5,000
CD276	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8841402	151.1203519	1		install new kerb ramp - pair	AF56	Secondary	MED	\$ 5,000
CD277	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8842659	151.1202696	1		install new kerb ramp	AF75	Secondary	MED	\$ 2,500
CD280	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8789936	151.12556	1		install new tgsi	AF44	Secondary	MED	\$ 650

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD281	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8789768	151.1256507	1		install new kerb ramp - pair	AF44	Secondary	MED	\$ 5,000
CD289	Frederick Street	Ashfield	State Road	Strategic Route	crossing deficiency	narrow kerb ramp	-33.8865899	151.1188201	1		install new kerb ramp	AF157	Secondary	MED	\$ 2,500
CD291	Georges River Drive	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8932357	151.1169273	1		install new kerb ramp - pair	AF111	Secondary	MED	\$ 5,000
CD297	Georges River Drive	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8929244	151.1171563	1		install new kerb ramp - pair	AF111	Secondary	MED	\$ 5,000
CD298	Georges River Drive	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8934064	151.1167734	1		install new kerb ramp - pair	CP2	Secondary	MED	\$ 5,000
CD302	Hardy Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9030472	151.125691	1		install new kerb ramp	AF82	Secondary	MED	\$ 2,500
CD303	Hardy Street	Ashfield	Local Road		crossing deficiency	missing crossing point	-33.9004986	151.1270328	1		install new kerb ramp - pair	AF80	Secondary	MED	\$ 5,000
CD304	Hardy Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9006317	151.1270946	1		install new kerb ramp	AF80	Secondary	MED	\$ 2,500
CD309	Holden Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8937091	151.1253635	1		install new tgsi	AF87	Secondary	MED	\$ 650
CD311	Holden Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8945498	151.1251596	1		install new tgsi - pair	AF88	Secondary	MED	\$ 1,300
CD312	Holden Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8941301	151.125188	1		install new kerb ramp - pair	AF88	Secondary	MED	\$ 5,000
CD314	Knox Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8880569	151.1232231	1		install new kerb ramp - pair	AF90	Secondary	MED	\$ 5,000
CD326	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8861585	151.1386673	1		install new kerb ramp - pair	AF96	Secondary	MED	\$ 5,000
CD337	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8893694	151.1320289	1		install new kerb ramp	AF61	Secondary	MED	\$ 2,500
CD338	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8893372	151.1322003	1		install new kerb ramp	AF61	Secondary	MED	\$ 2,500
CD342	Liverpool Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8874777	151.1211674	1		install new kerb ramp - pair	AF155	Secondary	MED	\$ 5,000
CD347	Markham Place	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.88745	151.1232534	1		install new kerb ramp	AF110	Secondary	MED	\$ 2,500
CD349	Milton Street	Ashfield	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8916107	151.1170251	1		install new kerb ramp - pair	AF116	Secondary	MED	\$ 5,000
CD351	Milton Street	Ashfield	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8915648	151.1172801	1		install new kerb ramp - pair	AF116	Secondary	MED	\$ 5,000
CD352	Milton Street	Ashfield	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8916266	151.1171784	1		install new kerb ramp - pair	AF116	Secondary	MED	\$ 5,000
CD354	Milton Street	Ashfield	State Road		crossing deficiency	poor kerb ramp alignment	-33.8939682	151.1174167	1		install new kerb ramp	AF140	Secondary	MED	\$ 2,500
CD355	Milton Street	Ashfield	State Road		crossing deficiency	poor kerb ramp alignment	-33.8940717	151.1173909	1		install new kerb ramp	AF140	Secondary	MED	\$ 2,500
CD356	Milton Street	Ashfield	State Road		crossing deficiency	missing crossing point	-33.8940724	151.1175283	1		install new kerb ramp - pair	AF140	Secondary	MED	\$ 5,000
CD357	Milton Street	Ashfield	State Road		crossing deficiency	at grade crossing missing tgsi	-33.8940898	151.1174897	1		install new tgsi	AF140	Secondary	MED	\$ 650
CD359	Milton Street	Ashfield	State Road		crossing deficiency	missing crossing point	-33.8949823	151.1192828	1		install new kerb ramp - pair	AF142	Secondary	MED	\$ 5,000
CD360	Milton Street	Ashfield	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8915327	151.1170278	1		install new kerb ramp - pair	AF116	Secondary	MED	\$ 5,000
CD376	Orpington Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8844461	151.1347383	1		install new kerb ramp - pair	AF137	Secondary	MED	\$ 5,000
CD377	Orpington Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8854386	151.1322448	1		install new kerb ramp - pair	AF136	Secondary	MED	\$ 5,000
CD379	Orpington Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8848997	151.133126	1		install new kerb ramp - pair	AF131	Secondary	MED	\$ 5,000
CD380	Orpington Street	Ashfield	Local Road		crossing deficiency	misaligned kerb ramp	-33.8844535	151.1346659	1		install new kerb ramp	AF137	Secondary	MED	\$ 2,500
CD381	Palace Street	Ashfield	Local Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8948881	151.1222787	1		install new kerb ramp	AF139	Secondary	MED	\$ 2,500
CD382	Palace Street	Ashfield	Local Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8949437	151.1207286	1		install new kerb ramp - pair	AF143	Secondary	MED	\$ 5,000
CD385	Paramatta Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8825626	151.1326476	1		install new kerb ramp - pair	AF146	Secondary	MED	\$ 5,000
CD386	Paramatta Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8762673	151.129117	1		install new kerb ramp	HA64	Secondary	MED	\$ 2,500
CD387	Paramatta Road	Ashfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.875644	151.1295723	1		install new kerb ramp - pair	HA64	Secondary	MED	\$ 5,000
CD388	Paramatta Road	Ashfield	State Road	Strategic Route	crossing deficiency	long driveway crossing point	-33.8749461	151.1280579	1		install new tgsi	HA81	Secondary	MED	\$ 650
CD390	Premier Street	Ashfield	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8948864	151.1192797	1		install new kerb ramp - pair	AF142	Secondary	MED	\$ 5,000
CD391	Premier Street	Ashfield	Local Road		crossing deficiency	long crossing	-33.8949377	151.1193922	1		install kerb extension - pair	AF142	Secondary	MED	\$ 20,000
CD392	Queen Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8933274	151.1278977	1		install new kerb ramp	AF153	Secondary	MED	\$ 2,500
CD393	Queen Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.892037	151.1279718	1		install new kerb ramp - pair	AF149	Secondary	MED	\$ 5,000
CD395	Queen Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8919241	151.1278209	1		install new kerb ramp - pair	AF154	Secondary	MED	\$ 5,000
CD396	Queen Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8928337	151.1277596	1		install new kerb ramp - pair	AF149	Secondary	MED	\$ 5,000
CD397	Queen Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8935527	151.1276798	1		install new kerb ramp - pair	AF153	Secondary	MED	\$ 5,000
CD398	Queen Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.894953	151.1275454	1		install new kerb ramp - pair	AF151	Secondary	MED	\$ 5,000
CD399	Queen Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.895718	151.1276349	1		install new kerb ramp - pair	AF49	Secondary	MED	\$ 5,000
CD401	The Esplanade	Ashfield	Local Road		crossing deficiency	missing kerb ramp	-33.8876038	151.1238882	1		install new kerb ramp	AF34	Secondary	MED	\$ 2,500
CD403	Thomas Street	Ashfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8865292	151.1186827	1		install new kerb ramp	AF158	Secondary	MED	\$ 2,500
CD404	Thomas Street	Ashfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8864056	151.1180193	1		install new kerb ramp - pair	AF158	Secondary	MED	\$ 5,000
CD405	Thomas Street	Ashfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.887106	151.1203856	1		install new kerb ramp - pair	AF156	Secondary	MED	\$ 5,000
CD406	Thomas Street	Ashfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.887507	151.1213281	1		install new kerb ramp - pair	AF155	Secondary	MED	\$ 5,000
CD409	Victoria Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8920762	151.129946	1		install new kerb ramp - pair	AF161	Secondary	MED	\$ 5,000
CD410	Victoria Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8915366	151.1301153	1		install new kerb ramp	AF161	Secondary	MED	\$ 2,500
CD411	Victoria Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8932389	151.1300582	1		install new kerb ramp	AF162	Secondary	MED	\$ 2,500
CD412	Victoria Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.895694	151.1299256	1		install new kerb ramp - pair	AF50	Secondary	MED	\$ 5,000
CD413	Victoria Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.895647	151.1297612	1		install new kerb ramp - pair	AF159	Secondary	MED	\$ 5,000
CD414	Victoria Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8947246	151.1297796	1		install new tgsi - pair	AF159	Secondary	MED	\$ 1,300
CD415	Victoria Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8933452	151.1299007	1		install new kerb ramp	AF162	Secondary	MED	\$ 2,500
CD416	Victoria Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8969104	151.1296769	1		install new tgsi - pair	AF166	Secondary	MED	\$ 1,300
CD417	Victoria Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.897776	151.1295173	1		install new kerb ramp - pair	AF166	Secondary	MED	\$ 5,000
CD418	Victoria Street	Ashfield	Local Road		crossing deficiency	missing crossing point	-33.8978465	151.1296215	1		install new kerb ramp - pair	AF166	Secondary	MED	\$ 5,000
CD419	Victoria Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8978581	151.1296675	1		install new kerb ramp	AF166	Secondary	MED	\$ 2,500
CD420	Victoria Street	Ashfield	Local Road		crossing deficiency	missing kerb ramp	-33.8994083	151.1294754	1		install new kerb ramp	AF168	Secondary	MED	\$ 2,500
CD421	Victoria Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8994775	151.1294296	1		install new kerb ramp	AF168	Secondary	MED	\$ 2,500
CD422	Victoria Street	Ashfield	Local Road		crossing deficiency	missing crossing point	-33.8986906	151.1295955	1		install new kerb ramp - pair	AF167	Secondary	MED	\$ 5,000
CD423	Victoria Street	Ashfield	Local Road		crossing deficiency	steep kerb ramp	-33.9008868	151.1294714	1		install new kerb ramp - pair	AF169	Secondary	MED	\$ 5,000
CD424	Victoria Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9006892	151.1294379	1		install new tgsi	AF169	Secondary	MED	\$ 650
CD425	Victoria Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9008073	151.1293546	1		install new tgsi - pair	AF169	Secondary	MED	\$ 1,300
CD426	Victoria Street	Ashfield	Local Road		crossing deficiency	raised kerb ramp lip	-33.9009234	151.129328	1		install new kerb ramp	AF169	Secondary	MED	\$ 2,500
CD427	Victoria Street	Ashfield	Local Road		crossing deficiency	missing crossing point	-33.9017013	151.1294394	1		install new kerb ramp - pair	AF170	Secondary	MED	\$ 5,000
CD428	Victoria Street	Ashfield	Local Road		crossing deficiency	missing kerb ramp	-33.9033906	151.1292741	1		install new kerb ramp	AF164	Secondary	MED	\$ 2,500
CD429	Victoria Street	Ashfield	Local Road		crossing deficiency	missing crossing point	-33.9033428	151.129214	1		install new kerb ramp - pair	AF164	Secondary	MED	\$ 5,000
CD430	Victoria Street	Ashfield	Local Road		crossing deficiency	misaligned refuge island	-33.8932434	151.1299722	1		re-construct refuge island	AF162	Secondary	MED	\$ 15,000
CD431	Beattie Street	Balmain	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8586649	151.1775825	1		install new kerb ramp - pair	BA48	Secondary	MED	\$ 5,000
CD432	Beattie Street	Balmain	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8587518	151.1776281	1		install new kerb ramp - pair	BA7	Secondary	MED	\$ 5,000
CD433	Beattie Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8577877	151.1808931	1		install new kerb ramp	BA58	Secondary	MED	\$ 2,500
CD437	Beattie Street	Balmain	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8602905	151.1731325	1		install new tgsi	BA4	Secondary	MED	\$ 650
CD438	Beattie Street	Balmain	Local Road		crossing deficiency	misaligned kerb ramp	-33.8604021	151.1726782	1		install new kerb ramp	RO17	Secondary	MED	\$ 2,500
CD439	Beattie Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8605504	151.1730221	1		install new kerb ramp	RO17	Secondary	MED	\$ 2,500
CD440	Beattie Street	Balmain	Local Road		crossing deficiency	raised kerb ramp lip	-33.8593336	151.1747067	1		install new kerb ramp	BA5	Secondary	MED	\$ 2,500
CD441	Beattie Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8592631	151.1747966	1		install new kerb ramp	BA5	Secondary	MED	\$ 2,500
CD442	Birchgrove Road	Balmain	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8558744	151.1757805	1		install new kerb ramp - pair	BA11	Secondary	MED	\$ 5,000
CD443	Birchgrove Road	Balmain	Local Road		crossing deficiency	missing crossing point	-33.8541455	151.1761569	1		install new kerb ramp - pair	BA9	Secondary	MED	\$ 5,000

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD444	Birchgrove Road	Balmain	Local Road		crossing deficiency	missing crossing point	-33.8549457	151.1751354	1		install new kerb ramp - pair	BA11	Secondary	MED	\$ 5,000
CD445	Birchgrove Road	Balmain	Local Road		crossing deficiency	missing crossing point	-33.854832	151.1751679	1		install new kerb ramp - pair	BA9	Secondary	MED	\$ 5,000
CD446	Birchgrove Road	Balmain	Local Road		crossing deficiency	misaligned kerb ramp	-33.8538321	151.1767831	1		install new kerb ramp	BA10	Secondary	MED	\$ 2,500
CD447	Birchgrove Road	Balmain	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8535229	151.1773499	1		install new tgsi	BA10	Secondary	MED	\$ 650
CD450	Booth Street	Balmain	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8610199	151.1821274	1		install new kerb ramp	BA14	Secondary	MED	\$ 2,500
CD451	Booth Street	Balmain	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.860346	151.181961	1		install new kerb ramp	BA14	Secondary	MED	\$ 2,500
CD455	Curtis Road	Balmain	Local Road		crossing deficiency	misaligned kerb ramp	-33.8570839	151.1831698	1		install new kerb ramp	BA21	Secondary	MED	\$ 2,500
CD456	Curtis Road	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8568089	151.1825382	1		install new kerb ramp	BA21	Secondary	MED	\$ 2,500
CD457	Curtis Road	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8559407	151.1810003	1		install new kerb ramp	BA22	Secondary	MED	\$ 2,500
CD458	Curtis Road	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8554867	151.1806421	1		install new kerb ramp	BA23	Secondary	MED	\$ 2,500
CD459	Curtis Road	Balmain	Local Road		crossing deficiency	raised kerb ramp lip	-33.8548315	151.1792029	1		install new kerb ramp	BA19	Secondary	MED	\$ 2,500
CD460	Curtis Road	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8547535	151.1792236	1		install new kerb ramp	BA19	Secondary	MED	\$ 2,500
CD461	Curtis Road	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8550178	151.1799191	1		install new kerb ramp	BA19	Secondary	MED	\$ 2,500
CD462	Curtis Road	Balmain	Local Road		crossing deficiency	missing kerb ramp	-33.8552356	151.1806019	1		install new kerb ramp	BA23	Secondary	MED	\$ 2,500
CD463	Curtis Road	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8557881	151.180987	1		install new kerb ramp	BA23	Secondary	MED	\$ 2,500
CD464	Curtis Road	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8566141	151.18216	1		install new kerb ramp	BA21	Secondary	MED	\$ 2,500
CD470	Darling Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8559624	151.1758006	1		install new kerb ramp - pair	BA11	Secondary	MED	\$ 5,000
CD471	Darling Street	Balmain	Local Road		crossing deficiency	long crossing point	-33.8559245	151.1758183	1		install kerb extension - pair	BA11	Secondary	MED	\$ 20,000
CD472	Darling Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8565329	151.1780181	1		install new kerb ramp - pair	BA47	Secondary	MED	\$ 5,000
CD473	Darling Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8564668	151.178058	1		install new kerb ramp	BA62	Secondary	MED	\$ 2,500
CD495	Elliott Street	Balmain	Local Road		crossing deficiency	missing crossing point	-33.8565459	151.171365	1		install new kerb ramp - pair	BA69	Secondary	MED	\$ 5,000
CD496	Glassop Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8556418	151.1723104	1		install new kerb ramp - pair	BA67	Secondary	MED	\$ 5,000
CD497	Glassop Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8550924	151.1730666	1		install new kerb ramp - pair	BA67	Secondary	MED	\$ 5,000
CD498	Glassop Street	Balmain	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8551574	151.1731721	1		install new tgsi	BA67	Secondary	MED	\$ 650
CD499	Glassop Street	Balmain	Local Road		crossing deficiency	missing kerb ramp	-33.8546941	151.1738644	1		install new kerb ramp	BA66	Secondary	MED	\$ 2,500
CD500	Glassop Street	Balmain	Local Road		crossing deficiency	missing kerb ramp	-33.8539863	151.1754313	1		install new kerb ramp	BA65	Secondary	MED	\$ 2,500
CD501	Glassop Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8540299	151.1754762	1		install new kerb ramp - pair	BA65	Secondary	MED	\$ 5,000
CD502	Glassop Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8541043	151.1761048	1		install new kerb ramp	BA65	Secondary	MED	\$ 2,500
CD503	Glassop Street	Balmain	Local Road		crossing deficiency	missing kerb ramp	-33.8540382	151.1761486	1		install new kerb ramp	BA65	Secondary	MED	\$ 2,500
CD506	Hyam Street	Balmain	Local Road		crossing deficiency	narrow refuge island	-33.8620215	151.1796886	1		re-construct refuge island	BA43	Secondary	MED	\$ 15,000
CD507	Hyam Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8619294	151.1797079	1		install new kerb ramp - pair	BA43	Secondary	MED	\$ 5,000
CD510	Hyam Street	Balmain	Local Road		crossing deficiency	missing crossing point	-33.8615793	151.1802877	1		install new kerb ramp - pair	BA43	Secondary	MED	\$ 5,000
CD511	Jane Street	Balmain	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8593703	151.184494	1		install new tgsi - pair	BA45	Secondary	MED	\$ 1,300
CD517	Montague Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8583246	151.1776752	1		install new kerb ramp	BA48	Secondary	MED	\$ 2,500
CD518	Montague Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8574198	151.1778546	1		install new kerb ramp - pair	BA47	Secondary	MED	\$ 5,000
CD519	Montague Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8574472	151.1778283	1		install new kerb ramp	BA47	Secondary	MED	\$ 2,500
CD520	Montague Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8573503	151.177725	1		install new kerb ramp - pair	BA47	Secondary	MED	\$ 5,000
CD521	Montague Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8584773	151.1775517	1		install new kerb ramp	BA48	Secondary	MED	\$ 2,500
CD522	Montague Street	Balmain	Local Road		crossing deficiency	missing kerb ramp	-33.8585213	151.177543	1		install new kerb ramp	BA48	Secondary	MED	\$ 2,500
CD523	Mullens Street	Balmain	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8590194	151.177509	1		install new tgsi	BA49	Secondary	MED	\$ 650
CD524	Mullens Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8599924	151.1773341	1		install new kerb ramp - pair	BA49	Secondary	MED	\$ 5,000
CD530	Mullens Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8596564	151.1774391	1		install new kerb ramp - pair	BA49	Secondary	MED	\$ 5,000
CD533	Palmer Street	Balmain	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8592028	151.1806017	1		install new tgsi - pair	BA56	Secondary	MED	\$ 1,300
CD534	Palmer Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8598278	151.1806067	1		install new kerb ramp	BA56	Secondary	MED	\$ 2,500
CD535	Palmer Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8579938	151.1807772	1		install new kerb ramp	BA58	Secondary	MED	\$ 2,500
CD536	Palmer Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8586289	151.1798555	1		install new kerb ramp	BA53	Secondary	MED	\$ 2,500
CD537	Palmer Street	Balmain	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8583395	151.1799398	1		install new tgsi - pair	BA53	Secondary	MED	\$ 1,300
CD538	Palmer Street	Balmain	Local Road		crossing deficiency	missing crossing point	-33.8587077	151.1798724	1		install new kerb ramp - pair	BA57	Secondary	MED	\$ 5,000
CD540	Reynolds Street	Balmain	Local Road		crossing deficiency	narrow refuge island	-33.8621661	151.1797269	1		install new refuge island	BA61	Secondary	MED	\$ 15,000
CD541	Reynolds Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8622777	151.1796993	1		install new kerb ramp	BA61	Secondary	MED	\$ 2,500
CD542	Robert Street	Balmain	Local Road		crossing deficiency	missing crossing point	-33.861409	151.1774091	1		install new kerb ramp - pair	BA59	Secondary	MED	\$ 5,000
CD547	Terry Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8572644	151.1712029	1		install new kerb ramp	BA69	Secondary	MED	\$ 2,500
CD548	Terry Street	Balmain	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8568423	151.1712303	1		install new tgsi	BA69	Secondary	MED	\$ 650
CD549	Terry Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8568257	151.1710999	1		install new kerb ramp - pair	BA69	Secondary	MED	\$ 5,000
CD550	Terry Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8565268	151.1712165	1		install new kerb ramp	BA69	Secondary	MED	\$ 2,500
CD551	Terry Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8564405	151.17123	1		install new kerb ramp - pair	BA69	Secondary	MED	\$ 5,000
CD552	Thames Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.85548	151.1852364	1		install new kerb ramp	BA71	Secondary	MED	\$ 2,500
CD554	Wortley Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8614716	151.1774962	1		install new kerb ramp - pair	BA59	Secondary	MED	\$ 5,000
CD555	Wortley Street	Balmain	Local Road		crossing deficiency	raised kerb ramp lip	-33.861195	151.1780535	1		install new kerb ramp	BA59	Secondary	MED	\$ 2,500
CD556	Wortley Street	Balmain	Local Road		crossing deficiency	misaligned kerb ramp	-33.8611705	151.1781588	1		install new kerb ramp	BA59	Secondary	MED	\$ 2,500
CD557	Wortley Street	Balmain	Local Road		crossing deficiency	missing kerb ramp	-33.8611029	151.1782394	1		install new kerb ramp	BA76	Secondary	MED	\$ 2,500
CD558	Wortley Street	Balmain	Local Road		crossing deficiency	misaligned kerb ramp	-33.8598253	151.1805663	1		install new kerb ramp	BA74	Secondary	MED	\$ 2,500
CD559	Wortley Street	Balmain	Local Road		crossing deficiency	misaligned kerb ramp	-33.8598967	151.1802298	1		install new kerb ramp	BA74	Secondary	MED	\$ 2,500
CD563	Wortley Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8607302	151.1786156	1		install new kerb ramp - pair	BA76	Secondary	MED	\$ 5,000
CD564	Darling Street	Balmain East	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8580639	151.1886547	1		install new kerb ramp	BA25	Secondary	MED	\$ 2,500
CD570	Birchgrove Road	Birchgrove	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8527615	151.1788029	1		install new kerb ramp	BI4	Secondary	MED	\$ 2,500
CD571	Birchgrove Road	Birchgrove	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8526331	151.1790751	1		install new kerb ramp	BI4	Secondary	MED	\$ 2,500
CD572	Birchgrove Road	Birchgrove	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8525125	151.1790827	1		install new kerb ramp	BI4	Secondary	MED	\$ 2,500
CD577	Louisa Road	Birchgrove	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8468145	151.1854397	1		install new kerb ramp	BI7	Secondary	MED	\$ 2,500
CD578	Louisa Road	Birchgrove	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8468337	151.1855487	1		install new kerb ramp - pair	BI7	Secondary	MED	\$ 5,000
CD579	Louisa Road	Birchgrove	Local Road		crossing deficiency	missing kerb ramp	-33.8467932	151.1854718	1		install new kerb ramp	BI7	Secondary	MED	\$ 2,500
CD583	Rowntree Street	Birchgrove	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8529535	151.181435	1		install new kerb ramp - pair	BI18	Secondary	MED	\$ 5,000
CD584	Rowntree Street	Birchgrove	Local Road		crossing deficiency	missing kerb ramp	-33.8528738	151.1814149	1		install new kerb ramp	BI18	Secondary	MED	\$ 2,500
CD585	Rowntree Street	Birchgrove	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8528625	151.1812909	1		install new kerb ramp - pair	BI18	Secondary	MED	\$ 5,000
CD586	Rowntree Street	Birchgrove	Local Road		crossing deficiency	missing crossing point	-33.853024	151.1811353	1		install new kerb ramp - pair	BI18	Secondary	MED	\$ 5,000
CD587	Rowntree Street	Birchgrove	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8534354	151.180656	1		install new tgsi	BI15	Secondary	MED	\$ 650
CD588	Rowntree Street	Birchgrove	Local Road		crossing deficiency	missing crossing point	-33.8544945	151.1788772	1		install new kerb ramp - pair	BA63	Secondary	MED	\$ 5,000
CD590	Australia Street	Camperdown	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8932588	151.1768727	1		install new kerb ramp	CA8	Secondary	MED	\$ 2,500
CD591	Australia Street	Camperdown	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.893084	151.1767616	1		install new kerb ramp	CA8	Secondary	MED	\$ 2,500
CD592	Australia Street	Camperdown	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.890438	151.1757535	1		install new kerb ramp	CA6	Secondary	MED	\$ 2,500
CD593	Australia Street	Camperdown	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8876138	151.1744729	1		install new tgsi	CA2	Secondary	MED	\$ 650
CD594	Derby Street	Camperdown	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8899326	151.1747151	1		install new kerb ramp - pair	CA17	Secondary	MED	\$ 5,000

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD595	Derby Street	Camperdown	Local Road		crossing deficiency	missing kerb ramp	-33.8899084	151.1745824	1		install new kerb ramp	CA17	Secondary	MED	\$ 2,500
CD596	Gordon Street	Camperdown	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8873988	151.1743458	1		install new kerb ramp - pair	CA2	Secondary	MED	\$ 5,000
CD605	Salisbury Road	Camperdown	Regional Road		crossing deficiency	misaligned kerb ramp	-33.8918516	151.17638	1		install new kerb ramp	CA7	Secondary	MED	\$ 2,500
CD606	Salisbury Road	Camperdown	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8913522	151.1779697	1		install new kerb ramp - pair	CA24	Secondary	MED	\$ 5,000
CD607	Salisbury Road	Camperdown	Regional Road		crossing deficiency	misaligned kerb ramp	-33.8916302	151.177091	1		install new kerb ramp	CA25	Secondary	MED	\$ 2,500
CD608	Salisbury Road	Camperdown	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8918793	151.1754722	1		install new kerb ramp - pair	CA26	Secondary	MED	\$ 5,000
CD609	Salisbury Road	Camperdown	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8919844	151.1754891	1		install new kerb ramp - pair	CA26	Secondary	MED	\$ 5,000
CD610	Salisbury Road	Camperdown	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8916576	151.1731783	1		install new kerb ramp	CA28	Secondary	MED	\$ 2,500
CD611	Church Street	Croydon	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8752773	151.1185654	1		install new kerb ramp - pair	CR1	Secondary	MED	\$ 5,000
CD612	Church Street	Croydon	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8759166	151.1230321	1		install new kerb ramp - pair	CR1	Secondary	MED	\$ 5,000
CD613	Croydon Road	Croydon	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8748669	151.1241412	1		install new kerb ramp - pair	CR6	Secondary	MED	\$ 5,000
CD614	Croydon Road	Croydon	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8739786	151.1250532	1		install new kerb ramp	CR5	Secondary	MED	\$ 2,500
CD615	Croydon Road	Croydon	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8735371	151.1255032	1		install new tgsi	CR4	Secondary	MED	\$ 650
CD616	Croydon Road	Croydon	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8730675	151.1260347	1		install new kerb ramp - pair	CR4	Secondary	MED	\$ 5,000
CD617	Croydon Road	Croydon	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8733936	151.1257763	1		install new tgsi	CR4	Secondary	MED	\$ 650
CD618	Croydon Road	Croydon	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8743784	151.1247417	1		install new kerb ramp - pair	CR5	Secondary	MED	\$ 5,000
CD619	Croydon Road	Croydon	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8747063	151.1244304	1		install new tgsi	CR6	Secondary	MED	\$ 650
CD620	Croydon Road	Croydon	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8784575	151.1214461	1		install new kerb ramp	CR12	Secondary	MED	\$ 2,500
CD621	Croydon Road	Croydon	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8795542	151.1206849	1		install new kerb ramp - pair	CR14	Secondary	MED	\$ 5,000
CD622	Croydon Road	Croydon	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8801775	151.1202738	1		install new kerb ramp - pair	CR3	Secondary	MED	\$ 5,000
CD623	Croydon Road	Croydon	Local Road	Strategic Route	crossing deficiency	raised kerb ramp lip - pair	-33.8828275	151.1183584	1		install new kerb ramp - pair	CR11	Secondary	MED	\$ 5,000
CD624	Croydon Road	Croydon	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8813975	151.1193215	1		install new tgsi	CR15	Secondary	MED	\$ 650
CD625	Croydon Road	Croydon	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.88105	151.119566	1		install new tgsi	CR15	Secondary	MED	\$ 650
CD626	Croydon Road	Croydon	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8797428	151.1204554	1		install new kerb ramp - pair	CR14	Secondary	MED	\$ 5,000
CD627	Croydon Road	Croydon	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8786236	151.1212044	1		install new kerb ramp - pair	CR12	Secondary	MED	\$ 5,000
CD628	Edwin Street	Croydon	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8815446	151.1183449	1		install new kerb ramp - pair	CR17	Secondary	MED	\$ 5,000
CD629	Edwin Street	Croydon	Local Road		crossing deficiency	missing kerb ramp	-33.8815184	151.1181591	1		install new kerb ramp	CR17	Secondary	MED	\$ 2,500
CD630	Edwin Street	Croydon	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8815312	151.1181397	1		install new kerb ramp	CR17	Secondary	MED	\$ 2,500
CD631	Edwin Street	Croydon	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8814934	151.1181901	1		install new kerb ramp	CR17	Secondary	MED	\$ 2,500
CD632	Elizabeth Street	Croydon	Regional Road		crossing deficiency	missing kerb ramp	-33.8835587	151.1191835	1		install new kerb ramp	CR20	Secondary	MED	\$ 2,500
CD633	Elizabeth Street	Croydon	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.883169	151.1182709	1		install new kerb ramp - pair	CR20	Secondary	MED	\$ 5,000
CD637	Elizabeth Street	Croydon	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8825008	151.1173179	1		install new kerb ramp - pair	CR17	Secondary	MED	\$ 5,000
CD644	Malvern Avenue	Croydon	Local Road		crossing deficiency	missing kerb ramp	-33.8842024	151.1132188	1		install new kerb ramp	CR35	Secondary	MED	\$ 2,500
CD645	Malvern Avenue	Croydon	Local Road		crossing deficiency	missing crossing point	-33.8839626	151.1134287	1		install new kerb ramp - pair	CR35	Secondary	MED	\$ 5,000
CD646	Parramatta Road	Croydon	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8740891	151.127877	1		install new kerb ramp - pair	CR33	Secondary	MED	\$ 5,000
CD647	Parramatta Road	Croydon	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8731446	151.1261382	1		install new kerb ramp - pair	CR32	Secondary	MED	\$ 5,000
CD648	Parramatta Road	Croydon	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8716716	151.1235875	1		install new kerb ramp - pair	CR28	Secondary	MED	\$ 5,000
CD649	Parramatta Road	Croydon	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8713406	151.1219535	1		install new kerb ramp - pair	CR27	Secondary	MED	\$ 5,000
CD650	Parramatta Road	Croydon	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8737788	151.126963	1		install new kerb ramp	CR33	Secondary	MED	\$ 2,500
CD651	Parramatta Road	Croydon	State Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.8716794	151.1236056	1		install new kerb ramp - pair	CR28	Secondary	MED	\$ 5,000
CD652	Thomas Street	Croydon	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8860126	151.1171937	1		install new kerb ramp	CR38	Secondary	MED	\$ 2,500
CD653	Thomas Street	Croydon	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8855896	151.1166707	1		install new kerb ramp	CR39	Secondary	MED	\$ 2,500
CD656	Thomas Street	Croydon	Local Road	Strategic Route	crossing deficiency	missing crossing point	-33.8848829	151.1152211	1		install new kerb ramp - pair	CR37	Secondary	MED	\$ 5,000
CD657	Thomas Street	Croydon	Local Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8844531	151.1145698	1		install new kerb ramp	CR41	Secondary	MED	\$ 2,500
CD658	Thomas Street	Croydon	Local Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8844789	151.1142838	1		install new kerb ramp	CR41	Secondary	MED	\$ 2,500
CD659	Thomas Street	Croydon	Local Road	Strategic Route	crossing deficiency	missing crossing point	-33.8841142	151.1141763	1		install new kerb ramp - pair	CR41	Secondary	MED	\$ 5,000
CD661	Georges River Drive	Croydon Park	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8935393	151.1154484	1		install new kerb ramp - pair	CP3	Secondary	MED	\$ 5,000
CD662	Georges River Drive	Croydon Park	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.893766	151.1154852	1		install new kerb ramp - pair	CP3	Secondary	MED	\$ 5,000
CD663	Georges River Drive	Croydon Park	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8939969	151.1144233	1		install new kerb ramp - pair	CP5	Secondary	MED	\$ 5,000
CD664	Georges River Drive	Croydon Park	Local Road		crossing deficiency	misaligned kerb ramp	-33.8940791	151.1137564	1		install new kerb ramp	CP5	Secondary	MED	\$ 2,500
CD665	Georges River Drive	Croydon Park	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8942049	151.1131179	1		install new kerb ramp - pair	CP1	Secondary	MED	\$ 5,000
CD666	Georges River Drive	Croydon Park	Local Road		crossing deficiency	missing crossing point	-33.8940128	151.1135123	1		install new kerb ramp - pair	CP1	Secondary	MED	\$ 5,000
CD667	Georges River Drive	Croydon Park	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8939852	151.1136111	1		install new kerb ramp - pair	CP5	Secondary	MED	\$ 5,000
CD669	Greenhills Street	Croydon Park	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8942538	151.1125331	1		install new kerb ramp - pair	CP1	Secondary	MED	\$ 5,000
CD671	Arlington Street	Dulwich Hill	Local Road		crossing deficiency	misaligned kerb ramp	-33.9007522	151.136071	1		install new kerb ramp	DH15	Secondary	MED	\$ 2,500
CD677	Arlington Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.900881	151.1322055	1		install new kerb ramp - pair	DH12	Secondary	MED	\$ 5,000
CD679	Arlington Street	Dulwich Hill	Local Road		crossing deficiency	misaligned refuge island	-33.9007472	151.1361198	1		install new refuge island	DH15	Secondary	MED	\$ 15,000
CD680	Bedford Crescent	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9107348	151.1413491	1		install new kerb ramp - pair	DH2	Secondary	MED	\$ 5,000
CD681	Bedford Crescent	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9106104	151.1411023	1		install new tgsi - pair	DH2	Secondary	MED	\$ 1,300
CD682	Blackwood Avenue	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9066406	151.1410675	1		install new kerb ramp - pair	DH4	Secondary	MED	\$ 5,000
CD683	Blackwood Lane	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9073462	151.1405	1		install new tgsi	DH4	Secondary	MED	\$ 650
CD687	Consett Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9057109	151.1380482	1		install new kerb ramp - pair	DH9	Secondary	MED	\$ 5,000
CD688	Consett Street	Dulwich Hill	Local Road		crossing deficiency	misaligned kerb ramp	-33.9060892	151.1388833	1		install new kerb ramp	DH9	Secondary	MED	\$ 2,500
CD689	Constitution Road	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9009773	151.1363269	1		install new kerb ramp - pair	DH15	Secondary	MED	\$ 5,000
CD690	Constitution Road	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9023499	151.1376286	1		install new kerb ramp - pair	DH17	Secondary	MED	\$ 5,000
CD691	Constitution Road	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9037437	151.14087	1		install new kerb ramp - pair	DH18	Secondary	MED	\$ 5,000
CD692	Constitution Road	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9036243	151.1407936	1		install new kerb ramp - pair	DH18	Secondary	MED	\$ 5,000
CD694	Constitution Road	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9020905	151.1377052	1		install new kerb ramp - pair	DH19	Secondary	MED	\$ 5,000
CD695	Davis Street	Dulwich Hill	Local Road		crossing deficiency	misaligned kerb ramp	-33.8994331	151.1405688	1		install new kerb ramp	DH21	Secondary	MED	\$ 2,500
CD696	Denison Road	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9007603	151.1411805	1		install new tgsi - pair	DH103	Secondary	MED	\$ 1,300
CD699	Ewart Lane	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9105928	151.1390339	1		install new tgsi	DH27	Secondary	MED	\$ 650
CD700	Ewart Street	Dulwich Hill	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9097717	151.1377416	1		install new kerb ramp - pair	DH39	Secondary	MED	\$ 5,000
CD701	Ewart Street	Dulwich Hill	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9099376	151.1349049	1		install new kerb ramp - pair	DH28	Secondary	MED	\$ 5,000
CD706	Ewart Street	Dulwich Hill	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9117868	151.1399619	1		install new kerb ramp - pair	DH30	Secondary	MED	\$ 5,000
CD711	Grove Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9023308	151.1386542	1		install new kerb ramp - pair	DH1	Secondary	MED	\$ 5,000
CD712	Grove Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9023146	151.1386789	1		install new kerb ramp - pair	DH60	Secondary	MED	\$ 5,000
CD713	Grove Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9011485	151.1397749	1		install new kerb ramp - pair	DH69	Secondary	MED	\$ 5,000
CD714	Hampstead Road	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8980636	151.137554	1		install new kerb ramp - pair	DH63	Secondary	MED	\$ 5,000
CD715	Hampstead Road	Dulwich Hill	Local Road		crossing deficiency	misaligned kerb ramp	-33.8987867	151.1383332	1		install new kerb ramp	DH63	Secondary	MED	\$ 2,500
CD716	Hampstead Road	Dulwich Hill	Local Road		crossing deficiency	long crossing point	-33.8971433	151.1366431	1		install kerb extension / refuge island	DH62	Secondary	MED	\$ 10,000
CD717	Hercules Street	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.907281	151.1388253	1		install new tgsi - pair	DH65	Secondary	MED	\$ 1,300
CD719	Hercules Street	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.90486	151.140219	1		install new tgsi - pair	DH64	Secondary	MED	\$ 1,300

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD720	Hercules Street	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.904878	151.140428	1		install new tgsi - pair	DH64	Secondary	MED	\$ 1,300
CD721	Hill Street	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9014678	151.1405199	1		install new tgsi	DH69	Secondary	MED	\$ 650
CD723	Keith Lane	Dulwich Hill	Local Road		crossing deficiency	missing kerb ramp	-33.9090916	151.1402285	1		install new kerb ramp	DH71	Secondary	MED	\$ 2,500
CD724	Keith Lane	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9095772	151.1398964	1		install new tgsi	DH71	Secondary	MED	\$ 650
CD725	Kintore Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9065793	151.141114	1		install new kerb ramp - pair	DH74	Secondary	MED	\$ 5,000
CD726	Kintore Street	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9071954	151.141907	1		install new tgsi - pair	DH73	Secondary	MED	\$ 1,300
CD727	Kintore Street	Dulwich Hill	Local Road		crossing deficiency	misaligned refuge island	-33.9071163	151.1418726	1		re-construct refuge island	DH73	Secondary	MED	\$ 15,000
CD729	Marrickville Road	Dulwich Hill	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9066332	151.1457696	1		install new kerb ramp	MV240	Secondary	MED	\$ 2,500
CD730	Marrickville Road	Dulwich Hill	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.9060924	151.145159	1		install new kerb ramp	DH77	Secondary	MED	\$ 2,500
CD735	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9007952	151.1449091	1		install new kerb ramp	DH34	Secondary	MED	\$ 2,500
CD736	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9008364	151.1449111	1		install new kerb ramp	DH34	Secondary	MED	\$ 2,500
CD751	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	raised kerb ramp lip	-33.9049744	151.1317517	1		install new kerb ramp	DH90	Secondary	MED	\$ 2,500
CD752	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	crossing deficiency	raised kerb ramp lip	-33.9049702	151.1319012	1		install new kerb ramp	DH90	Secondary	MED	\$ 2,500
CD767	Old Canterbury Road	Dulwich Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8965676	151.1372971	1		install new kerb ramp - pair	SH57	Secondary	MED	\$ 5,000
CD768	Old Canterbury Road	Dulwich Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8971162	151.1366974	1		install new kerb ramp - pair	DH62	Secondary	MED	\$ 5,000
CD769	Old Canterbury Road	Dulwich Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8976129	151.1358027	1		install new kerb ramp - pair	SH58	Secondary	MED	\$ 5,000
CD773	Old Canterbury Road	Dulwich Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8994826	151.1334301	1		install new kerb ramp - pair	SH61	Secondary	MED	\$ 5,000
CD774	Old Canterbury Road	Dulwich Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9007227	151.1322945	1		install new kerb ramp - pair	DH12	Secondary	MED	\$ 5,000
CD780	Piggott Street	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9008067	151.1411858	1		install new tgsi - pair	DH103	Secondary	MED	\$ 1,300
CD781	Piggott Street	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9008486	151.1411155	1		install new tgsi - pair	DH103	Secondary	MED	\$ 1,300
CD782	Piggott Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9016769	151.142662	1		install new kerb ramp - pair	DH101	Secondary	MED	\$ 5,000
CD784	Piggott Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9016665	151.1427529	1		install new kerb ramp - pair	DH101	Secondary	MED	\$ 5,000
CD785	Piggott Street	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9007648	151.1411229	1		install new tgsi - pair	DH103	Secondary	MED	\$ 1,300
CD786	Tennyson Street	Dulwich Hill	Local Road		crossing deficiency	missing crossing point	-33.9110329	151.1369075	1		install new kerb ramp - pair	DH38	Secondary	MED	\$ 5,000
CD788	Terrace Road	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9094305	151.1380898	1		install new kerb ramp - pair	DH52	Secondary	MED	\$ 5,000
CD789	Terrace Road	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9071884	151.1378342	1		install new tgsi - pair	DH114	Secondary	MED	\$ 1,300
CD791	Terrace Road	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp construction	-33.9057105	151.1378894	1		install new kerb ramp	DH112	Secondary	MED	\$ 2,500
CD792	Terrace Road	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9050546	151.1380625	1		install new kerb ramp	DH112	Secondary	MED	\$ 2,500
CD793	Terry Road	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8994151	151.1378793	1		install new kerb ramp - pair	DH115	Secondary	MED	\$ 5,000
CD794	Wardell Road	Dulwich Hill	Regional Road		crossing deficiency	steep kerb ramp	-33.9061589	151.1463166	1		install new kerb ramp - pair	DH121	Secondary	MED	\$ 5,000
CD795	Wardell Road	Dulwich Hill	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.9038219	151.1486402	1		install new kerb ramp	MV234	Secondary	MED	\$ 2,500
CD796	Wardell Road	Dulwich Hill	Regional Road		crossing deficiency	misaligned refuge island	-33.9037709	151.1486929	1		re-construct refuge island	MV234	Secondary	MED	\$ 15,000
CD798	Wardell Road	Dulwich Hill	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9077637	151.1443298	1		install new kerb ramp - pair	MV232	Secondary	MED	\$ 5,000
CD803	Wardell Road	Dulwich Hill	Regional Road		crossing deficiency	misaligned refuge island	-33.9090365	151.1432282	1		no action	DH6	Secondary	MED	\$ -
CD806	Wardell Road	Dulwich Hill	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9131144	151.1381292	1		install new kerb ramp - pair	MV233	Secondary	MED	\$ 5,000
CD807	Wardell Road	Dulwich Hill	Regional Road		crossing deficiency	missing kerb ramp	-33.903833	151.1486958	1		install new kerb ramp	MV234	Secondary	MED	\$ 2,500
CD808	Weston Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8981965	151.1392956	1		install new kerb ramp - pair	DH117	Secondary	MED	\$ 5,000
CD809	Weston Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8985352	151.1398547	1		install new kerb ramp - pair	DH117	Secondary	MED	\$ 5,000
CD810	Weston Street	Dulwich Hill	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8959299	151.1417119	1		install new tgsi	DH45	Secondary	MED	\$ 650
CD811	Weston Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8955353	151.1417533	1		install new kerb ramp - pair	DH45	Secondary	MED	\$ 5,000
CD813	Williams Parade	Dulwich Hill	Local Road		crossing deficiency	misaligned refuge island	-33.9023379	151.1373934	1		re-construct refuge island	DH127	Secondary	MED	\$ 15,000
CD814	Windsor Road	Dulwich Hill	Local Road		crossing deficiency	missing crossing point	-33.8988262	151.1383436	1		install new kerb ramp - pair	DH128	Secondary	MED	\$ 5,000
CD815	Windsor Road	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8983625	151.1389759	1		install new kerb ramp - pair	DH128	Secondary	MED	\$ 5,000
CD816	Windsor Road	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8982078	151.1391886	1		install new kerb ramp	DH128	Secondary	MED	\$ 2,500
CD817	Windsor Road	Dulwich Hill	Local Road		crossing deficiency	missing crossing point	-33.89812	151.1392877	1		install new kerb ramp - pair	DH117	Secondary	MED	\$ 5,000
CD818	Windsor Road	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8982429	151.1390417	1		install new kerb ramp - pair	DH128	Secondary	MED	\$ 5,000
CD819	Edgeware Road	Enmore	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9039623	151.1728976	1		install new kerb ramp	EN5	Secondary	MED	\$ 2,500
CD820	Edgeware Road	Enmore	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.902519	151.1722368	1		install new tgsi	EN4	Secondary	MED	\$ 650
CD837	Liberty Street	Enmore	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8982676	151.1697649	1		install new kerb ramp	EN10	Secondary	MED	\$ 2,500
CD839	Llewellyn Street	Enmore	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9048259	151.1730836	1		install new tgsi	MV124	Secondary	MED	\$ 650
CD841	Phillip Street	Enmore	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8968338	151.1732606	1		install new kerb ramp	NE45	Secondary	MED	\$ 2,500
CD843	Stanmore Road	Enmore	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8988649	151.1695666	1		install new kerb ramp	EN10	Secondary	MED	\$ 2,500
CD846	Alt Street	Haberfield	Local Road		crossing deficiency	missing crossing point	-33.8792449	151.1312181	1		install new kerb ramp - pair	AF6	Secondary	MED	\$ 5,000
CD848	Alt Street	Haberfield	Local Road		crossing deficiency	long crossing	-33.8769361	151.135886	1		install kerb extension - pair	HA1	Secondary	MED	\$ 20,000
CD850	Alt Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8790457	151.13138	1		install new kerb ramp - pair	AF6	Secondary	MED	\$ 5,000
CD851	Bland Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8803503	151.1321085	1		install new kerb ramp - pair	AF29	Secondary	MED	\$ 5,000
CD852	Bland Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8787333	151.1346157	1		install new kerb ramp - pair	HA20	Secondary	MED	\$ 5,000
CD853	Bland Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8787831	151.1346477	1		install new kerb ramp - pair	HA20	Secondary	MED	\$ 5,000
CD854	Bland Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8788686	151.1346566	1		install new kerb ramp - pair	HA40	Secondary	MED	\$ 5,000
CD855	Bland Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8804285	151.1321639	1		install new kerb ramp - pair	AF29	Secondary	MED	\$ 5,000
CD856	Bland Street	Haberfield	Local Road		crossing deficiency	misaligned refuge island	-33.8787703	151.1346793	1		re-construct refuge island	HA20	Secondary	MED	\$ 15,000
CD857	Boomerang Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8708516	151.1451873	1		install new kerb ramp	HA22	Secondary	MED	\$ 2,500
CD858	Boomerang Street	Haberfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8709093	151.1450987	1		install new tgsi	HA22	Secondary	MED	\$ 650
CD859	Boomerang Street	Haberfield	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8728692	151.1436091	1		install new kerb ramp - pair	HA26	Secondary	MED	\$ 5,000
CD860	Boomerang Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8746878	151.1425076	1		install new kerb ramp - pair	HA25	Secondary	MED	\$ 5,000
CD861	Boomerang Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8736799	151.1429914	1		install new kerb ramp	HA26	Secondary	MED	\$ 2,500
CD862	Boomerang Street	Haberfield	Local Road		crossing deficiency	missing crossing point	-33.8725329	151.143909	1		install new kerb ramp - pair	HA23	Secondary	MED	\$ 5,000
CD868	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	missing crossing point	-33.8757537	151.142096	1		install new kerb ramp - pair	HA33	Secondary	MED	\$ 5,000
CD869	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8762274	151.142021	1		install new kerb ramp - pair	HA33	Secondary	MED	\$ 5,000
CD870	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8773487	151.1411374	1		install new kerb ramp - pair	HA29	Secondary	MED	\$ 5,000
CD877	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	long driveway crossing point	-33.8842536	151.1361589	1		install new tgsi	HA37	Secondary	MED	\$ 650
CD878	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8846473	151.1357344	1		install new kerb ramp - pair	HA37	Secondary	MED	\$ 5,000
CD879	Dalhousie Street	Haberfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8821048	151.1372691	1		install new kerb ramp - pair	HA31	Secondary	MED	\$ 5,000
CD880	Denman Avenue	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8805829	151.135942	1		install new kerb ramp - pair	HA42	Secondary	MED	\$ 5,000
CD881	Denman Avenue	Haberfield	Local Road		crossing deficiency	misaligned kerb ramp	-33.8797108	151.1353129	1		install new kerb ramp	HA43	Secondary	MED	\$ 2,500
CD882	Denman Avenue	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8808469	151.1359554	1		install new kerb ramp - pair	HA42	Secondary	MED	\$ 5,000
CD883	Denman Avenue	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8809655	151.136099	1		install new kerb ramp	HA42	Secondary	MED	\$ 2,500
CD884	Denman Avenue	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8813036	151.1364693	1		install new kerb ramp - pair	HA42	Secondary	MED	\$ 5,000
CD885	Hawthorn Parade	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8849074	151.1439346	1		install new kerb ramp	HA56	Secondary	MED	\$ 2,500
CD886	Hawthorn Parade	Haberfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8863671	151.1440608	1		install new tgsi	HA55	Secondary	MED	\$ 650
CD887	Hawthorn Parade	Haberfield	Local Road		crossing deficiency	missing kerb ramp	-33.8878599	151.1437861	1		install new kerb ramp	HA55	Secondary	MED	\$ 2,500
CD888	Hawthorn Parade	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8875614	151.1438391	1		install new kerb ramp	HA55	Secondary	MED	\$ 2,500

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD890	Hawthorne Parade	Haberfield	Local Road		crossing deficiency	missing kerb ramp - pair	-33.886186	151.14418	1		install new kerb ramp - pair	LH85	Secondary	MED	\$ 5,000
CD894	Mortley Avenue	Haberfield	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8719773	151.1430696	1		install new tgsi - pair	HA63	Secondary	MED	\$ 1,300
CD895	Mortley Avenue	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8709176	151.1418384	1		install new kerb ramp - pair	HA62	Secondary	MED	\$ 5,000
CD896	Mortley Avenue	Haberfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8710362	151.1417538	1		install new tgsi	HA62	Secondary	MED	\$ 650
CD897	Mortley Avenue	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8708891	151.1419349	1		install new kerb ramp - pair	HA62	Secondary	MED	\$ 5,000
CD898	Mortley Avenue	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8725937	151.1436199	1		install new kerb ramp - pair	HA63	Secondary	MED	\$ 5,000
CD899	Parramatta Road	Haberfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8845575	151.1356393	1		install new kerb ramp - pair	HA37	Secondary	MED	\$ 5,000
CD900	Parramatta Road	Haberfield	State Road	Strategic Route	crossing deficiency	missing crossing point	-33.8803787	151.1322703	1		install new kerb ramp - pair	AF29	Secondary	MED	\$ 5,000
CD901	Parramatta Road	Haberfield	State Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8744267	151.1279475	1		install new kerb ramp - pair	HA80	Secondary	MED	\$ 5,000
CD902	Parramatta Road	Haberfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8753853	151.1287346	1		install new kerb ramp - pair	HA81	Secondary	MED	\$ 5,000
CD907	Parramatta Road	Haberfield	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8874669	151.1419067	1		install new kerb ramp - pair	HA100	Secondary	MED	\$ 5,000
CD915	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8777665	151.1365838	1		install new kerb ramp	HA17	Secondary	MED	\$ 2,500
CD916	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	long crossing point	-33.8777315	151.1365564	1		install kerb extension - pair	HA17	Secondary	MED	\$ 20,000
CD917	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8769012	151.1358594	1		install new kerb ramp	HA1	Secondary	MED	\$ 2,500
CD919	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8753024	151.13467	1		install new kerb ramp - pair	HA87	Secondary	MED	\$ 5,000
CD920	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8753097	151.1346031	1		install new kerb ramp - pair	HA87	Secondary	MED	\$ 5,000
CD926	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8847642	151.1422697	1		install new kerb ramp	HA91	Secondary	MED	\$ 2,500
CD927	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8851566	151.1427099	1		install new kerb ramp - pair	HA91	Secondary	MED	\$ 5,000
CD930	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8741253	151.1336886	1		install new kerb ramp - pair	HA98	Secondary	MED	\$ 5,000
CD931	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.873301	151.1329891	1		install new kerb ramp - pair	HA96	Secondary	MED	\$ 5,000
CD932	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	missing crossing point	-33.8734724	151.1332183	1		install new kerb ramp - pair	HA96	Secondary	MED	\$ 5,000
CD933	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.873328	151.1331919	1		install new kerb ramp - pair	HA96	Secondary	MED	\$ 5,000
CD934	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8750111	151.1342941	1		install new kerb ramp - pair	HA97	Secondary	MED	\$ 5,000
CD935	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	traffic post narrows kerb ramp	-33.8748545	151.1342735	1		refer to Transport for NSW	HA97	Secondary	MED	\$ -
CD936	Sloane Street	Haberfield	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8868444	151.1424491	1		install new kerb ramp - pair	HA100	Secondary	MED	\$ 5,000
CD937	Waratah Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8744936	151.1397335	1		install new kerb ramp - pair	HA108	Secondary	MED	\$ 5,000
CD941	Waratah Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8747763	151.1399686	1		install new kerb ramp - pair	HA108	Secondary	MED	\$ 5,000
CD942	Waratah Street	Haberfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8748446	151.1401821	1		install new tgsi	HA107	Secondary	MED	\$ 650
CD943	Waratah Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8752315	151.1411123	1		install new kerb ramp	HA107	Secondary	MED	\$ 2,500
CD944	Waratah Street	Haberfield	Local Road		crossing deficiency	long crossing	-33.8752594	151.1411847	1		install kerb extension - pair	HA107	Secondary	MED	\$ 20,000
CD945	Waratah Street	Haberfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.875285	151.1412335	1		install new tgsi	HA106	Secondary	MED	\$ 650
CD953	Hardy Street	Hurlstone Park	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.906481	151.123516	1		install new kerb ramp - pair	HP2	Secondary	MED	\$ 5,000
CD954	Hardy Street	Hurlstone Park	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9059188	151.1238796	1		install new kerb ramp - pair	HP2	Secondary	MED	\$ 5,000
CD955	Hardy Street	Hurlstone Park	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9051667	151.1243203	1		install new kerb ramp - pair	HP1	Secondary	MED	\$ 5,000
CD956	Hardy Street	Hurlstone Park	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9038758	151.125114	1		install new kerb ramp - pair	AF82	Secondary	MED	\$ 5,000
CD957	New Canterbury Road	Hurlstone Park	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9049682	151.1302946	1		install new kerb ramp - pair	DH91	Secondary	MED	\$ 5,000
CD959	Old Canterbury Road	Hurlstone Park	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9052222	151.1282325	1		install new kerb ramp - pair	HP4	Secondary	MED	\$ 5,000
CD963	Old Canterbury Road	Hurlstone Park	State Road		crossing deficiency	missing kerb ramp - pair	-33.9075446	151.12588	1		install new kerb ramp - pair	HP3	Secondary	MED	\$ 5,000
CD966	Old Canterbury Road	Hurlstone Park	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9048205	151.1284023	1		install new kerb ramp - pair	HP4	Secondary	MED	\$ 5,000
CD967	Old Canterbury Road	Hurlstone Park	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9046863	151.1284434	1		install new kerb ramp - pair	HP4	Secondary	MED	\$ 5,000
CD968	Lord Street	Leichhardt	Local Road		crossing deficiency	narrow kerb ramp - pair	-33.886186	151.14418	1		install new kerb ramp - pair	LH85	Secondary	MED	\$ 5,000
CD969	Allen Street	Leichhardt	Local Road		crossing deficiency	misaligned refuge island	-33.8803288	151.1499812	1		re-construct refuge island	LH3	Secondary	MED	\$ 15,000
CD970	Allen Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8804324	151.1487811	1		install new tgsi	LH2	Secondary	MED	\$ 650
CD971	Allen Street	Leichhardt	Local Road		crossing deficiency	missing kerb ramp	-33.8804149	151.1499484	1		install new kerb ramp	LH3	Secondary	MED	\$ 2,500
CD972	Allen Street	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp	-33.8804215	151.1500056	1		install new kerb ramp	LH4	Secondary	MED	\$ 2,500
CD973	Allen Street	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8802032	151.153377	1		install new kerb ramp - pair	LH7	Secondary	MED	\$ 5,000
CD974	Allen Street	Leichhardt	Local Road		crossing deficiency	missing kerb ramp	-33.8800694	151.1548264	1		install new kerb ramp	LH7	Secondary	MED	\$ 2,500
CD975	Allen Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8800611	151.1548638	1		install new kerb ramp	LH1	Secondary	MED	\$ 2,500
CD976	Allen Street	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp	-33.880102	151.1560069	1		install new kerb ramp	LH8	Secondary	MED	\$ 2,500
CD977	Allen Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8799432	151.1557942	1		install new kerb ramp	LH8	Secondary	MED	\$ 2,500
CD978	Allen Street	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp	-33.8803051	151.1501541	1		install new kerb ramp	LH4	Secondary	MED	\$ 2,500
CD980	Balmain Road	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8781925	151.1596977	1		install new kerb ramp	LH106	Secondary	MED	\$ 2,500
CD993	Balmain Road	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.884515	151.1591948	1		install new kerb ramp - pair	LH146	Secondary	MED	\$ 5,000
CD1000	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.886033	151.1619813	1		install new kerb ramp	LH26	Secondary	MED	\$ 2,500
CD1001	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.8861942	151.1618177	1		install new tgsi - pair	LH26	Secondary	MED	\$ 1,300
CD1002	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8845131	151.162455	1		install new kerb ramp - pair	LH29	Secondary	MED	\$ 5,000
CD1003	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8831614	151.1627543	1		install new kerb ramp - pair	LH149	Secondary	MED	\$ 5,000
CD1004	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8832074	151.1627988	1		install new kerb ramp - pair	LH22	Secondary	MED	\$ 5,000
CD1005	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8831695	151.1628509	1		install new kerb ramp	LH152	Secondary	MED	\$ 2,500
CD1006	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.88313	151.1627932	1		install new kerb ramp - pair	LH28	Secondary	MED	\$ 5,000
CD1007	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8831397	151.1628534	1		install new kerb ramp - pair	LH152	Secondary	MED	\$ 5,000
CD1008	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8831143	151.1628284	1		install new kerb ramp	LH28	Secondary	MED	\$ 2,500
CD1009	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8807214	151.1636931	1		install new tgsi	LH23	Secondary	MED	\$ 650
CD1010	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8807938	151.1635852	1		install new kerb ramp - pair	LH23	Secondary	MED	\$ 5,000
CD1016	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.8808569	151.1636109	1		install new tgsi - pair	LH23	Secondary	MED	\$ 1,300
CD1017	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.8808412	151.1635275	1		install new tgsi - pair	LH23	Secondary	MED	\$ 1,300
CD1018	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	uneven crossing surface	-33.8808366	151.1635411	1		install new pavement surface	LH23	Secondary	MED	\$ 300
CD997	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8831851	151.1628526	1		install new kerb ramp	LH152	Secondary	MED	\$ 2,500
CD998	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8872127	151.1616108	1		install new kerb ramp	LH25	Secondary	MED	\$ 2,500
CD999	Catherine Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8870579	151.1616816	1		install new tgsi	LH25	Secondary	MED	\$ 650
CD1020	Darley Road	Leichhardt	State Road		crossing deficiency	poor kerb ramp alignment	-33.8754543	151.1548161	1		install new kerb ramp	LH31	Secondary	MED	\$ 2,500
CD1021	Darley Road	Leichhardt	State Road		crossing deficiency	misaligned kerb ramp	-33.8754258	151.1543895	1		install new kerb ramp	LH31	Secondary	MED	\$ 2,500
CD1022	Darley Road	Leichhardt	State Road		crossing deficiency	at grade crossing missing tgsi	-33.8754931	151.1537831	1		install new tgsi	LH32	Secondary	MED	\$ 650
CD1023	Darley Road	Leichhardt	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8754752	151.1533995	1		install new kerb ramp - pair	LH32	Secondary	MED	\$ 5,000
CD1024	Darley Road	Leichhardt	State Road		crossing deficiency	at grade crossing missing tgsi	-33.8754243	151.1537695	1		install new tgsi	LH32	Secondary	MED	\$ 650
CD1025	Darley Road	Leichhardt	State Road		crossing deficiency	narrow kerb ramp	-33.8756398	151.1520046	1		install new kerb ramp	LH34	Secondary	MED	\$ 2,500
CD1026	Darley Road	Leichhardt	State Road		crossing deficiency	at grade crossing missing tgsi	-33.8757045	151.1515046	1		install new tgsi	LH34	Secondary	MED	\$ 650
CD1027	Darley Road	Leichhardt	State Road		crossing deficiency	misaligned kerb ramp - pair	-33.8761746	151.1505695	1		install new kerb ramp - pair	LH36	Secondary	MED	\$ 5,000
CD1028	Darley Road	Leichhardt	State Road		crossing deficiency	misaligned kerb ramp	-33.8765202	151.150235	1		install new kerb ramp	LH36	Secondary	MED	\$ 2,500
CD1029	Darley Road	Leichhardt	State Road		crossing deficiency	poor kerb ramp alignment	-33.8771493	151.1494099	1		install new kerb ramp	LH172	Secondary	MED	\$ 2,500
CD1030	Darley Road	Leichhardt	State Road		crossing deficiency	narrow kerb ramp	-33.8772307	151.1493159	1		install new kerb ramp	LH38	Secondary	MED	\$ 2,500
CD1031	Darley Road	Leichhardt	State Road		crossing deficiency	poor kerb ramp construction	-33.8783393	151.1482085	1		install new kerb ramp	LH39	Secondary	MED	\$ 2,500

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD1032	Derbyshire Road	Leichhardt	Local Road		crossing deficiency	missing crossing point	-33.8773034	151.1581879	1		install new kerb ramp - pair	LH169	Secondary	MED	\$ 5,000
CD1033	Derbyshire Road	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8782239	151.1583168	1		install new tgsi - pair	LH42	Secondary	MED	\$ 1,300
CD1034	Derbyshire Road	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8799531	151.1584662	1		install new kerb ramp	LH41	Secondary	MED	\$ 2,500
CD1036	Elswick Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8847897	151.1521735	1		install new tgsi	LH46	Secondary	MED	\$ 650
CD1038	Elswick Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8831942	151.1520589	1		install new tgsi	LH52	Secondary	MED	\$ 650
CD1039	Elswick Street	Leichhardt	Local Road		crossing deficiency	misaligned refuge island	-33.8831338	151.1520451	1		re-construct refuge island	LH52	Secondary	MED	\$ 15,000
CD1044	Elswick Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8882591	151.1529307	1		install new tgsi	LH53	Secondary	MED	\$ 650
CD1046	Elswick Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8882607	151.1530248	1		install new tgsi	LH53	Secondary	MED	\$ 650
CD1047	Elswick Street	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp	-33.8883246	151.1530721	1		install new kerb ramp	LH53	Secondary	MED	\$ 2,500
CD1048	Elswick Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.888891	151.1530213	1		install new kerb ramp	LH53	Secondary	MED	\$ 2,500
CD1049	Elswick Street	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp	-33.8885622	151.1529561	1		install new kerb ramp	LH53	Secondary	MED	\$ 2,500
CD1054	Elswick Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8842245	151.1511764	1		install new kerb ramp - pair	LH97	Secondary	MED	\$ 5,000
CD1058	Elswick Street	Leichhardt	Local Road		crossing deficiency	missing kerb ramp	-33.8775871	151.1516389	1		install new kerb ramp	LH173	Secondary	MED	\$ 2,500
CD1059	Elswick Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8775459	151.151747	1		install new kerb ramp	LH173	Secondary	MED	\$ 2,500
CD1060	Flood Street	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp	-33.879698	151.1519566	1		install new kerb ramp	LH49	Secondary	MED	\$ 2,500
CD1061	Flood Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8782927	151.1519648	1		install new tgsi	LH47	Secondary	MED	\$ 650
CD1062	Flood Street	Leichhardt	Local Road		crossing deficiency	missing crossing point	-33.877891	151.151638	1		install new kerb ramp - pair	LH173	Secondary	MED	\$ 5,000
CD1063	Flood Street	Leichhardt	Local Road		crossing deficiency	narrow kerb ramp - pair	-33.8858179	151.1498586	1		no action	LH59	Secondary	MED	\$ -
CD1064	Flood Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.886079	151.1497361	1		install new kerb ramp - pair	LH59	Secondary	MED	\$ 5,000
CD1065	Flood Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8876739	151.149464	1		install new kerb ramp	LH60	Secondary	MED	\$ 2,500
CD1070	Flood Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.886395	151.1498568	1		install new tgsi	LH112	Secondary	MED	\$ 650
CD1073	Flood Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8795739	151.1501379	1		install new kerb ramp - pair	LH64	Secondary	MED	\$ 5,000
CD1074	Flood Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8802359	151.1501368	1		install new kerb ramp - pair	LH64	Secondary	MED	\$ 5,000
CD1076	Flood Street	Leichhardt	Local Road		crossing deficiency	missing crossing point	-33.8855768	151.1498882	1		install new kerb ramp - pair	LH62	Secondary	MED	\$ 5,000
CD1077	Flood Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8837865	151.1499301	1		install new tgsi - pair	LH67	Secondary	MED	\$ 1,300
CD1078	Flood Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8790871	151.1500193	1		install new kerb ramp - pair	LH64	Secondary	MED	\$ 5,000
CD1081	Foster Street	Leichhardt	State Road		crossing deficiency	poor kerb ramp alignment	-33.8859296	151.1475743	1		install new kerb ramp	LH88	Secondary	MED	\$ 2,500
CD1083	Foster Street	Leichhardt	State Road		crossing deficiency	poor kerb ramp alignment	-33.8860698	151.147532	1		install new kerb ramp	LH87	Secondary	MED	\$ 2,500
CD1084	Foster Street	Leichhardt	State Road		crossing deficiency	poor kerb ramp alignment	-33.8859631	151.1477057	1		install new kerb ramp	LH88	Secondary	MED	\$ 2,500
CD1085	Foster Street	Leichhardt	State Road		crossing deficiency	poor kerb ramp alignment	-33.8860785	151.1475604	1		install new kerb ramp	LH153	Secondary	MED	\$ 2,500
CD1086	Foster Street	Leichhardt	State Road		crossing deficiency	misaligned kerb ramp	-33.8859296	151.1477307	1		install new kerb ramp	LH88	Secondary	MED	\$ 2,500
CD1087	Foster Street	Leichhardt	State Road		crossing deficiency	poor kerb ramp alignment	-33.8860428	151.1477502	1		install new kerb ramp	LH88	Secondary	MED	\$ 2,500
CD1088	Leichhardt Street	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8832987	151.1612992	1		install new kerb ramp - pair	LH90	Secondary	MED	\$ 5,000
CD1089	Leichhardt Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp construction	-33.883182	151.1612359	1		install new kerb ramp	LH83	Secondary	MED	\$ 2,500
CD1090	Lords Road	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8859616	151.1483144	1		install new tgsi	LH88	Secondary	MED	\$ 650
CD1091	Lords Road	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8860697	151.1466065	1		install new kerb ramp	LH87	Secondary	MED	\$ 2,500
CD1092	Lords Road	Leichhardt	Local Road		crossing deficiency	long driveway crossing point	-33.8857924	151.1484527	1		no action	LH88	Secondary	MED	\$ -
CD1093	Lords Road	Leichhardt	Local Road		crossing deficiency	long driveway crossing point	-33.885801	151.1484417	1		no action	LH88	Secondary	MED	\$ -
CD1094	Mackenzie Street	Leichhardt	Local Road		crossing deficiency	missing kerb ramp	-33.8844501	151.1610736	1		install new kerb ramp	LH147	Secondary	MED	\$ 2,500
CD1095	Mackenzie Street	Leichhardt	Local Road		crossing deficiency	missing kerb ramp	-33.8844169	151.1611328	1		install new kerb ramp	LH147	Secondary	MED	\$ 2,500
CD1099	Marion Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8840878	151.1520358	1		install new kerb ramp	LH98	Secondary	MED	\$ 2,500
CD1100	Marion Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8841615	151.1519901	1		install new kerb ramp - pair	LH46	Secondary	MED	\$ 5,000
CD1101	Marion Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8840316	151.1518863	1		install new kerb ramp	LH97	Secondary	MED	\$ 2,500
CD1102	Marion Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8840789	151.151889	1		install new kerb ramp - pair	LH97	Secondary	MED	\$ 5,000
CD1103	Marion Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8841668	151.1510561	1		install new kerb ramp	LH97	Secondary	MED	\$ 2,500
CD1104	Marion Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8841429	151.150094	1		install new kerb ramp	LH96	Secondary	MED	\$ 2,500
CD1110	Marion Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8840917	151.1453782	1		install new tgsi	LH92	Secondary	MED	\$ 650
CD1113	Moore Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8797987	151.1662279	1		install new kerb ramp	LH109	Secondary	MED	\$ 2,500
CD1114	Moore Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	missing crossing point	-33.8797544	151.1662585	1		install new kerb ramp - pair	LH109	Secondary	MED	\$ 5,000
CD1115	Moore Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8796386	151.1666268	1		install new tgsi	LH110	Secondary	MED	\$ 650
CD1117	Moore Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8787694	151.1619206	1		install new kerb ramp	LH104	Secondary	MED	\$ 2,500
CD1118	Moore Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	narrow kerb ramp	-33.8787836	151.1619705	1		install new kerb ramp	LH105	Secondary	MED	\$ 2,500
CD1119	Moore Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8788545	151.1624796	1		install new kerb ramp	LH105	Secondary	MED	\$ 2,500
CD1120	Moore Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8797766	151.1666464	1		install new kerb ramp	LH110	Secondary	MED	\$ 2,500
CD1121	Moore Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	steep kerb ramp	-33.878862	151.1625132	1		install new kerb ramp - pair	LH105	Secondary	MED	\$ 5,000
CD1130	Norton Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8772215	151.1563147	1		install new kerb ramp - pair	LH126	Secondary	MED	\$ 5,000
CD1131	Norton Street	Leichhardt	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8771506	151.1561279	1		install new kerb ramp - pair	LH126	Secondary	MED	\$ 5,000
CD1134	Paramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8899448	151.1467096	1		install new kerb ramp - pair	LH156	Secondary	MED	\$ 5,000
CD1147	Paramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8899585	151.1484877	1		install new kerb ramp - pair	LH134	Secondary	MED	\$ 5,000
CD1150	Prospect Street	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8844578	151.1605438	1		install new kerb ramp - pair	LH147	Secondary	MED	\$ 5,000
CD1151	Prospect Street	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp	-33.8844566	151.160505	1		install new kerb ramp	LH147	Secondary	MED	\$ 2,500
CD1152	Prospect Street	Leichhardt	Local Road		crossing deficiency	missing kerb ramp	-33.8844161	151.1604917	1		install new kerb ramp	LH147	Secondary	MED	\$ 2,500
CD1153	Prospect Street	Leichhardt	Local Road		crossing deficiency	missing kerb ramp	-33.8844871	151.1604984	1		install new kerb ramp	LH147	Secondary	MED	\$ 2,500
CD1154	Prospect Street	Leichhardt	Local Road		crossing deficiency	bollard narrows crossing	-33.8844893	151.1604448	1		relocate bollard	LH147	Secondary	MED	\$ 2,500
CD1156	Styles Street	Leichhardt	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8827908	151.1654039	1		install new kerb ramp - pair	LH150	Secondary	MED	\$ 5,000
CD1157	Styles Street	Leichhardt	Regional Road		crossing deficiency	raised kerb ramp lip	-33.882864	151.1649071	1		install new kerb ramp	LH151	Secondary	MED	\$ 2,500
CD1158	Styles Street	Leichhardt	Regional Road		crossing deficiency	raised kerb ramp lip	-33.8828682	151.1648532	1		install new kerb ramp	LH151	Secondary	MED	\$ 2,500
CD1159	Styles Street	Leichhardt	Regional Road		crossing deficiency	misaligned kerb ramp - pair	-33.8829275	151.1644163	1		install new kerb ramp - pair	LH148	Secondary	MED	\$ 5,000
CD1160	Styles Street	Leichhardt	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8829772	151.1644162	1		install new kerb ramp - pair	LH148	Secondary	MED	\$ 5,000
CD1161	Styles Street	Leichhardt	Regional Road		crossing deficiency	misaligned kerb ramp	-33.8832693	151.1618845	1		install new kerb ramp	LH149	Secondary	MED	\$ 2,500
CD1162	Styles Street	Leichhardt	Regional Road		crossing deficiency	missing kerb ramp	-33.8833763	151.1620239	1		install new kerb ramp	LH149	Secondary	MED	\$ 2,500
CD1163	Styles Street	Leichhardt	Regional Road		crossing deficiency	misaligned kerb ramp - pair	-33.8831973	151.1623128	1		install new kerb ramp - pair	LH149	Secondary	MED	\$ 5,000
CD1165	Tebutt Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8869672	151.1473605	1		install new kerb ramp	LH153	Secondary	MED	\$ 2,500
CD1166	Tebutt Street	Leichhardt	Local Road		crossing deficiency	long crossing	-33.8870296	151.1473635	1		install kerb extension	LH154	Secondary	MED	\$ 10,000
CD1167	Tebutt Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8870941	151.1473131	1		install new kerb ramp - pair	LH154	Secondary	MED	\$ 5,000
CD1168	Tebutt Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8879235	151.147137	1		install new kerb ramp	LH154	Secondary	MED	\$ 2,500
CD1169	White Creek	Leichhardt	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.8840515	151.1650376	1		install new tgsi - pair	LH161	Secondary	MED	\$ 1,300
CD1170	White Creek	Leichhardt	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.8840797	151.1650275	1		install new tgsi - pair	LH161	Secondary	MED	\$ 1,300
CD1171	White Creek	Leichhardt	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.8850078	151.1647919	1		install new tgsi - pair	LH160	Secondary	MED	\$ 1,300
CD1172	White Creek	Leichhardt	Local Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8839422	151.1651395	1		install new kerb ramp - pair	LH161	Secondary	MED	\$ 5,000
CD1173	White Creek	Leichhardt	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.8850706	151.1648029	1		install new tgsi - pair	LH160	Secondary	MED	\$ 1,300
CD1174	White Creek	Leichhardt	Local Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8863653	151.1640985	1		install new kerb ramp	LH158	Secondary	MED	\$ 2,500

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD1175	White Creek	Leichhardt	Local Road	Strategic Route	crossing deficiency	narrow kerb ramp	-33.8862676	151.1641732	1		install new kerb ramp	LH158	Secondary	MED	\$ 2,500
CD1176	White Creek	Leichhardt	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8862922	151.1641045	1		install new tgsi	LH158	Secondary	MED	\$ 650
CD1177	White Creek	Leichhardt	Local Road	Strategic Route	crossing deficiency	missing crossing point	-33.8866696	151.1633555	1		install new kerb ramp - pair	LH157	Secondary	MED	\$ 5,000
CD1178	William Street	Leichhardt	Local Road		crossing deficiency	missing kerb ramp	-33.8773397	151.1564427	1		install new kerb ramp	LH170	Secondary	MED	\$ 2,500
CD1179	William Street	Leichhardt	Local Road		crossing deficiency	missing kerb ramp	-33.8776487	151.1520416	1		install new kerb ramp	LH173	Secondary	MED	\$ 2,500
CD1181	William Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8772247	151.1582846	1		install new tgsi	LH169	Secondary	MED	\$ 650
CD1182	William Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8772516	151.1575626	1		install new tgsi	LH169	Secondary	MED	\$ 650
CD1183	William Street	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp	-33.8772607	151.1574813	1		install new kerb ramp	LH170	Secondary	MED	\$ 2,500
CD1184	William Street	Leichhardt	Local Road		crossing deficiency	misaligned refuge island	-33.8777943	151.1502393	1		re-construct refuge island	LH172	Secondary	MED	\$ 15,000
CD1185	William Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8772479	151.1492874	1		install new kerb ramp - pair	LH38	Secondary	MED	\$ 5,000
CD1186	William Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8776028	151.1502114	1		install new kerb ramp	LH172	Secondary	MED	\$ 2,500
CD1187	William Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8778314	151.1506972	1		install new kerb ramp	LH173	Secondary	MED	\$ 2,500
CD1188	William Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8777605	151.1511902	1		install new kerb ramp - pair	LH173	Secondary	MED	\$ 5,000
CD1189	William Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8775076	151.1525218	1		install new kerb ramp - pair	LH174	Secondary	MED	\$ 5,000
CD1190	William Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8774218	151.154471	1		install new kerb ramp - pair	LH168	Secondary	MED	\$ 5,000
CD1191	William Street	Leichhardt	Local Road		crossing deficiency	missing crossing point	-33.8774626	151.1545969	1		install new kerb ramp - pair	LH168	Secondary	MED	\$ 5,000
CD1192	William Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.877464	151.1535789	1		install new kerb ramp	LH174	Secondary	MED	\$ 2,500
CD1193	William Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8774684	151.153111	1		install new kerb ramp	LH174	Secondary	MED	\$ 2,500
CD1194	William Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8776253	151.1530174	1		install new tgsi - pair	LH174	Secondary	MED	\$ 1,300
CD1195	William Street	Leichhardt	Local Road		crossing deficiency	missing kerb ramp	-33.877363	151.1554348	1		install new kerb ramp	LH175	Secondary	MED	\$ 2,500
CD1196	William Street	Leichhardt	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8776402	151.1517178	1		install new kerb ramp - pair	LH173	Secondary	MED	\$ 5,000
CD1197	William Street	Leichhardt	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8775996	151.1521782	1		install new kerb ramp - pair	LH174	Secondary	MED	\$ 5,000
CD1198	Carrington Street	Lewisham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8904894	151.1478372	1		install new kerb ramp	LW29	Secondary	MED	\$ 2,500
CD1203	Hunter Street	Lewisham	Local Road	Strategic Route	crossing deficiency	narrow kerb ramp - pair	-33.8955091	151.1494466	1		install new kerb ramp - pair	LW9	Secondary	MED	\$ 5,000
CD1204	Hunter Street	Lewisham	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.895262	151.1494393	1		install new kerb ramp	LW9	Secondary	MED	\$ 2,500
CD1205	Hunter Street	Lewisham	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8952435	151.1492095	1		install new kerb ramp	LW9	Secondary	MED	\$ 2,500
CD1206	Hunter Street	Lewisham	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8950958	151.1492463	1		install new kerb ramp	LW9	Secondary	MED	\$ 2,500
CD1207	Hunter Street	Lewisham	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8951928	151.1492278	1		install new kerb ramp	LW9	Secondary	MED	\$ 2,500
CD1216	New Canterbury Road	Lewisham	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8981337	151.1491949	1		install new tgsi	LW39	Secondary	MED	\$ 650
CD1217	Old Canterbury Road	Lewisham	State Road		crossing deficiency	poor kerb ramp alignment	-33.8940351	151.1453785	1		install new kerb ramp	LW18	Secondary	MED	\$ 2,500
CD1221	Old Canterbury Road	Lewisham	State Road		crossing deficiency	poor kerb ramp alignment	-33.8950626	151.1437831	1		install new kerb ramp	LW20	Secondary	MED	\$ 2,500
CD1222	Old Canterbury Road	Lewisham	State Road		crossing deficiency	poor kerb ramp alignment	-33.8950805	151.1438792	1		install new kerb ramp	LW20	Secondary	MED	\$ 2,500
CD1223	Old Canterbury Road	Lewisham	State Road		crossing deficiency	missing kerb ramp	-33.8951269	151.1440648	1		install new kerb ramp	LW20	Secondary	MED	\$ 2,500
CD1224	Old Canterbury Road	Lewisham	State Road		crossing deficiency	long crossing	-33.8950689	151.1440534	1		further investigation required	LW20	Secondary	MED	-
CD1225	Old Canterbury Road	Lewisham	State Road		crossing deficiency	missing crossing point	-33.8951977	151.1429288	1		install new kerb ramp - pair	LW21	Secondary	MED	\$ 5,000
CD1228	Parramatta Road	Lewisham	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8899531	151.148908	1		install new kerb ramp - pair	LH134	Secondary	MED	\$ 5,000
CD1230	Smith Street	Lewisham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8934222	151.1433702	1		install new kerb ramp	LW1	Secondary	MED	\$ 2,500
CD1232	Thomas Street	Lewisham	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8914529	151.1479924	1		install new kerb ramp - pair	LW28	Secondary	MED	\$ 5,000
CD1236	Toothill Street	Lewisham	Regional Road		crossing deficiency	misaligned kerb ramp	-33.8969167	151.1462804	1		install new kerb ramp	LW35	Secondary	MED	\$ 2,500
CD1237	Toothill Street	Lewisham	Regional Road		crossing deficiency	misaligned kerb ramp - pair	-33.8969416	151.1464533	1		install new kerb ramp - pair	LW35	Secondary	MED	\$ 5,000
CD1238	Toothill Street	Lewisham	Regional Road		crossing deficiency	misaligned refuge island	-33.8969128	151.1464313	1		re-construct refuge island	LW35	Secondary	MED	\$ 15,000
CD1241	Toothill Street	Lewisham	Regional Road		crossing deficiency	narrow kerb ramp	-33.8976166	151.1470623	1		install new kerb ramp	LW35	Secondary	MED	\$ 2,500
CD1242	Toothill Street	Lewisham	Regional Road		crossing deficiency	missing kerb ramp	-33.8949136	151.1444581	1		install new kerb ramp	LW20	Secondary	MED	\$ 2,500
CD1246	Trafalgar Street	Lewisham	Regional Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8930835	151.1457916	1		install new kerb ramp - pair	LW18	Secondary	MED	\$ 5,000
CD1247	Trafalgar Street	Lewisham	Regional Road		crossing deficiency	narrow kerb ramp	-33.8930925	151.1458007	1		install new kerb ramp	LW18	Secondary	MED	\$ 2,500
CD1249	Trafalgar Street	Lewisham	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8940465	151.1498117	1		install new kerb ramp	PE65	Secondary	MED	\$ 2,500
CD1252	West Street	Lewisham	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8940225	151.1498586	1		install new kerb ramp - pair	PE65	Secondary	MED	\$ 5,000
CD1263	Balmain Road	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8699906	151.1622011	1		install new kerb ramp - pair	LF8	Secondary	MED	\$ 5,000
CD1264	Balmain Road	Lilyfield	Local Road		crossing deficiency	long crossing point	-33.870013	151.162216	1		install kerb extension / refuge island	LF8	Secondary	MED	\$ 10,000
CD1268	Balmain Road	Lilyfield	Local Road		crossing deficiency	misaligned kerb ramp	-33.8714824	151.1595907	1		install new kerb ramp	LF89	Secondary	MED	\$ 2,500
CD1271	Balmain Road	Lilyfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8701995	151.1618248	1		install new tgsi	LF8	Secondary	MED	\$ 650
CD1280	Catherine Street	Lilyfield	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8764729	151.164817	1		install new kerb ramp - pair	LF93	Secondary	MED	\$ 5,000
CD1281	Catherine Street	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8744721	151.1646513	1		install new kerb ramp	LF42	Secondary	MED	\$ 2,500
CD1282	Church Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8702367	151.1567058	1		install new kerb ramp - pair	LF50	Secondary	MED	\$ 5,000
CD1286	City West Link Bridge	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8750315	151.1551158	1		install new kerb ramp	LF59	Secondary	MED	\$ 2,500
CD1287	City West Link Bridge	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8747411	151.155266	1		install new kerb ramp	LF59	Secondary	MED	\$ 2,500
CD1290	Frazer Street	Lilyfield	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8700864	151.1520392	1		install new kerb ramp - pair	LF27	Secondary	MED	\$ 5,000
CD1291	Glover Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8695726	151.1565187	1		install new kerb ramp	LF50	Secondary	MED	\$ 2,500
CD1292	Glover Street	Lilyfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8691368	151.1562213	1		install new tgsi	LF49	Secondary	MED	\$ 650
CD1296	Grove Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8725806	151.1644568	1		install new kerb ramp - pair	LF54	Secondary	MED	\$ 5,000
CD1302	Grove Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8699867	151.163655	1		install new kerb ramp	LF53	Secondary	MED	\$ 2,500
CD1303	Grove Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8695538	151.1634797	1		install new kerb ramp - pair	LF53	Secondary	MED	\$ 5,000
CD1304	Grove Street	Lilyfield	Local Road		crossing deficiency	missing kerb ramp - pair	-33.86944	151.1633638	1		install new kerb ramp - pair, and tgsi	LF53	Secondary	MED	\$ 6,000
CD1305	James Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8746027	151.1549964	1		install new kerb ramp	LF59	Secondary	MED	\$ 2,500
CD1306	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.871631	151.1691733	1		install new kerb ramp	LF75	Secondary	MED	\$ 2,500
CD1307	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8718767	151.1688395	1		install new kerb ramp	LF75	Secondary	MED	\$ 2,500
CD1308	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8720492	151.1684087	1		install new kerb ramp - pair	LF74	Secondary	MED	\$ 5,000
CD1309	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8725834	151.1672373	1		install new kerb ramp - pair	LF73	Secondary	MED	\$ 5,000
CD1310	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8727257	151.1666497	1		install new kerb ramp	LF72	Secondary	MED	\$ 2,500
CD1311	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8727896	151.1663263	1		install new kerb ramp - pair	LF72	Secondary	MED	\$ 5,000
CD1312	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8730221	151.1653522	1		install new kerb ramp - pair	LF71	Secondary	MED	\$ 5,000
CD1313	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8730957	151.16479	1		install new kerb ramp - pair	LF54	Secondary	MED	\$ 5,000
CD1315	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8730565	151.1658006	1		install new tgsi	LF72	Secondary	MED	\$ 650
CD1318	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8743082	151.1607146	1		install new kerb ramp - pair	LF1	Secondary	MED	\$ 5,000
CD1319	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8741585	151.1606687	1		install new kerb ramp - pair	LF69	Secondary	MED	\$ 5,000
CD1320	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8739539	151.1612472	1		install new kerb ramp	LF69	Secondary	MED	\$ 2,500
CD1321	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8741839	151.1604665	1		install new kerb ramp - pair	LF64	Secondary	MED	\$ 5,000
CD1322	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8740947	151.1571697	1		install new kerb ramp	LF66	Secondary	MED	\$ 2,500
CD1325	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8735863	151.15521	1		install new kerb ramp	LF58	Secondary	MED	\$ 2,500
CD1326	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8732817	151.1541684	1		install new kerb ramp	LF60	Secondary	MED	\$ 2,500
CD1327	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	steep kerb ramp	-33.8729506	151.1530961	1		install new kerb ramp - pair	LF62	Secondary	MED	\$ 5,000
CD1328	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8727357	151.1523321	1		install new kerb ramp	LF61	Secondary	MED	\$ 2,500

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD1329	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8727936	151.1523218	1		install new kerb ramp	LF61	Secondary	MED	\$ 2,500
CD1330	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8726752	151.1521338	1		install new kerb ramp	LF61	Secondary	MED	\$ 2,500
CD1332	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8724227	151.1518274	1		install new kerb ramp - pair	LF61	Secondary	MED	\$ 5,000
CD1334	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8742884	151.158929	1		install new kerb ramp - pair	LF67	Secondary	MED	\$ 5,000
CD1335	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8722543	151.167973	1		install new kerb ramp - pair	LF74	Secondary	MED	\$ 5,000
CD1336	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	missing crossing point - future park access	-33.8722494	151.1679569	1		install new kerb ramp - pair, new refuge	LF74	Secondary	MED	\$ 7,000
CD1339	Mary Street	Lilyfield	Local Road		crossing deficiency	missing crossing point	-33.8727028	151.1553116	1		install new kerb ramp - pair	LF78	Secondary	MED	\$ 5,000
CD1340	Mary Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8726858	151.1552026	1		install new kerb ramp - pair	LF78	Secondary	MED	\$ 5,000
CD1347	Mary Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8735788	151.1552362	1		install new kerb ramp	LF58	Secondary	MED	\$ 2,500
CD1348	Mary Street	Lilyfield	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8728363	151.1553377	1		install new kerb ramp - pair	LF78	Secondary	MED	\$ 5,000
CD1349	Mary Street	Lilyfield	Local Road		crossing deficiency	missing refuge island	-33.8727572	151.1552981	1		install new refuge island	LF78	Secondary	MED	\$ 15,000
CD1350	Mary Street	Lilyfield	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8724963	151.1555526	1		install new kerb ramp - pair	LF79	Secondary	MED	\$ 5,000
CD1353	Perry Street	Lilyfield	Local Road		crossing deficiency	long crossing	-33.8720961	151.1573774	1		install kerb extension - pair	LF88	Secondary	MED	\$ 20,000
CD1354	Perry Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8724016	151.1562489	1		install new kerb ramp	LF87	Secondary	MED	\$ 2,500
CD1361	Piper Street	Lilyfield	Local Road		crossing deficiency	misaligned kerb ramp	-33.8766467	151.1657033	1		install new kerb ramp	LF94	Secondary	MED	\$ 2,500
CD1370	Piper Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8754168	151.1610431	1		install new kerb ramp - pair	LF16	Secondary	MED	\$ 5,000
CD1371	Addison Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8999188	151.1577836	1		install new kerb ramp	MV3	Secondary	MED	\$ 2,500
CD1372	Addison Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8999862	151.1578131	1		install new kerb ramp	MV3	Secondary	MED	\$ 2,500
CD1373	Addison Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.900342	151.1586301	1		install new kerb ramp	MV4	Secondary	MED	\$ 2,500
CD1374	Addison Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9004434	151.1592801	1		install new kerb ramp	MV5	Secondary	MED	\$ 2,500
CD1375	Addison Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9011008	151.1608115	1		install new kerb ramp	MV6	Secondary	MED	\$ 2,500
CD1376	Addison Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9013176	151.1613502	1		install new kerb ramp - pair	MV7	Secondary	MED	\$ 5,000
CD1377	Addison Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9018434	151.162572	1		install new kerb ramp	MV1	Secondary	MED	\$ 2,500
CD1378	Addison Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.901728	151.1625443	1		install new kerb ramp	MV1	Secondary	MED	\$ 2,500
CD1380	Addison Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9026683	151.1644698	1		install new kerb ramp	MV9	Secondary	MED	\$ 2,500
CD1381	Addison Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9029431	151.1653906	1		install new kerb ramp - pair	MV9	Secondary	MED	\$ 5,000
CD1382	Addison Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9038364	151.1677277	1		install new tgsi	MV11	Secondary	MED	\$ 650
CD1383	Addison Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9040486	151.168262	1		install new kerb ramp	MV11	Secondary	MED	\$ 2,500
CD1384	Addison Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9038428	151.1676818	1		install new tgsi	MV11	Secondary	MED	\$ 650
CD1385	Addison Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	narrow refuge island	-33.9040938	151.1683398	1		install new refuge island	MV11	Secondary	MED	\$ 15,000
CD1388	Albermarle Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9121781	151.1461721	1		install new tgsi - pair	MV12	Secondary	MED	\$ 1,300
CD1389	Albermarle Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9128068	151.1469688	1		install new kerb ramp - pair	MV12	Secondary	MED	\$ 5,000
CD1390	Beauchamp Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9146426	151.1430407	1		install new tgsi - pair	MV16	Secondary	MED	\$ 1,300
CD1391	Beauchamp Street	Marrickville	Local Road		crossing deficiency	overhanging vegetation narrows kerb ramp	-33.9139997	151.1451041	1		refer to maintenance	MV15	Secondary	MED	\$ -
CD1392	Beauchamp Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9141991	151.1441038	1		install new tgsi - pair	MV15	Secondary	MED	\$ 1,300
CD1393	Beauchamp Street	Marrickville	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.9138486	151.1462217	1		install new kerb ramp - pair	MV14	Secondary	MED	\$ 5,000
CD1394	Calvert Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9124657	151.1565964	1		install new kerb ramp - pair	MV21	Secondary	MED	\$ 5,000
CD1395	Calvert Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9127463	151.1571857	1		install new tgsi	MV19	Secondary	MED	\$ 650
CD1396	Calvert Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9128307	151.1573264	1		install new kerb ramp	MV19	Secondary	MED	\$ 2,500
CD1398	Calvert Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9134972	151.1586749	1		install new tgsi - pair	MV22	Secondary	MED	\$ 1,300
CD1399	Calvert Street	Marrickville	Local Road		crossing deficiency	missing crossing point	-33.9129431	151.1575861	1		install new kerb ramp - pair	MV19	Secondary	MED	\$ 5,000
CD1400	Calvert Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9128095	151.1573894	1		install new tgsi - pair	MV19	Secondary	MED	\$ 1,300
CD1401	Calvert Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9125045	151.1570192	1		install new tgsi - pair	MV21	Secondary	MED	\$ 1,300
CD1402	Calvert Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9123374	151.1566557	1		install new tgsi - pair	MV21	Secondary	MED	\$ 1,300
CD1403	Calvert Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.91209	151.1562429	1		install new tgsi - pair	MV20	Secondary	MED	\$ 1,300
CD1404	Calvert Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9117977	151.1556575	1		install new tgsi - pair	MV20	Secondary	MED	\$ 1,300
CD1405	Calvert Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9116755	151.1553456	1		install new kerb ramp - pair	MV20	Secondary	MED	\$ 5,000
CD1406	Calvert Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9120084	151.155915	1		install new kerb ramp - pair	MV20	Secondary	MED	\$ 5,000
CD1410	Carrington Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9204843	151.154511	1		install new kerb ramp - pair	MV24	Secondary	MED	\$ 5,000
CD1411	Carrington Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9205816	151.154498	1		install new kerb ramp	MV24	Secondary	MED	\$ 2,500
CD1412	Carrington Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.921255	151.1540209	1		install new kerb ramp	MV24	Secondary	MED	\$ 2,500
CD1418	Chapel Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9050996	151.1616945	1		install new tgsi	MV31	Secondary	MED	\$ 650
CD1419	Chapel Street	Marrickville	Local Road		crossing deficiency	narrow kerb ramp	-33.9055135	151.1624095	1		install new kerb ramp	MV31	Secondary	MED	\$ 2,500
CD1420	Chapel Street	Marrickville	Local Road		crossing deficiency	missing kerb ramp	-33.9055857	151.1623156	1		install new kerb ramp	MV31	Secondary	MED	\$ 2,500
CD1421	Chapel Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9055281	151.1623607	1		install new kerb ramp	MV31	Secondary	MED	\$ 2,500
CD1422	Chapel Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9059824	151.1629463	1		install new kerb ramp - pair	MV32	Secondary	MED	\$ 5,000
CD1423	Chapel Street	Marrickville	Local Road		crossing deficiency	raised kerb ramp lip - pair	-33.9060079	151.1629959	1		install new kerb ramp - pair	MV32	Secondary	MED	\$ 5,000
CD1425	Dudley Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9114464	151.1430186	1		install new kerb ramp	MV182	Secondary	MED	\$ 2,500
CD1426	Edgeware Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9050522	151.1732092	1		install new kerb ramp	MV124	Secondary	MED	\$ 2,500
CD1429	Edinburgh Road	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9085131	151.1725804	1		install new tgsi	MV51	Secondary	MED	\$ 650
CD1430	Edinburgh Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9079783	151.1706253	1		install new kerb ramp	MV58	Secondary	MED	\$ 2,500
CD1435	Enmore Road	Marrickville	State Road	Strategic Route	crossing deficiency	narrow pedestrian waiting area	-33.9040145	151.1682828	1		install new refuge island	MV11	Secondary	MED	\$ 15,000
CD1438	Ewart Street	Marrickville	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.911966	151.1399928	1		install new kerb ramp	DH30	Secondary	MED	\$ 2,500
CD1442	Ewart Street	Marrickville	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9145887	151.1427492	1		install new tgsi	MV68	Secondary	MED	\$ 650
CD1443	Ewart Street	Marrickville	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9145255	151.1429255	1		install new tgsi	MV68	Secondary	MED	\$ 650
CD1444	Ewart Street	Marrickville	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9139729	151.1423613	1		install new tgsi - pair	MV68	Secondary	MED	\$ 1,300
CD1449	Ewart Street	Marrickville	Local Road	Strategic Route	crossing deficiency	narrow kerb ramp	-33.9119552	151.1400099	1		install new kerb ramp	DH30	Secondary	MED	\$ 2,500
CD1456	Frazer Street	Marrickville	Regional Road		crossing deficiency	steep kerb ramp	-33.9011897	151.1507534	1		install new kerb ramp - pair	MV76	Secondary	MED	\$ 5,000
CD1457	Frazer Street	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp - pair	-33.9011202	151.1491711	1		install new kerb ramp - pair	PE20	Secondary	MED	\$ 5,000
CD1458	Frazer Street	Marrickville	Regional Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9010352	151.1505771	1		install new tgsi - pair	MV76	Secondary	MED	\$ 1,300
CD1459	Frazer Street	Marrickville	Regional Road		crossing deficiency	steep kerb ramp	-33.9010447	151.1511172	1		install new kerb ramp - pair	MV77	Secondary	MED	\$ 5,000
CD1460	Frazer Street	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9012896	151.1533104	1		install new kerb ramp	MV75	Secondary	MED	\$ 2,500
CD1461	Hawkshurst Street	Marrickville	Local Road		crossing deficiency	steep kerb ramp	-33.9054659	151.1547252	1		install new kerb ramp - pair	MV29	Secondary	MED	\$ 5,000
CD1462	Hawkshurst Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9052013	151.1552624	1		install new tgsi - pair	MV29	Secondary	MED	\$ 1,300
CD1463	Hawkshurst Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9049374	151.1557886	1		install new tgsi - pair	MV29	Secondary	MED	\$ 1,300
CD1464	Hawkshurst Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9048575	151.1558867	1		install new tgsi - pair	MV29	Secondary	MED	\$ 1,300
CD1465	Hawkshurst Street	Marrickville	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.9056201	151.1547953	1		install new kerb ramp - pair	MV78	Secondary	MED	\$ 5,000
CD1466	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9076167	151.1591965	1		install new kerb ramp - pair	MV193	Secondary	MED	\$ 5,000
CD1467	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9075514	151.1591252	1		install new kerb ramp - pair	MV87	Secondary	MED	\$ 5,000
CD1468	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	steep kerb ramp	-33.9062586	151.1603199	1		install new kerb ramp - pair	MV84	Secondary	MED	\$ 5,000
CD1469	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9061415	151.1602449	1		install new kerb ramp	MV84	Secondary	MED	\$ 2,500
CD1470	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9050581	151.1612613	1		install new tgsi	MV83	Secondary	MED	\$ 650

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD1471	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9045183	151.1615887	1		install new tgsi	MV79	Secondary	MED	\$ 650
CD1472	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9041613	151.1619432	1		install new tgsi	MV79	Secondary	MED	\$ 650
CD1474	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.909136	151.1576505	1		install new tgsi - pair	MV81	Secondary	MED	\$ 1,300
CD1477	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9165277	151.1494617	1		install new kerb ramp - pair	MV168	Secondary	MED	\$ 5,000
CD1478	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9188277	151.1457871	1		install new kerb ramp - pair	MV101	Secondary	MED	\$ 5,000
CD1479	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.919109	151.1453668	1		install new kerb ramp - pair	MV101	Secondary	MED	\$ 5,000
CD1480	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9197993	151.1446705	1		install new kerb ramp - pair	MV102	Secondary	MED	\$ 5,000
CD1481	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.9197157	151.1448165	1		re-construct refuge island	MV102	Secondary	MED	\$ 15,000
CD1485	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9191107	151.1455953	1		install new kerb ramp - pair	MV101	Secondary	MED	\$ 5,000
CD1486	Illawarra Road	Marrickville	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9186725	151.1462597	1		install new kerb ramp - pair	MV100	Secondary	MED	\$ 5,000
CD1503	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9049912	151.1530526	1		install new kerb ramp	MV112	Secondary	MED	\$ 2,500
CD1506	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9076622	151.1527813	1		install new tgsi - pair	MV115	Secondary	MED	\$ 1,300
CD1510	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9073171	151.1527023	1		install new kerb ramp	MV115	Secondary	MED	\$ 2,500
CD1512	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.9051484	151.1530673	1		re-construct refuge island	MV112	Secondary	MED	\$ 15,000
CD1513	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	steep kerb ramp	-33.9050612	151.1530805	1		install new kerb ramp - pair	MV112	Secondary	MED	\$ 5,000
CD1517	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9012373	151.1533295	1		install new kerb ramp	MV75	Secondary	MED	\$ 2,500
CD1518	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9138589	151.1463918	1		install new kerb ramp - pair	MV243	Secondary	MED	\$ 5,000
CD1526	Livingstone Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.912783	151.1471722	1		re-construct refuge island	MV12	Secondary	MED	\$ 15,000
CD1534	Llewellyn Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9047432	151.1724668	1		install new tgsi - pair	MV124	Secondary	MED	\$ 1,300
CD1535	Llewellyn Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9046679	151.1726127	1		install new kerb ramp	MV124	Secondary	MED	\$ 2,500
CD1542	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9071243	151.147089	1		install new kerb ramp	MV142	Secondary	MED	\$ 2,500
CD1543	Marrickville Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9066748	151.1459456	1		install new kerb ramp	MV141	Secondary	MED	\$ 2,500
CD1544	Marrickville Road	Marrickville	Regional Road		crossing deficiency	raised kerb ramp lip	-33.9077556	151.1496948	1		install new kerb ramp	MV144	Secondary	MED	\$ 2,500
CD1585	Murray Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9064626	151.1730987	1		install new tgsi	MV48	Secondary	MED	\$ 650
CD1586	Murray Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9068021	151.1728987	1		install new tgsi	MV48	Secondary	MED	\$ 650
CD1592	Newington Road	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9017723	151.16912	1		install new tgsi	MV148	Secondary	MED	\$ 650
CD1593	Newington Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9016294	151.1687631	1		install new kerb ramp	MV148	Secondary	MED	\$ 2,500
CD1600	Newington Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.899764	151.1636262	1		install new kerb ramp	MV153	Secondary	MED	\$ 2,500
CD1601	Newington Road	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.898155	151.1592397	1		install new tgsi	PE37	Secondary	MED	\$ 650
CD1602	Newington Road	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8982759	151.1590706	1		install new tgsi	PE37	Secondary	MED	\$ 650
CD1603	Premier Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9212846	151.1538847	1		install new kerb ramp	MV159	Secondary	MED	\$ 2,500
CD1604	Premier Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9210181	151.1531778	1		install new tgsi - pair	MV159	Secondary	MED	\$ 1,300
CD1605	Premier Street	Marrickville	Local Road		crossing deficiency	missing crossing point	-33.9210138	151.1532115	1		install new kerb ramp - pair	MV159	Secondary	MED	\$ 5,000
CD1606	Premier Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.920185	151.151801	1		install new tgsi - pair	MV162	Secondary	MED	\$ 1,300
CD1607	Premier Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9199742	151.151541	1		install new tgsi - pair	MV162	Secondary	MED	\$ 1,300
CD1608	Premier Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9201606	151.1518128	1		install new tgsi	MV162	Secondary	MED	\$ 650
CD1609	Premier Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9195868	151.1509888	1		install new tgsi	MV162	Secondary	MED	\$ 650
CD1610	Premier Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9199018	151.1511509	1		install new tgsi - pair	MV162	Secondary	MED	\$ 1,300
CD1611	Premier Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9194025	151.1505524	1		install new tgsi - pair	MV163	Secondary	MED	\$ 1,300
CD1617	Premier Street	Marrickville	Local Road		crossing deficiency	narrow refuge island	-33.9210028	151.1531545	1		install new refuge island	MV159	Secondary	MED	\$ 15,000
CD1619	Renwick Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9178368	151.1518942	1		install new tgsi - pair	MV171	Secondary	MED	\$ 1,300
CD1620	Renwick Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.918051	151.1522098	1		install new tgsi - pair	MV171	Secondary	MED	\$ 1,300
CD1621	Renwick Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9180201	151.1522829	1		install new tgsi - pair	MV171	Secondary	MED	\$ 1,300
CD1626	Renwick Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9179188	151.1517609	1		install new tgsi - pair	MV171	Secondary	MED	\$ 1,300
CD1627	Renwick Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9166418	151.1495068	1		install new kerb ramp - pair	MV168	Secondary	MED	\$ 5,000
CD1628	Richardson Crescent	Marrickville	Local Road		crossing deficiency	missing crossing point	-33.922128	151.1564363	1		install new kerb ramp - pair	MV175	Secondary	MED	\$ 5,000
CD1631	Richardson Crescent	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9235552	151.1559863	1		install new kerb ramp	MV176	Secondary	MED	\$ 2,500
CD1632	Richardson Crescent	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9235184	151.1561037	1		install new kerb ramp - pair	MV176	Secondary	MED	\$ 5,000
CD1633	Riverside Crescent	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9150848	151.142558	1		install new tgsi	MV178	Secondary	MED	\$ 650
CD1634	Riverside Crescent	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.91496	151.1426349	1		install new kerb ramp	MV178	Secondary	MED	\$ 2,500
CD1641	Smidmore Street	Marrickville	Local Road		crossing deficiency	missing kerb ramp - pair	-33.9077542	151.1711415	1		install new kerb ramp - pair	MV58	Secondary	MED	\$ 5,000
CD1643	Station Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9148475	151.1562031	1		install new kerb ramp - pair	MV187	Secondary	MED	\$ 5,000
CD1644	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9095857	151.1621739	1		install new kerb ramp	MV191	Secondary	MED	\$ 2,500
CD1647	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9088042	151.1608144	1		install new kerb ramp	MV192	Secondary	MED	\$ 2,500
CD1648	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	steep kerb ramp	-33.9092457	151.1613195	1		install new kerb ramp - pair	MV191	Secondary	MED	\$ 5,000
CD1649	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9084306	151.160197	1		install new kerb ramp	MV192	Secondary	MED	\$ 2,500
CD1650	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9081808	151.1597787	1		install new kerb ramp	MV193	Secondary	MED	\$ 2,500
CD1651	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9075777	151.1592143	1		install new kerb ramp	MV193	Secondary	MED	\$ 2,500
CD1652	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9076563	151.1591547	1		install new kerb ramp	MV87	Secondary	MED	\$ 2,500
CD1653	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.9075228	151.1591627	1		install new kerb ramp	MV82	Secondary	MED	\$ 2,500
CD1654	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	traffic post narrows kerb ramp	-33.9075855	151.1590907	1		refer to Transport for NSW	MV87	Secondary	MED	\$ -
CD1655	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.9071245	151.1585991	1		re-construct refuge island	MV195	Secondary	MED	\$ 15,000
CD1664	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9114206	151.1646107	1		install new tgsi - pair	MV202	Secondary	MED	\$ 1,300
CD1665	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.911937	151.1653392	1		install new tgsi - pair	MV204	Secondary	MED	\$ 1,300
CD1666	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9124854	151.1660239	1		install new tgsi	MV185	Secondary	MED	\$ 650
CD1670	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9122329	151.1655524	1		install new tgsi - pair	MV204	Secondary	MED	\$ 1,300
CD1671	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.9118046	151.1649567	1		install new tgsi - pair	MV204	Secondary	MED	\$ 1,300
CD1672	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9112292	151.1642707	1		install new kerb ramp	MV202	Secondary	MED	\$ 2,500
CD1673	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	raised kerb ramp lip	-33.9106052	151.163438	1		install new kerb ramp	MV201	Secondary	MED	\$ 2,500
CD1675	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.91037	151.16342	1		install new tgsi - pair	MV201	Secondary	MED	\$ 1,300
CD1678	Sydney Steel St	Marrickville	Local Road		crossing deficiency	poor kerb ramp construction	-33.9086671	151.1714044	1		install new kerb ramp	MV53	Secondary	MED	\$ 2,500
CD1679	Victoria Road	Marrickville	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment, does not follow desire line	-33.9054521	151.169251	1		no action	MV211	Secondary	MED	\$ -
CD1681	Victoria Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned refuge island	-33.9056111	151.1662305	1		re-construct refuge island	MV214	Secondary	MED	\$ 15,000
CD1682	Victoria Road	Marrickville	State Road	Strategic Route	crossing deficiency	long crossing point	-33.9058483	151.1657953	1		install new refuge island	MV214	Secondary	MED	\$ 15,000
CD1683	Victoria Road	Marrickville	State Road	Strategic Route	crossing deficiency	steep kerb ramp	-33.9068162	151.1644305	1		install new kerb ramp - pair	MV30	Secondary	MED	\$ 5,000
CD1689	Victoria Road	Marrickville	State Road	Strategic Route	crossing deficiency	missing crossing point	-33.9148017	151.1564279	1		install new kerb ramp - pair	MV228	Secondary	MED	\$ 5,000
CD1694	Warburton Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9137765	151.1517359	1		install new kerb ramp	MV229	Secondary	MED	\$ 2,500
CD1703	Wardell Road	Marrickville	Regional Road		crossing deficiency	misaligned refuge island	-33.9075758	151.1447807	1		re-construct refuge island	MV232	Secondary	MED	\$ 15,000
CD1704	Wardell Road	Marrickville	Regional Road		crossing deficiency	missing crossing point	-33.9080288	151.1442068	1		install new kerb ramp - pair	MV232	Secondary	MED	\$ 5,000
CD1706	Wardell Road	Marrickville	Regional Road		crossing deficiency	misaligned refuge island	-33.9130636	151.1385445	1		re-construct refuge island	MV236	Secondary	MED	\$ 15,000
CD1707	Wardell Road	Marrickville	Regional Road		crossing deficiency	missing crossing point	-33.9134197	151.1377877	1		install new kerb ramp - pair	MV233	Secondary	MED	\$ 5,000
CD1708	Warren Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9147961	151.1484058	1		install new kerb ramp	MV245	Secondary	MED	\$ 2,500

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD1712	Warren Road	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9170451	151.1523923	1		install new tgsi - pair	MV249	Secondary	MED	\$ 1,300
CD1716	Warren Road	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9171671	151.1524132	1		install new tgsi - pair	MV249	Secondary	MED	\$ 1,300
CD1719	Warren Road	Marrickville	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.9153533	151.1491616	1		install new kerb ramp - pair	MV245	Secondary	MED	\$ 5,000
CD1720	Warren Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9138413	151.1465295	1		install new kerb ramp - pair	MV243	Secondary	MED	\$ 5,000
CD1721	Warren Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9141898	151.1473909	1		install new kerb ramp - pair	MV244	Secondary	MED	\$ 5,000
CD1722	Albermarle Street	Newtown	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8959175	151.174968	1		install new kerb ramp - pair	NE4	Secondary	MED	\$ 5,000
CD1723	Albermarle Street	Newtown	Local Road		crossing deficiency	missing kerb ramp	-33.8959192	151.1749578	1		install new kerb ramp	NE4	Secondary	MED	\$ 2,500
CD1724	Albermarle Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8959632	151.1749839	1		install new kerb ramp	NE4	Secondary	MED	\$ 2,500
CD1725	Albermarle Street	Newtown	Local Road		crossing deficiency	missing kerb ramp	-33.8959002	151.1750296	1		install new kerb ramp	NE4	Secondary	MED	\$ 2,500
CD1726	Albermarle Street	Newtown	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8956837	151.1757327	1		install new kerb ramp - pair	NE4	Secondary	MED	\$ 5,000
CD1727	Albermarle Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8955173	151.1763032	1		install new kerb ramp	NE3	Secondary	MED	\$ 2,500
CD1728	Albermarle Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8955658	151.1763289	1		install new kerb ramp	NE3	Secondary	MED	\$ 2,500
CD1729	Albermarle Street	Newtown	Local Road		crossing deficiency	misaligned kerb ramp	-33.8955502	151.1763777	1		install new kerb ramp	NE3	Secondary	MED	\$ 2,500
CD1730	Albermarle Street	Newtown	Local Road		crossing deficiency	missing kerb ramp	-33.895496	151.1763662	1		install new kerb ramp	NE3	Secondary	MED	\$ 2,500
CD1731	Albermarle Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8953188	151.1769715	1		install new kerb ramp	NE2	Secondary	MED	\$ 2,500
CD1732	Albermarle Street	Newtown	Local Road		crossing deficiency	missing kerb ramp	-33.8952984	151.1770246	1		install new kerb ramp	NE2	Secondary	MED	\$ 2,500
CD1733	Albermarle Street	Newtown	Local Road		crossing deficiency	missing kerb ramp	-33.8953675	151.1769892	1		install new kerb ramp	NE2	Secondary	MED	\$ 2,500
CD1734	Albermarle Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.895346	151.1770478	1		install new kerb ramp	NE2	Secondary	MED	\$ 2,500
CD1735	Albermarle Street	Newtown	Local Road		crossing deficiency	missing kerb ramp	-33.8952973	151.1770355	1		install new kerb ramp	NE2	Secondary	MED	\$ 2,500
CD1736	Albermarle Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8951167	151.1776625	1		install new kerb ramp	NE2	Secondary	MED	\$ 2,500
CD1737	Alice Street	Newtown	Regional Road		crossing deficiency	driveway as kerb ramp	-33.9040919	151.1759131	1		no action	NE8	Secondary	MED	\$ -
CD1738	Alice Street	Newtown	Regional Road		crossing deficiency	driveway as kerb ramp	-33.9039636	151.1759628	1		no action	NE8	Secondary	MED	\$ -
CD1739	Alice Street	Newtown	Regional Road		crossing deficiency	at grade crossing missing tgsi	-33.9040051	151.1758224	1		install new tgsi	NE8	Secondary	MED	\$ 650
CD1744	Bedford Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8975552	151.1771406	1		install new kerb ramp - pair	NE20	Secondary	MED	\$ 5,000
CD1745	Bedford Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8968813	151.174668	1		install new kerb ramp	NE19	Secondary	MED	\$ 2,500
CD1746	Bedford Street	Newtown	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8962759	151.1737843	1		install new kerb ramp - pair	NE1	Secondary	MED	\$ 5,000
CD1747	Bedford Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8962038	151.1735764	1		install new kerb ramp - pair	NE45	Secondary	MED	\$ 5,000
CD1748	Bedford Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8953045	151.1719997	1		install new kerb ramp	NE16	Secondary	MED	\$ 2,500
CD1749	Bedwin Road	Newtown	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.9079655	151.1748105	1		install new kerb ramp	MV17	Secondary	MED	\$ 2,500
CD1757	Enmore Road	Newtown	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8986713	151.1740305	1		install new kerb ramp	NE46	Secondary	MED	\$ 2,500
CD1758	Enmore Road	Newtown	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8987193	151.1738923	1		install new kerb ramp	NE46	Secondary	MED	\$ 2,500
CD1761	Frederick Street	Newtown	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8972443	151.1758324	1		install new kerb ramp - pair	NE19	Secondary	MED	\$ 5,000
CD1763	King Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9028943	151.1793658	1		install new kerb ramp	NE5	Secondary	MED	\$ 2,500
CD1775	Lennox Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8959846	151.1782202	1		install new kerb ramp	NE42	Secondary	MED	\$ 2,500
CD1776	Lennox Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8955471	151.179734	1		install new kerb ramp	NE40	Secondary	MED	\$ 2,500
CD1777	Lennox Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.895901	151.1784848	1		install new kerb ramp	NE42	Secondary	MED	\$ 2,500
CD1781	Phillip Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8984391	151.1739404	1		install new kerb ramp	NE46	Secondary	MED	\$ 2,500
CD1782	Phillip Street	Newtown	Local Road		crossing deficiency	missing kerb ramp	-33.8979234	151.1735496	1		install new kerb ramp	NE44	Secondary	MED	\$ 2,500
CD1783	Phillip Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8979843	151.1735745	1		install new kerb ramp	NE46	Secondary	MED	\$ 2,500
CD1784	Phillip Street	Newtown	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8973107	151.1732872	1		install new kerb ramp - pair	NE44	Secondary	MED	\$ 5,000
CD1785	Phillip Street	Newtown	Local Road		crossing deficiency	damaged kerb ramp - pair	-33.8982986	151.1737694	1		install new kerb ramp - pair	NE46	Secondary	MED	\$ 5,000
CD1786	Station Street	Newtown	Local Road		crossing deficiency	poor kerb ramp alignment	-33.900219	151.1772312	1		install new kerb ramp	NE59	Secondary	MED	\$ 2,500
CD1787	Wells Street	Newtown	Local Road		crossing deficiency	missing kerb ramp	-33.9052648	151.1802167	1		install new kerb ramp	NE60	Secondary	MED	\$ 2,500
CD1788	Wells Street	Newtown	Local Road		crossing deficiency	misaligned kerb ramp	-33.9060085	151.1776836	1		install new kerb ramp	NE64	Secondary	MED	\$ 2,500
CD1789	Wells Street	Newtown	Local Road		crossing deficiency	misaligned kerb ramp	-33.9062024	151.177328	1		install new kerb ramp	NE63	Secondary	MED	\$ 2,500
CD1790	Wells Street	Newtown	Local Road		crossing deficiency	mismatched kerb ramps	-33.9064757	151.1764547	1		install new kerb ramp	NE62	Secondary	MED	\$ 2,500
CD1791	Addison Road	Petersham	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8996974	151.1558807	1		install new kerb ramp	PE2	Secondary	MED	\$ 2,500
CD1792	Addison Road	Petersham	Regional Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.8994775	151.1544837	1		install new kerb ramp - pair	PE1	Secondary	MED	\$ 5,000
CD1793	Addison Road	Petersham	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8994801	151.1545623	1		install new kerb ramp	PE1	Secondary	MED	\$ 2,500
CD1794	Addison Road	Petersham	Regional Road	Strategic Route	crossing deficiency	steep kerb ramp	-33.8995228	151.1555013	1		install new kerb ramp - pair	PE2	Secondary	MED	\$ 5,000
CD1797	Brighton Street	Petersham	Local Road		crossing deficiency	missing kerb ramp	-33.8922107	151.1548863	1		install new kerb ramp	PE9	Secondary	MED	\$ 2,500
CD1798	Brighton Street	Petersham	Local Road		crossing deficiency	misaligned kerb ramp	-33.8921873	151.1561396	1		install new kerb ramp	PE11	Secondary	MED	\$ 2,500
CD1800	Brighton Street	Petersham	Local Road		crossing deficiency	misaligned refuge island	-33.8930697	151.1504395	1		re-construct refuge island	PE5	Secondary	MED	\$ 15,000
CD1801	Brighton Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8932384	151.1504314	1		install new kerb ramp	PE5	Secondary	MED	\$ 2,500
CD1803	Crystal Street	Petersham	Local Road		crossing deficiency	misaligned kerb ramp	-33.8940991	151.1574473	1		install new kerb ramp	PE19	Secondary	MED	\$ 2,500
CD1804	Crystal Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8939257	151.1575235	1		install new kerb ramp	PE19	Secondary	MED	\$ 2,500
CD1805	Crystal Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8926531	151.1579505	1		install new kerb ramp	SM9	Secondary	MED	\$ 2,500
CD1806	Crystal Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8923103	151.1578999	1		install new kerb ramp	PE4	Secondary	MED	\$ 2,500
CD1807	Crystal Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8911174	151.1583415	1		install new kerb ramp	PE15	Secondary	MED	\$ 2,500
CD1812	Crystal Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8918029	151.1582904	1		install new kerb ramp	PE15	Secondary	MED	\$ 2,500
CD1813	Frazer Street	Petersham	Regional Road		crossing deficiency	missing kerb ramp	-33.9009427	151.1491763	1		install new kerb ramp	PE20	Secondary	MED	\$ 2,500
CD1814	Frazer Street	Petersham	Regional Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.900985	151.1495828	1		install new tgsi - pair	PE20	Secondary	MED	\$ 1,300
CD1815	Frazer Street	Petersham	Regional Road		crossing deficiency	at grade crossing missing tgsi	-33.9011852	151.1533106	1		install new tgsi	MV75	Secondary	MED	\$ 650
CD1818	Livingstone Road	Petersham	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8995071	151.1534448	1		install new kerb ramp	PE26	Secondary	MED	\$ 2,500
CD1819	Livingstone Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8994159	151.1536358	1		install new kerb ramp	PE1	Secondary	MED	\$ 2,500
CD1820	Livingstone Road	Petersham	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi - pair	-33.8974793	151.1534926	1		install new tgsi - pair	PE24	Secondary	MED	\$ 1,300
CD1838	Newington Road	Petersham	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8985008	151.1609454	1		install new tgsi	MV150	Secondary	MED	\$ 650
CD1839	Newington Road	Petersham	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8984211	151.160478	1		install new tgsi	MV149	Secondary	MED	\$ 650
CD1840	Newington Road	Petersham	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8983062	151.1599744	1		install new tgsi	MV149	Secondary	MED	\$ 650
CD1841	Newington Road	Petersham	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8981959	151.159542	1		install new tgsi	MV149	Secondary	MED	\$ 650
CD1842	Newington Road	Petersham	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8980162	151.1583108	1		install new tgsi	PE36	Secondary	MED	\$ 650
CD1843	Newington Road	Petersham	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8979966	151.1583582	1		install new tgsi	PE36	Secondary	MED	\$ 650
CD1844	Newington Road	Petersham	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8979576	151.1583229	1		install new tgsi	PE36	Secondary	MED	\$ 650
CD1845	Newington Road	Petersham	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8979948	151.1582414	1		install new tgsi	PE36	Secondary	MED	\$ 650
CD1846	Newington Road	Petersham	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8978656	151.1574721	1		install new tgsi	PE36	Secondary	MED	\$ 650
CD1851	Palace Street	Petersham	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8921043	151.1543193	1		install new kerb ramp	PE39	Secondary	MED	\$ 2,500
CD1852	Palace Street	Petersham	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8908595	151.1544395	1		install new kerb ramp - pair	PE42	Secondary	MED	\$ 5,000
CD1854	Palace Street	Petersham	Local Road	Strategic Route	crossing deficiency	missing crossing point	-33.8912365	151.154323	1		install new kerb ramp - pair	PE39	Secondary	MED	\$ 5,000
CD1855	Palace Street	Petersham	Local Road	Strategic Route	crossing deficiency	missing crossing point	-33.8892127	151.1543987	1		install new kerb ramp - pair	PE40	Secondary	MED	\$ 5,000
CD1866	Railway Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8931055	151.1559238	1		install new kerb ramp	PE47	Secondary	MED	\$ 2,500
CD1867	Railway Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8923893	151.1561661	1		install new kerb ramp - pair	PE47	Secondary	MED	\$ 5,000
CD1868	Railway Street	Petersham	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8922969	151.1559966	1		install new kerb ramp - pair	PE10	Secondary	MED	\$ 5,000

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD1869	Railway Street	Petersham	Local Road		crossing deficiency	crossing within roundabout	-33.8922462	151.1561763	1		install new kerb ramp and reconstruct	PE11	Secondary	MED	\$ 5,000
CD1870	Shaw Street	Petersham	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8964329	151.156633	1		install new kerb ramp	PE50	Secondary	MED	\$ 2,500
CD1871	Shaw Street	Petersham	Regional Road		crossing deficiency	misaligned new kerb ramp	-33.8975786	151.1559946	1		install new kerb ramp	PE52	Secondary	MED	\$ 2,500
CD1872	Shaw Street	Petersham	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8964212	151.1565266	1		install new kerb ramp	PE50	Secondary	MED	\$ 2,500
CD1873	Stanmore Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8956053	151.1568451	1		install new kerb ramp	PE18	Secondary	MED	\$ 2,500
CD1875	Stanmore Road	Petersham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8957808	151.1568936	1		install new kerb ramp - pair	PE50	Secondary	MED	\$ 5,000
CD1879	Terminus Street	Petersham	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.893447	151.1558576	1		install new kerb ramp	PE47	Secondary	MED	\$ 2,500
CD1881	Terminus Street	Petersham	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8934152	151.1575798	1		install new kerb ramp - pair	PE13	Secondary	MED	\$ 5,000
CD1882	Trafalgar Street	Petersham	Regional Road		crossing deficiency	misaligned kerb ramp	-33.8949311	151.1517393	1		install new kerb ramp	PE64	Secondary	MED	\$ 2,500
CD1886	Wardell Road	Petersham	Regional Road		crossing deficiency	missing kerb ramp	-33.9009519	151.1492164	1		install new kerb ramp	PE20	Secondary	MED	\$ 2,500
CD1887	Wardell Road	Petersham	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9009599	151.1491249	1		install new kerb ramp	PE20	Secondary	MED	\$ 2,500
CD1888	Wardell Road	Petersham	Regional Road		crossing deficiency	misaligned refuge island	-33.8987195	151.1492412	1		re-construct refuge island	LW39	Secondary	MED	\$ 15,000
CD1889	West Street	Petersham	Local Road		crossing deficiency	misaligned kerb ramp	-33.8932719	151.1504505	1		install new kerb ramp	PE65	Secondary	MED	\$ 2,500
CD1891	West Street	Petersham	Local Road		crossing deficiency	misaligned kerb ramp	-33.8932813	151.1504132	1		install new kerb ramp	PE65	Secondary	MED	\$ 2,500
CD1892	West Street	Petersham	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8907402	151.1490056	1		install new tgsi	PE66	Secondary	MED	\$ 650
CD1893	West Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8906431	151.1490516	1		install new kerb ramp	PE66	Secondary	MED	\$ 2,500
CD1894	York Crescent	Petersham	Local Road		crossing deficiency	missing kerb ramp	-33.8937219	151.1585093	1		install new kerb ramp	PE21	Secondary	MED	\$ 2,500
CD1895	Beattie Street	Rozelle	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8605752	151.1723061	1		install new tgsi	RO17	Secondary	MED	\$ 650
CD1904	Darling Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8607323	151.1719257	1		install new kerb ramp	RO17	Secondary	MED	\$ 2,500
CD1911	Darling Street	Rozelle	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8653882	151.167519	1		install new tgsi	RO27	Secondary	MED	\$ 650
CD1912	Darling Street	Rozelle	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8655902	151.1671623	1		install new tgsi	RO27	Secondary	MED	\$ 650
CD1913	Denison Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8683444	151.1692171	1		install new kerb ramp - pair	RO30	Secondary	MED	\$ 5,000
CD1914	Denison Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8683144	151.1691816	1		install new kerb ramp	RO30	Secondary	MED	\$ 2,500
CD1924	Denison Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8661968	151.1680374	1		install new kerb ramp	RO29	Secondary	MED	\$ 2,500
CD1925	Denison Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8657647	151.1678579	1		install new kerb ramp - pair	RO32	Secondary	MED	\$ 5,000
CD1926	Denison Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8658416	151.1679795	1		install new kerb ramp - pair	RO32	Secondary	MED	\$ 5,000
CD1929	Evans Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.866998	151.1696663	1		install new kerb ramp	RO35	Secondary	MED	\$ 2,500
CD1930	Evans Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8674825	151.1687937	1		install new kerb ramp - pair	RO35	Secondary	MED	\$ 5,000
CD1931	Evans Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8671073	151.1692726	1		install new kerb ramp	RO35	Secondary	MED	\$ 2,500
CD1935	Gordon Street	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8660448	151.1729501	1		install new kerb ramp	RO38	Secondary	MED	\$ 2,500
CD1936	Gordon Street	Rozelle	State Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8678609	151.1727611	1		install new kerb ramp	RO40	Secondary	MED	\$ 2,500
CD1937	Gordon Street	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8677228	151.1727645	1		install new kerb ramp	RO39	Secondary	MED	\$ 2,500
CD1938	Gordon Street	Rozelle	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8674375	151.1727283	1		install new tgsi	RO39	Secondary	MED	\$ 650
CD1939	Gordon Street	Rozelle	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8670745	151.1727761	1		install new kerb ramp	RO39	Secondary	MED	\$ 2,500
CD1940	Gordon Street	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8669939	151.1727801	1		install new kerb ramp - pair	RO39	Secondary	MED	\$ 5,000
CD1941	Gordon Street	Rozelle	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8666416	151.172861	1		install new tgsi	RO38	Secondary	MED	\$ 650
CD1942	Gordon Street	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8664853	151.1728734	1		install new kerb ramp	RO38	Secondary	MED	\$ 2,500
CD1943	Gordon Street	Rozelle	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8664751	151.1730017	1		install new tgsi	RO38	Secondary	MED	\$ 650
CD1944	Gordon Street	Rozelle	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8669524	151.1729092	1		install new kerb ramp	RO38	Secondary	MED	\$ 2,500
CD1945	Gordon Street	Rozelle	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8677164	151.1728369	1		install new tgsi	RO39	Secondary	MED	\$ 650
CD1946	Gordon Street	Rozelle	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8680777	151.1728757	1		install new tgsi	RO40	Secondary	MED	\$ 650
CD1947	Gordon Street	Rozelle	State Road	Strategic Route	crossing deficiency	missing crossing point	-33.8685229	151.1728689	1		install new kerb ramp - pair	RO40	Secondary	MED	\$ 5,000
CD1948	Gordon Street	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8686203	151.1728485	1		install new kerb ramp - pair	RO37	Secondary	MED	\$ 5,000
CD1949	Lilyfield Road	Rozelle	Regional Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8686756	151.1724375	1		install new kerb ramp - pair	RO41	Secondary	MED	\$ 5,000
CD1950	Lilyfield Road	Rozelle	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8685439	151.1727808	1		install new kerb ramp - pair	RO41	Secondary	MED	\$ 5,000
CD1951	Lilyfield Road	Rozelle	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8687714	151.1724108	1		install new tgsi	RO41	Secondary	MED	\$ 650
CD1952	Lilyfield Road	Rozelle	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8692243	151.1717238	1		install new tgsi	RO48	Secondary	MED	\$ 650
CD1953	Lilyfield Road	Rozelle	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8684504	151.1757959	1		install new kerb ramp	RO44	Secondary	MED	\$ 2,500
CD1954	Lilyfield Road	Rozelle	Regional Road	Strategic Route	crossing deficiency	missing crossing point	-33.8686927	151.1730286	1		install new kerb ramp - pair	RO43	Secondary	MED	\$ 5,000
CD1955	Lilyfield Road	Rozelle	Regional Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8713324	151.1695516	1		install new kerb ramp	RO45	Secondary	MED	\$ 2,500
CD1956	Lilyfield Road	Rozelle	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.87142	151.1694485	1		install new kerb ramp	RO45	Secondary	MED	\$ 2,500
CD1957	Lilyfield Road	Rozelle	Regional Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8715791	151.1692671	1		install new tgsi	RO45	Secondary	MED	\$ 650
CD1958	Lilyfield Road	Rozelle	Regional Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8696864	151.1708228	1		install new kerb ramp - pair	RO47	Secondary	MED	\$ 5,000
CD1959	Lilyfield Road	Rozelle	Regional Road	Strategic Route	crossing deficiency	missing crossing point - future park access	-33.8695954	151.171029	1		install new kerb ramp - pair, new refuge	RO47	Secondary	MED	\$ 7,000
CD1960	Lilyfield Road	Rozelle	Regional Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.8708477	151.1702197	1		install new kerb ramp - pair	RO46	Secondary	MED	\$ 5,000
CD1961	Lilyfield Road	Rozelle	Regional Road	Strategic Route	crossing deficiency	missing crossing point - future park access	-33.8709849	151.1701043	1		install new kerb ramp - pair, new refuge	RO45	Secondary	MED	\$ 7,000
CD1966	Manning Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8636461	151.1653292	1		install new kerb ramp - pair	RO51	Secondary	MED	\$ 5,000
CD1967	Manning Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8642163	151.1656204	1		install new kerb ramp	RO49	Secondary	MED	\$ 2,500
CD1968	Manning Street	Rozelle	Local Road		crossing deficiency	missing kerb ramp	-33.8652147	151.1663018	1		install new kerb ramp	RO52	Secondary	MED	\$ 2,500
CD1969	Mullens Street	Rozelle	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8639463	151.1766391	1		install new tgsi - pair	RO54	Secondary	MED	\$ 1,300
CD1970	Mullens Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.864031	151.1767777	1		install new kerb ramp	RO54	Secondary	MED	\$ 2,500
CD1971	Mullens Street	Rozelle	Local Road		crossing deficiency	missing kerb ramp	-33.86416	151.1767408	1		install new kerb ramp	RO54	Secondary	MED	\$ 2,500
CD1976	Robert Street	Rozelle	Local Road		crossing deficiency	narrow kerb ramp - pair	-33.8661634	151.1765161	1		install new kerb ramp - pair	RO56	Secondary	MED	\$ 5,000
CD1977	Robert Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8666344	151.1754951	1		install new kerb ramp - pair	RO57	Secondary	MED	\$ 5,000
CD1980	Terry Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8616409	151.1664832	1		install new kerb ramp - pair	RO65	Secondary	MED	\$ 5,000
CD1982	Terry Street	Rozelle	Local Road		crossing deficiency	narrow refuge island	-33.86069	151.1699728	1		install new refuge island	RO66	Secondary	MED	\$ 15,000
CD1983	Terry Street	Rozelle	Local Road		crossing deficiency	missing kerb ramp	-33.8606637	151.1699543	1		install new kerb ramp	RO66	Secondary	MED	\$ 2,500
CD1984	Terry Street	Rozelle	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8603551	151.1703367	1		install new kerb ramp - pair	RO63	Secondary	MED	\$ 5,000
CD1987	Terry Street	Rozelle	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8604534	151.1703484	1		install new kerb ramp - pair	RO66	Secondary	MED	\$ 5,000
CD1993	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8620435	151.1674161	1		install new kerb ramp - pair	RO79	Secondary	MED	\$ 5,000
CD1995	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8661432	151.1737541	1		install new kerb ramp	RO73	Secondary	MED	\$ 2,500
CD1996	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8658768	151.1732629	1		install new kerb ramp - pair	RO73	Secondary	MED	\$ 5,000
CD1997	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8669637	151.1754674	1		install new kerb ramp	RO57	Secondary	MED	\$ 2,500
CD2003	Victoria Road	Rozelle	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8660746	151.1741883	1		install new kerb ramp - pair	RO73	Secondary	MED	\$ 5,000
CD2008	Campbell Street	St Peters	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.9117973	151.1776571	1		install new kerb ramp	SP31	Secondary	MED	\$ 2,500
CD2010	Church Street	St Peters	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9127817	151.1780766	1		install new kerb ramp	SP7	Secondary	MED	\$ 2,500
CD2011	Church Street	St Peters	Local Road		crossing deficiency	missing crossing point	-33.9134017	151.1774592	1		install new kerb ramp - pair	SP7	Secondary	MED	\$ 5,000
CD2012	Church Street	St Peters	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9121804	151.1785759	1		install new kerb ramp - pair	SP6	Secondary	MED	\$ 5,000
CD2018	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9166195	151.1726588	1		install new kerb ramp - pair	SP25	Secondary	MED	\$ 5,000
CD2019	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9170628	151.1720333	1		install new kerb ramp - pair	SP8	Secondary	MED	\$ 5,000
CD2020	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9198578	151.168754	1		install new kerb ramp - pair	SP28	Secondary	MED	\$ 5,000
CD2022	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9180858	151.1709209	1		install new kerb ramp - pair	SP8	Secondary	MED	\$ 5,000

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD2023	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	missing kerb ramp - pair	-33.9174979	151.1717504	1		install new kerb ramp - pair	SP8	Secondary	MED	\$ 5,000
CD2028	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9157707	151.173918	1		install new kerb ramp - pair	SP23	Secondary	MED	\$ 5,000
CD2031	Princes Highway	St Peters	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9123868	151.1795704	1		install new kerb ramp - pair	SP15	Secondary	MED	\$ 5,000
CD2043	St Peters Street	St Peters	Local Road		crossing deficiency	missing crossing point	-33.9128643	151.1767093	1		install new kerb ramp - pair	SP30	Secondary	MED	\$ 5,000
CD2044	Unwins Bridge Road	St Peters	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9140856	151.1699647	1		install new kerb ramp	SP38	Secondary	MED	\$ 2,500
CD2045	Unwins Bridge Road	St Peters	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9135047	151.1707421	1		install new kerb ramp	SP38	Secondary	MED	\$ 2,500
CD2047	Bridge Road	Stanmore	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8909054	151.1705466	1		install new kerb ramp	SM2	Secondary	MED	\$ 2,500
CD2054	Douglas Street	Stanmore	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8931418	151.1594196	1		install new kerb ramp	SM10	Secondary	MED	\$ 2,500
CD2059	Gordon Crescent	Stanmore	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8943888	151.1612177	1		install new kerb ramp - pair	SM17	Secondary	MED	\$ 5,000
CD2060	Gordon Crescent	Stanmore	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8938785	151.1593305	1		install new kerb ramp	SM15	Secondary	MED	\$ 2,500
CD2066	Merchant Street	Stanmore	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8971083	151.1668884	1		install new kerb ramp - pair	SM19	Secondary	MED	\$ 5,000
CD2067	Merchant Street	Stanmore	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8971078	151.1667724	1		install new kerb ramp	SM19	Secondary	MED	\$ 2,500
CD2068	Merchant Street	Stanmore	Local Road		crossing deficiency	missing kerb ramp	-33.8969708	151.1668298	1		install new kerb ramp	SM19	Secondary	MED	\$ 2,500
CD2069	Merchant Street	Stanmore	Local Road		crossing deficiency	missing kerb ramp	-33.8970475	151.1667054	1		install new kerb ramp	SM19	Secondary	MED	\$ 2,500
CD2070	Merchant Street	Stanmore	Local Road		crossing deficiency	raised kerb ramp lip	-33.896077	151.1673427	1		install new kerb ramp	SM21	Secondary	MED	\$ 2,500
CD2071	Merchant Street	Stanmore	Local Road		crossing deficiency	missing kerb ramp	-33.8972988	151.1665727	1		install new kerb ramp	SM19	Secondary	MED	\$ 2,500
CD2080	Parramatta Road	Stanmore	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8881895	151.1650054	1		install new kerb ramp - pair	AN75	Secondary	MED	\$ 5,000
CD2081	Parramatta Road	Stanmore	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8877272	151.1715614	1		install new kerb ramp - pair	SM1	Secondary	MED	\$ 5,000
CD2094	Railway Avenue	Stanmore	Local Road		crossing deficiency	misaligned refuge island	-33.893778	151.1674639	1		re-construct refuge island	SM40	Secondary	MED	\$ 15,000
CD2103	Salisbury Road	Stanmore	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8916833	151.1684949	1		install new kerb ramp	SM45	Secondary	MED	\$ 2,500
CD2104	Salisbury Road	Stanmore	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8912448	151.170413	1		install new kerb ramp	SM44	Secondary	MED	\$ 2,500
CD2106	Stanmore Road	Stanmore	State Road	Strategic Route	crossing deficiency	steep kerb ramp - pair	-33.8976564	151.1664696	1		install new kerb ramp	SM19	Secondary	MED	\$ 5,000
CD2107	Stanmore Road	Stanmore	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8976105	151.1663397	1		install new kerb ramp	SM19	Secondary	MED	\$ 2,500
CD2112	Carlton Crescent	Summer Hill	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8897532	151.1316463	1		install new kerb ramp - pair	SH8	Secondary	MED	\$ 5,000
CD2116	Carlton Crescent	Summer Hill	Regional Road	Strategic Route	crossing deficiency	raised kerb ramp lip - pair	-33.8917334	151.1421561	1		install new kerb ramp - pair	SH7	Secondary	MED	\$ 5,000
CD2117	Carlton Crescent	Summer Hill	Regional Road	Strategic Route	crossing deficiency	missing crossing point	-33.8924654	151.1437795	1		install new kerb ramp - pair	SH1	Secondary	MED	\$ 5,000
CD2119	Flour Mill Way	Summer Hill	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8929139	151.1423475	1		install new tgsi	SH15	Secondary	MED	\$ 650
CD2120	Frenchs Lane	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8897458	151.144604	1		install new kerb ramp - pair	SH16	Secondary	MED	\$ 5,000
CD2122	Grosvenor Crescent	Summer Hill	Local Road		crossing deficiency	missing crossing point	-33.8901099	151.1391877	1		install new kerb ramp - pair	SH21	Secondary	MED	\$ 5,000
CD2123	Grosvenor Crescent	Summer Hill	Local Road		crossing deficiency	missing crossing point	-33.8924612	151.1439997	1		install new kerb ramp - pair	SH19	Secondary	MED	\$ 5,000
CD2126	Henson Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8963814	151.1346783	1		install new kerb ramp - pair	SH35	Secondary	MED	\$ 5,000
CD2127	Herbert Street	Summer Hill	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8963375	151.134492	1		install new kerb ramp - pair	SH37	Secondary	MED	\$ 5,000
CD2128	Herbert Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8963566	151.1335694	1		install new kerb ramp - pair	SH37	Secondary	MED	\$ 5,000
CD2130	James Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8972955	151.1345578	1		install new kerb ramp - pair	SH35	Secondary	MED	\$ 5,000
CD2131	James Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8974061	151.1358809	1		install new kerb ramp - pair	SH58	Secondary	MED	\$ 5,000
CD2133	Junction Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8949771	151.132434	1		install new kerb ramp - pair	SH40	Secondary	MED	\$ 5,000
CD2134	Junction Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8950297	151.1334916	1		install new kerb ramp - pair	SH40	Secondary	MED	\$ 5,000
CD2135	Junction Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8951889	151.1356371	1		install new kerb ramp - pair	SH43	Secondary	MED	\$ 5,000
CD2136	Junction Road	Summer Hill	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8952783	151.1366065	1		install new tgsi	SH43	Secondary	MED	\$ 650
CD2137	Junction Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8952993	151.1367141	1		install new kerb ramp	SH39	Secondary	MED	\$ 2,500
CD2138	Junction Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.895355	151.1375765	1		install new kerb ramp - pair	SH39	Secondary	MED	\$ 5,000
CD2139	Junction Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8954013	151.1371971	1		install new kerb ramp	SH39	Secondary	MED	\$ 2,500
CD2140	Junction Road	Summer Hill	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8953911	151.1371547	1		install new tgsi	SH39	Secondary	MED	\$ 650
CD2141	Junction Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8953412	151.1366591	1		install new kerb ramp - pair	SH39	Secondary	MED	\$ 5,000
CD2144	Liverpool Road	Summer Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8881942	151.1351289	1		install new kerb ramp - pair	SH46	Secondary	MED	\$ 5,000
CD2145	Liverpool Road	Summer Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8868516	151.1379147	1		install new kerb ramp - pair	AF96	Secondary	MED	\$ 5,000
CD2146	Liverpool Road	Summer Hill	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8894188	151.1324739	1		install new kerb ramp - pair	SH28	Secondary	MED	\$ 5,000
CD2148	Nowranie Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8923961	151.1388064	1		install new kerb ramp - pair	SH51	Secondary	MED	\$ 5,000
CD2149	Nowranie Street	Summer Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8942597	151.1387541	1		install new tgsi - pair	SH50	Secondary	MED	\$ 1,300
CD2150	Nowranie Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8954769	151.138597	1		install new kerb ramp - pair	SH55	Secondary	MED	\$ 5,000
CD2151	Nowranie Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8934998	151.1386917	1		install new kerb ramp - pair	SH52	Secondary	MED	\$ 5,000
CD2164	Prospect Road	Summer Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8904633	151.1322631	1		install new tgsi - pair	SH64	Secondary	MED	\$ 1,300
CD2165	Prospect Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8898299	151.1322951	1		install new kerb ramp - pair	SH64	Secondary	MED	\$ 5,000
CD2166	Prospect Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8935296	151.1323417	1		install new kerb ramp	SH68	Secondary	MED	\$ 2,500
CD2167	Prospect Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8934505	151.1324766	1		install new kerb ramp - pair	SH68	Secondary	MED	\$ 5,000
CD2168	Prospect Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8987841	151.1322156	1		install new kerb ramp - pair	SH73	Secondary	MED	\$ 5,000
CD2170	Prospect Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8962839	151.1324029	1		install new kerb ramp - pair	SH37	Secondary	MED	\$ 5,000
CD2171	Prospect Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8979658	151.1322071	1		install new kerb ramp - pair	SH73	Secondary	MED	\$ 5,000
CD2180	Smith Street	Summer Hill	Local Road		crossing deficiency	missing kerb ramp	-33.891694	151.1363151	1		install new kerb ramp	SH82	Secondary	MED	\$ 2,500
CD2183	Smith Street	Summer Hill	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8918176	151.1380992	1		install new kerb ramp - pair	SH81	Secondary	MED	\$ 5,000
CD2184	Smith Street	Summer Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8920432	151.1387863	1		install new tgsi - pair	SH81	Secondary	MED	\$ 1,300
CD2185	Smith Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8923837	151.1404383	1		install new kerb ramp - pair	SH87	Secondary	MED	\$ 5,000
CD2186	Smith Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8926137	151.1417028	1		install new kerb ramp - pair	SH88	Secondary	MED	\$ 5,000
CD2187	Smith Street	Summer Hill	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8924957	151.1435641	1		install new kerb ramp - pair	SH89	Secondary	MED	\$ 5,000
CD2188	Smith Street	Summer Hill	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8928078	151.1419216	1		install new kerb ramp - pair	SH88	Secondary	MED	\$ 5,000
CD2189	Smith Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8928217	151.1417196	1		install new kerb ramp - pair	SH88	Secondary	MED	\$ 5,000
CD2190	Smith Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8925922	151.1408555	1		install new kerb ramp - pair	SH87	Secondary	MED	\$ 5,000
CD2191	Smith Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8923744	151.1399076	1		install new kerb ramp - pair	SH87	Secondary	MED	\$ 5,000
CD2192	Smith Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8920892	151.1388936	1		install new kerb ramp - pair	SH86	Secondary	MED	\$ 5,000
CD2193	Smith Street	Summer Hill	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8916228	151.1348065	1		install new kerb ramp - pair	SH83	Secondary	MED	\$ 5,000
CD2194	Smith Street	Summer Hill	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8917071	151.1335029	1		install new kerb ramp - pair	SH80	Secondary	MED	\$ 5,000
CD2195	Smith Street	Summer Hill	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8917	151.1332302	1		install new tgsi - pair	SH80	Secondary	MED	\$ 1,300
CD2196	Smith Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8917797	151.1325223	1		install new kerb ramp - pair	SH80	Secondary	MED	\$ 5,000
CD2197	Smith Street	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.891606	151.1336243	1		install new kerb ramp - pair	SH80	Secondary	MED	\$ 5,000
CD2198	Smith Street	Summer Hill	Local Road		crossing deficiency	long crossing	-33.892086	151.1388568	1		install kerb extension	SH51	Secondary	MED	\$ 10,000
CD2203	George Street	Sydenham	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9146009	151.1672724	1		install new tgsi - pair	SY3	Secondary	MED	\$ 1,300
CD2208	Princes Highway	Sydenham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9201808	151.1679202	1		install new kerb ramp	SP29	Secondary	MED	\$ 2,500
CD2209	Princes Highway	Sydenham	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9196642	151.1686104	1		install new kerb ramp	SP28	Secondary	MED	\$ 2,500
CD2210	Princes Highway	Sydenham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9174896	151.1713415	1		install new kerb ramp - pair	SP8	Secondary	MED	\$ 5,000
CD2211	Princes Highway	Sydenham	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.918021	151.170721	1		install new kerb ramp - pair	SP8	Secondary	MED	\$ 5,000
CD2213	Princes Highway	Sydenham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9190862	151.1692916	1		install new kerb ramp - pair	SY9	Secondary	MED	\$ 5,000
CD2214	Princes Highway	Sydenham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9191835	151.1691879	1		install new kerb ramp - pair	SY9	Secondary	MED	\$ 5,000

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD2215	Princes Highway	Sydenham	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9201949	151.1679104	1		install new kerb ramp - pair	SP29	Secondary	MED	\$ 5,000
CD2220	Gannon Street	Tempe	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9247829	151.1598668	1		install new kerb ramp - pair	TE1	Secondary	MED	\$ 5,000
CD2221	Gannon Street	Tempe	Local Road		crossing deficiency	misaligned kerb ramp	-33.9236432	151.1579032	1		install new kerb ramp	TE2	Secondary	MED	\$ 2,500
CD2222	Gannon Street	Tempe	Local Road		crossing deficiency	steep kerb ramp	-33.9232496	151.1573211	1		install new kerb ramp - pair	TE2	Secondary	MED	\$ 5,000
CD2223	Griffiths Street	Tempe	Local Road		crossing deficiency	poor kerb ramp alignment	-33.924748	151.1568442	1		install new kerb ramp	TE31	Secondary	MED	\$ 2,500
CD2224	Griffiths Street	Tempe	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9241322	151.1569712	1		install new tgsi	TE31	Secondary	MED	\$ 650
CD2225	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9250333	151.1603555	1		install new kerb ramp	TE1	Secondary	MED	\$ 2,500
CD2230	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9209401	151.1665014	1		install new kerb ramp	TE8	Secondary	MED	\$ 2,500
CD2231	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.9204734	151.1675085	1		install new kerb ramp	TE7	Secondary	MED	\$ 2,500
CD2232	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9205016	151.1677198	1		install new kerb ramp - pair	TE7	Secondary	MED	\$ 5,000
CD2233	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9204557	151.1675029	1		install new kerb ramp - pair	TE7	Secondary	MED	\$ 5,000
CD2234	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9205339	151.1673301	1		install new kerb ramp - pair	TE7	Secondary	MED	\$ 5,000
CD2235	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.921107	151.1655313	1		install new kerb ramp - pair	TE9	Secondary	MED	\$ 5,000
CD2236	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9221037	151.1636901	1		install new kerb ramp - pair	TE11	Secondary	MED	\$ 5,000
CD2238	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9233077	151.1623708	1		install new kerb ramp - pair	TE19	Secondary	MED	\$ 5,000
CD2243	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.920626	151.1676282	1		install new kerb ramp - pair	TE7	Secondary	MED	\$ 5,000
CD2244	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp - pair	-33.9258484	151.1596811	1		install new kerb ramp - pair	TE1	Secondary	MED	\$ 5,000
CD2248	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9257141	151.1594084	1		install new kerb ramp - pair	TE1	Secondary	MED	\$ 5,000
CD2249	Princes Highway	Tempe	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.9253738	151.1601819	1		install new kerb ramp - pair	TE1	Secondary	MED	\$ 5,000
CD2250	Richardson Crescent	Tempe	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9223853	151.1579019	1		install new kerb ramp - pair	TE14	Secondary	MED	\$ 5,000
CD2251	Richardson Crescent	Tempe	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9222879	151.1580386	1		install new kerb ramp - pair	TE23	Secondary	MED	\$ 5,000
CD2252	Union Street	Tempe	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9216304	151.1605465	1		install new tgsi	TE17	Secondary	MED	\$ 650
CD2253	Union Street	Tempe	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9218847	151.160889	1		install new kerb ramp	TE18	Secondary	MED	\$ 2,500
CD2254	Unwins Bridge Road	Tempe	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9211683	151.1599633	1		install new tgsi	TE17	Secondary	MED	\$ 650
CD2255	Unwins Bridge Road	Tempe	Local Road		crossing deficiency	misaligned derb ramp	-33.9203446	151.1608543	1		install new kerb ramp	TE20	Secondary	MED	\$ 2,500
IC1	Booth Street	Annandale	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8838678	151.1756054	1		re-construct footpath pavement	AN27	Primary	MED	\$ 200
IC2	Booth Street	Annandale	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8834831	151.1754557	1		re-construct footpath pavement	AN27	Primary	MED	\$ 200
IC6	Nelson Street	Annandale	Local Road	Strategic Route	infrastructure condition	raised pavement lip	-33.8827931	151.1734556	1		repair pavement panel	AN72	Primary	MED	\$ 200
IC7	Nelson Street	Annandale	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8829158	151.173451	1		re-construct footpath pavement	AN72	Primary	MED	\$ 200
IC8	Nelson Street	Annandale	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8832876	151.173258	1		re-construct footpath pavement	AN72	Primary	MED	\$ 200
IC10	Parramatta Road	Annandale	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8873719	151.1735274	1		re-construct footpath pavement	AN83	Primary	MED	\$ 200
IC11	Parramatta Road	Annandale	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8875255	151.1721219	1		re-construct footpath pavement	AN82	Primary	MED	\$ 200
IC12	Parramatta Road	Annandale	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8875901	151.1713595	1		re-construct footpath pavement	AN81	Primary	MED	\$ 200
IC13	Parramatta Road	Annandale	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8881429	151.1625862	1		re-construct footpath pavement	LH145	Primary	MED	\$ 200
IC21	Trafalgar Street	Annandale	Regional Road		infrastructure condition	uneven pavement surface	-33.8835483	151.1713335	1		re-construct footpath pavement	AN107	Primary	MED	\$ 200
IC34	Alt Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8846072	151.1235211	1		re-construct footpath pavement	AF10	Primary	MED	\$ 200
IC35	Alt Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8852513	151.1232491	1		re-construct footpath pavement	AF10	Primary	MED	\$ 200
IC36	Alt Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8846136	151.1236844	1		re-construct footpath pavement	AF10	Primary	MED	\$ 200
IC41	Charlotte Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8863641	151.1260664	1		re-construct footpath pavement	AF39	Primary	MED	\$ 200
IC51	Elizabeth Street	Ashfield	Regional Road		infrastructure condition	uneven pavement surface	-33.8874868	151.1273784	1		re-construct footpath pavement	AF52	Primary	MED	\$ 200
IC52	Elizabeth Street	Ashfield	Regional Road		infrastructure condition	raised pavement lip	-33.8877531	151.1279867	1		repair pavement panel	AF52	Primary	MED	\$ 200
IC53	Elizabeth Street	Ashfield	Regional Road		infrastructure condition	uneven pavement surface	-33.8881236	151.128806	1		re-construct footpath pavement	AF62	Primary	MED	\$ 200
IC56	Elizabeth Street	Ashfield	Regional Road		infrastructure condition	uneven pavement surface	-33.8856305	151.1232866	1		re-construct footpath pavement	AF53	Primary	MED	\$ 200
IC57	Elizabeth Street	Ashfield	Regional Road		infrastructure condition	uneven pavement surface	-33.8857636	151.1236993	1		re-construct footpath pavement	AF53	Primary	MED	\$ 200
IC58	Frederick Street	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8784257	151.1264806	1		re-construct footpath pavement	AF69	Primary	MED	\$ 200
IC59	Frederick Street	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8786648	151.1260413	1		re-construct footpath pavement	AF69	Primary	MED	\$ 200
IC60	Frederick Street	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8790143	151.1252476	1		re-construct footpath pavement	AF69	Primary	MED	\$ 200
IC61	Frederick Street	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8795054	151.1242668	1		re-construct footpath pavement	AF70	Primary	MED	\$ 200
IC62	Frederick Street	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8797394	151.1238204	1		re-construct footpath pavement	AF70	Primary	MED	\$ 200
IC63	Frederick Street	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8808831	151.1223637	1		re-construct footpath pavement	AF72	Primary	MED	\$ 200
IC64	Frederick Street	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8808831	151.1223637	1		re-construct footpath pavement	AF72	Primary	MED	\$ 200
IC65	Frederick Street	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8824744	151.1212994	1		re-construct footpath pavement	AF74	Primary	MED	\$ 200
IC66	Frederick Street	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8829292	151.1209697	1		re-construct footpath pavement	AF74	Primary	MED	\$ 200
IC68	Frederick Street	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8805409	151.1229801	1		re-construct footpath pavement	AF71	Primary	MED	\$ 200
IC69	Frederick Street	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8772052	151.1288757	1		re-construct footpath pavement	AF68	Primary	MED	\$ 200
IC70	Frederick Street	Ashfield	State Road	Strategic Route	infrastructure condition	poor barrier condition	-33.8852164	151.119696	1		repair barrier	AF76	Primary	MED	\$ 750
IC71	Georges River Drive	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8910606	151.1170593	1		re-construct footpath pavement	AF115	Primary	MED	\$ 200
IC72	Georges River Drive	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8889984	151.1174131	1		re-construct footpath pavement	AF112	Primary	MED	\$ 200
IC73	Georges River Drive	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8897077	151.1172962	1		re-construct footpath pavement	AF113	Primary	MED	\$ 200
IC74	Georges River Drive	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.890292	151.1172684	1		re-construct footpath pavement	AF114	Primary	MED	\$ 200
IC75	Georges River Drive	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8909647	151.1172546	1		re-construct footpath pavement	AF115	Primary	MED	\$ 200
IC76	Knox Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.889284	151.1226696	1		re-construct footpath pavement	AF119	Primary	MED	\$ 200
IC82	Norton Street	Ashfield	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8897187	151.1236654	1		re-construct footpath pavement	AF120	Primary	MED	\$ 200
IC83	Norton Street	Ashfield	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8912194	151.1276814	1		re-construct footpath pavement	AF122	Primary	MED	\$ 200
IC84	Norton Street	Ashfield	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8915116	151.1305307	1		re-construct footpath pavement	AF125	Primary	MED	\$ 200
IC85	Old Canterbury Road	Ashfield	State Road		infrastructure condition	uneven pavement surface	-33.90406	151.12899	1		re-construct footpath pavement	AF130	Primary	MED	\$ 200
IC92	Parramatta Road	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8784044	151.1305153	1		re-construct footpath pavement	HA68	Primary	MED	\$ 200
IC93	Parramatta Road	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.877954	151.1302167	1		re-construct footpath pavement	HA67	Primary	MED	\$ 200
IC132	Jane Street	Balmain	Local Road		infrastructure condition	uneven pavement surface	-33.8586255	151.1843727	1		re-construct footpath pavement	BA44	Primary	MED	\$ 200
IC139	Robert Street	Balmain	Local Road		infrastructure condition	uneven pavement surface	-33.8613917	151.1772453	1		re-construct footpath pavement	BA60	Primary	MED	\$ 200
IC157	Denison Road	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9018306	151.1403122	1		re-construct footpath pavement	DH22	Primary	MED	\$ 200
IC158	Dulwich Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9028765	151.1419066	1		re-construct footpath pavement	DH26	Primary	MED	\$ 200
IC159	Dulwich Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9024486	151.1411706	1		re-construct footpath pavement	DH25	Primary	MED	\$ 200
IC172	Ewart Street	Dulwich Hill	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9105497	151.1386799	1		re-construct footpath pavement	DH31	Primary	MED	\$ 200
IC191	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9044296	151.1396158	1		re-construct footpath pavement	DH83	Primary	MED	\$ 200
IC192	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	infrastructure condition	damaged kerb ramp	-33.9051981	151.1332176	1		install new kerb ramp	DH89	Primary	MED	\$ 2,500
IC194	Old Canterbury Road	Dulwich Hill	State Road		infrastructure condition	uneven pavement surface	-33.9000273	151.1328515	1		re-construct footpath pavement	SH62	Primary	MED	\$ 200
IC195	Old Canterbury Road	Dulwich Hill	State Road		infrastructure condition	raised pavement lip	-33.9004879	151.13246	1		repair pavement panel	SH62	Primary	MED	\$ 200
IC196	Old Canterbury Road	Dulwich Hill	State Road		infrastructure condition	uneven pavement surface	-33.9027253	151.1304501	1		re-construct footpath pavement	AF128	Primary	MED	\$ 200
IC197	Old Canterbury Road	Dulwich Hill	State Road		infrastructure condition	uneven pavement surface	-33.9028644	151.1303606	1		re-construct footpath pavement	AF128	Primary	MED	\$ 200
IC227	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9050869	151.137955	1		re-construct footpath pavement	DH84	Primary	MED	\$ 200
IC231	Wardell Road	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9092819	151.143025	1		re-construct footpath pavement	DH126	Primary	MED	\$ 200

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
IC232	Wardell Road	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9094235	151.1428963	1		re-construct footpath pavement	DH126	Primary	MED	\$ 200
IC233	Wardell Road	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9098893	151.1423955	1		re-construct footpath pavement	DH125	Primary	MED	\$ 200
IC234	Wardell Road	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9105386	151.1417466	1		re-construct footpath pavement	DH125	Primary	MED	\$ 200
IC239	Wardell Road	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9124387	151.1394001	1		re-construct footpath pavement	MV237	Primary	MED	\$ 200
IC240	Wardell Road	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9121396	151.1398528	1		re-construct footpath pavement	MV237	Primary	MED	\$ 200
IC259	Parramatta Road	Haberfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8878026	151.1425186	1		re-construct footpath pavement	HA78	Primary	MED	\$ 200
IC267	New Canterbury Road	Hurlstone Park	State Road	Strategic Route	infrastructure condition	damaged refuge island	-33.9051047	151.1322584	1		re-construct refuge island	DH89	Primary	MED	\$ 15,000
IC270	Derbyshire Road	Leichhardt	Local Road		infrastructure condition	uneven pavement surface	-33.8808272	151.1587748	1		re-construct footpath pavement	LH44	Primary	MED	\$ 200
IC271	Derbyshire Road	Leichhardt	Local Road		infrastructure condition	uneven pavement surface	-33.8809306	151.1587343	1		re-construct footpath pavement	LH44	Primary	MED	\$ 200
IC276	Foster Street	Leichhardt	State Road		infrastructure condition	uneven pavement surface	-33.8842799	151.1475356	1		re-construct footpath pavement	LH72	Primary	MED	\$ 200
IC277	Lords Road	Leichhardt	Local Road		infrastructure condition	uneven pavement surface	-33.8858163	151.1494551	1		re-construct footpath pavement	LH89	Primary	MED	\$ 200
IC278	Marion Street	Leichhardt	Regional Road	Strategic Route	infrastructure condition	raised pavement lip	-33.8839503	151.1554788	1		repair pavement panel	LH91	Primary	MED	\$ 200
IC280	Parramatta Road	Leichhardt	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8888542	151.154056	1		re-construct footpath pavement	LH138	Primary	MED	\$ 200
IC282	Parramatta Road	Leichhardt	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8898797	151.1464596	1		re-construct footpath pavement	LH132	Primary	MED	\$ 200
IC283	Parramatta Road	Leichhardt	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8898462	151.1462356	1		re-construct footpath pavement	LH132	Primary	MED	\$ 200
IC284	Renwick Street Link	Leichhardt	Local Road		infrastructure condition	faded traffic control marking	-33.8878692	151.157491	1		repair pavement marking	LH131	Primary	MED	\$ 200
IC289	New Canterbury Road	Lewisham	State Road	Strategic Route	infrastructure condition	damaged tgsi	-33.8980694	151.1466282	1		install new tgsi	LW14	Primary	MED	\$ 650
IC290	Old Canterbury Road	Lewisham	State Road		infrastructure condition	uneven pavement surface	-33.8945476	151.1448492	1		re-construct footpath pavement	LW19	Primary	MED	\$ 200
IC293	Railway Terrace	Lewisham	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8941314	151.1499659	1		re-construct footpath pavement	PE48	Primary	MED	\$ 200
IC294	Thomas Street	Lewisham	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8933358	151.1483693	1		re-construct footpath pavement	LW34	Primary	MED	\$ 200
IC301	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8733004	151.1646229	1		re-construct footpath pavement	LF68	Primary	MED	\$ 200
IC302	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8734394	151.1640736	1		re-construct footpath pavement	LF68	Primary	MED	\$ 200
IC303	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8735773	151.1635252	1		re-construct footpath pavement	LF68	Primary	MED	\$ 200
IC306	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	infrastructure condition	raised pavement lip	-33.873172	151.1543585	1		repair pavement panel	LF63	Primary	MED	\$ 200
IC318	Dudley Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9114339	151.1424863	1		re-construct footpath pavement	MV46	Primary	MED	\$ 200
IC319	Dudley Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9115753	151.1420032	1		re-construct footpath pavement	MV46	Primary	MED	\$ 200
IC320	Edgeware Road	Marrickville	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9052978	151.1733438	1		re-construct footpath pavement	NE24	Primary	MED	\$ 200
IC321	Enmore Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9055718	151.1675762	1		re-construct footpath pavement	MV213	Primary	MED	\$ 200
IC322	Ewart Street	Marrickville	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9125045	151.1405392	1		re-construct footpath pavement	MV66	Primary	MED	\$ 200
IC323	Ewart Street	Marrickville	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9127119	151.1407161	1		re-construct footpath pavement	MV66	Primary	MED	\$ 200
IC326	Ewart Street	Marrickville	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9138299	151.1421265	1		re-construct footpath pavement	MV65	Primary	MED	\$ 200

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
IC327	Ewart Street	Marrickville	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9136603	151.1419392	1		re-construct footpath pavement	MV65	Primary	MED	\$ 200
IC328	Ewart Street	Marrickville	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9132382	151.1414581	1		re-construct footpath pavement	MV67	Primary	MED	\$ 200
IC344	Illawarra Road	Marrickville	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9136035	151.1532659	1		re-construct footpath pavement	MV92	Primary	MED	\$ 200
IC345	Illawarra Road	Marrickville	Regional Road	Strategic Route	infrastructure condition	trip hazard - raised manhole cover	-33.9140791	151.152853	1		repair pit cover	MV92	Primary	MED	\$ 2,000
IC346	Illawarra Road	Marrickville	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9134517	151.1532491	1		re-construct footpath pavement	MV92	Primary	MED	\$ 200
IC347	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9037446	151.1531684	1		re-construct footpath pavement	MV110	Primary	MED	\$ 200
IC348	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9112908	151.1486954	1		re-construct footpath pavement	MV106	Primary	MED	\$ 200
IC349	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9115362	151.148465	1		re-construct footpath pavement	MV122	Primary	MED	\$ 200
IC350	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9123376	151.1475285	1		re-construct footpath pavement	MV116	Primary	MED	\$ 200
IC351	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9131668	151.1467334	1		re-construct footpath pavement	MV117	Primary	MED	\$ 200
IC352	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9135079	151.1464578	1		re-construct footpath pavement	MV117	Primary	MED	\$ 200
IC353	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9136761	151.1465431	1		re-construct footpath pavement	MV117	Primary	MED	\$ 200
IC354	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9132746	151.1468264	1		re-construct footpath pavement	MV117	Primary	MED	\$ 200
IC355	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9128298	151.1472165	1		re-construct footpath pavement	MV116	Primary	MED	\$ 200
IC356	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9124799	151.1476289	1		re-construct footpath pavement	MV116	Primary	MED	\$ 200
IC357	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9117872	151.1483458	1		re-construct footpath pavement	MV122	Primary	MED	\$ 200
IC358	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9115717	151.1485934	1		re-construct footpath pavement	MV122	Primary	MED	\$ 200
IC359	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9107677	151.1499689	1		re-construct footpath pavement	MV121	Primary	MED	\$ 200
IC360	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9106897	151.1501546	1		re-construct footpath pavement	MV121	Primary	MED	\$ 200
IC361	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9097038	151.1517446	1		re-construct footpath pavement	MV119	Primary	MED	\$ 200
IC362	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9092651	151.1519439	1		re-construct footpath pavement	MV118	Primary	MED	\$ 200
IC363	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9089883	151.152164	1		re-construct footpath pavement	MV118	Primary	MED	\$ 200
IC364	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9093247	151.1516667	1		re-construct footpath pavement	MV118	Primary	MED	\$ 200
IC365	Livingstone Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9103123	151.1507966	1		re-construct footpath pavement	MV120	Primary	MED	\$ 200
IC368	Marrickville Road	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.9138866	151.1625149	1		re-construct footpath pavement	MV129	Primary	MED	\$ 200
IC369	Marrickville Road	Marrickville	Regional Road		infrastructure condition	sunk pits	-33.9135631	151.1622846	1		install new utility cover	MV129	Primary	MED	\$ 2,000
IC379	Railway Parade	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9137284	151.166674	1		re-construct footpath pavement	MV165	Primary	MED	\$ 200
IC403	Sydenham Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9128471	151.1664481	1		re-construct footpath pavement	MV203	Primary	MED	\$ 200
IC404	Sydenham Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9128818	151.1664889	1		re-construct footpath pavement	MV203	Primary	MED	\$ 200
IC405	Sydenham Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.913001	151.166661	1		re-construct footpath pavement	MV203	Primary	MED	\$ 200
IC406	Sydenham Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9130771	151.1667663	1		re-construct footpath pavement	MV165	Primary	MED	\$ 200
IC410	Sydenham Road	Marrickville	State Road	Strategic Route	infrastructure condition	damaged pit cover	-33.9096915	151.1623609	1		install new pit cover	MV200	Primary	MED	\$ 250
IC421	Victoria Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9055646	151.1678265	1		re-construct footpath pavement	MV224	Primary	MED	\$ 200
IC425	Victoria Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9112216	151.1611189	1		re-construct footpath pavement	MV212	Primary	MED	\$ 200
IC426	Victoria Road	Marrickville	State Road	Strategic Route	infrastructure condition	sunk pit	-33.9116346	151.1607709	1		install new utility cover	MV220	Primary	MED	\$ 2,000
IC427	Victoria Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9135312	151.1590178	1		re-construct footpath pavement	MV226	Primary	MED	\$ 200
IC428	Victoria Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9133292	151.159181	1		re-construct footpath pavement	MV226	Primary	MED	\$ 200
IC429	Victoria Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9128236	151.1597274	1		re-construct footpath pavement	MV225	Primary	MED	\$ 200
IC430	Victoria Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9131323	151.1595619	1		re-construct footpath pavement	MV225	Primary	MED	\$ 200
IC445	Wardell Road	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.9083283	151.1439526	1		re-construct footpath pavement	MV239	Primary	MED	\$ 200
IC446	Wardell Road	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.9122088	151.1399983	1		re-construct footpath pavement	MV237	Primary	MED	\$ 200
IC447	Wardell Road	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.9125162	151.1394909	1		re-construct footpath pavement	MV237	Primary	MED	\$ 200
IC451	Warren Road	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9152362	151.1492759	1		re-construct footpath pavement	MV242	Primary	MED	\$ 200
IC452	Warren Road	Marrickville	Local Road		infrastructure condition	raised pavement lip	-33.9153165	151.1494146	1		repair pavement panel	MV242	Primary	MED	\$ 200
IC453	Warren Road	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.916256	151.1507764	1		re-construct footpath pavement	MV246	Primary	MED	\$ 200
IC459	Alice Street	Newtown	Regional Road		infrastructure condition	uneven pavement surface	-33.9036308	151.1770628	1		re-construct footpath pavement	NE9	Primary	MED	\$ 200
IC460	Bedford Street	Newtown	Local Road		infrastructure condition	cyclist sign faded and covered with stickers	-33.8974757	151.1780878	1		refer to maintenance	NE15	Primary	MED	\$ -
IC461	Edgeware Road	Newtown	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9046177	151.1732128	1		re-construct footpath pavement	NE23	Primary	MED	\$ 200
IC462	Enmore Road	Newtown	State Road	Strategic Route	infrastructure condition	faded traffic control marking	-33.8988739	151.1735824	1		paint new line marking	NE37	Primary	MED	\$ 200
IC463	Holt Street	Newtown	Local Road		infrastructure condition	uneven pavement surface	-33.9002099	151.1774321	1		re-construct footpath pavement	NE38	Primary	MED	\$ 200
IC467	New Canterbury Road	Petersham	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8967173	151.1522087	1		re-construct footpath pavement	PE34	Primary	MED	\$ 200
IC470	Trafalgar Street	Petersham	Regional Road		infrastructure condition	raised pavement lip	-33.8935197	151.1565337	1		repair pavement panel	PE58	Primary	MED	\$ 200
IC471	Wardell Road	Petersham	Regional Road		infrastructure condition	uneven pavement surface	-33.8971325	151.1494155	1		re-construct footpath pavement	LW38	Primary	MED	\$ 200
IC482	Terry Street	Rozelle	Local Road		infrastructure condition	uneven pavement surface	-33.8591192	151.1707798	1		re-construct footpath pavement	RO69	Primary	MED	\$ 200
IC483	Terry Street	Rozelle	Local Road		infrastructure condition	damaged kerb ramp	-33.8587373	151.1711394	1		install new kerb ramp	RO64	Primary	MED	\$ 2,500
IC484	Terry Street	Rozelle	Local Road		infrastructure condition	uneven pavement surface	-33.8596035	151.1707826	1		re-construct footpath pavement	RO69	Primary	MED	\$ 200
IC486	Victoria Road	Rozelle	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8689979	151.1761831	1		re-construct footpath pavement	RO75	Primary	MED	\$ 200
IC487	Victoria Road	Rozelle	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8672197	151.1753304	1		re-construct footpath pavement	RO70	Primary	MED	\$ 200
IC488	Victoria Road	Rozelle	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8662811	151.1746015	1		re-construct footpath pavement	RO74	Primary	MED	\$ 200
IC497	Princes Highway	St Peters	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9161297	151.1734222	1		re-construct footpath pavement	SP24	Primary	MED	\$ 200
IC498	Princes Highway	St Peters	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9108431	151.1801923	1		re-construct footpath pavement	SP14	Primary	MED	\$ 200
IC499	Princes Highway	St Peters	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9135769	151.1784916	1		re-construct footpath pavement	SP17	Primary	MED	\$ 200
IC500	Princes Highway	St Peters	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9143298	151.1774687	1		re-construct footpath pavement	SP19	Primary	MED	\$ 200
IC501	Princes Highway	St Peters	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9151334	151.1758394	1		re-construct footpath pavement	SP21	Primary	MED	\$ 200
IC502	Princes Highway	St Peters	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9152846	151.1750191	1		re-construct footpath pavement	SP22	Primary	MED	\$ 200
IC503	Princes Highway	St Peters	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.91487	151.1761331	1		re-construct footpath pavement	SP20	Primary	MED	\$ 200
IC504	Audley Street	Stanmore	Local Road		infrastructure condition	uneven pavement surface	-33.8951434	151.1618071	1		re-construct footpath pavement	SM14	Primary	MED	\$ 200
IC521	Smith Street	Summer Hill	Local Road		infrastructure condition	uneven pavement surface	-33.8917203	151.1370414	1		re-construct footpath pavement	SH84	Primary	MED	\$ 200
IC523	Burrows Avenue	Sydenham	Local Road		infrastructure condition	uneven pavement surface	-33.9150469	151.1664715	1		re-construct footpath pavement	SY2	Primary	MED	\$ 200
IC527	Princes Highway	Sydenham	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9186607	151.1698327	1		re-construct footpath pavement	SP27	Primary	MED	\$ 200
IC530	Railway Parade	Sydenham	Local Road		infrastructure condition	uneven pavement surface	-33.9149739	151.1652497	1		re-construct footpath pavement	MV166	Primary	MED	\$ 200
IC535	Princes Highway	Tempe	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9228042	151.1632829	1		re-construct footpath pavement	TE5	Primary	MED	\$ 200
IC537	Princes Highway	Tempe	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.926027	151.1590524	1		re-construct footpath pavement	TE34	Primary	MED	\$ 200
MP1	Bignell Lane	Annandale	Local Road		missing footpath	missing footpath	-33.8863116	151.175572		151	install new footpath	AN93	Secondary	MED	\$ 30,200
MP2	Bignell Lane	Annandale	Local Road		missing footpath	missing footpath	-33.8863784	151.1756015		147	install new footpath	AN93	Secondary	MED	\$ 29,400
MP3	Cohen Park	Annandale	Local Road		missing footpath	missing footpath	-33.8757231	151.1691621		196	install new footpath	AN117	Secondary	MED	\$ 39,200
MP4	Gehrig Lane	Annandale	Local Road		missing footpath	missing footpath	-33.8856904	151.1748096		89	install new footpath	AN29	Secondary	MED	\$ 17,800
MP5	Gehrig Lane	Annandale	Local Road		missing footpath	missing footpath	-33.8856525	151.1747854		89	install new footpath	AN29	Secondary	MED	\$ 17,800
MP6	Hudson Street - Piper S	Annandale	Local Road		missing footpath	missing footpath	-33.8770308	151.1687886		99	install new footpath	AN116	Secondary	MED	\$ 19,800
MP7	Hutchinson Lane	Annandale	Local Road		missing footpath	missing footpath	-33.8759462	151.1698297		185	install new footpath	AN117	Secondary	MED	\$ 37,000
MP8	Hutchinson Lane	Annandale	Local Road		missing footpath	missing footpath	-33.8759885	151.1699182		184	install new footpath	AN120	Secondary	MED	\$ 36,800
MP9	Pritchard Street	Annandale	Local Road		missing footpath	missing footpath	-33.8723122	151.1727658		60	install new footpath	AN18	Secondary	MED	\$ 12,000

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
MP10	Railway Parade	Annandale	Local Road		missing footpath	missing footpath	-33.8720685	151.1725206		75	install new footpath	AN18	Secondary	MED	\$ 15,000
MP12	Palace Street	Ashfield	Local Road	Strategic Route	missing footpath	missing footpath	-33.8949737	151.122167		169	install new footpath	AF139	Secondary	MED	\$ 33,800
MP13	Victoria Street	Ashfield	Local Road		missing footpath	missing footpath	-33.9034414	151.1292409		32	install new footpath	AF164	Secondary	MED	\$ 6,400
MP15	Cardigan Lane	Camperdown	Local Road		missing footpath	missing footpath	-33.8902397	151.1727702		54	install new footpath	CA16	Secondary	MED	\$ 10,800
MP16	Church Street	Croydon	Local Road		missing footpath	missing footpath	-33.8756175	151.1202234		179	install new footpath	CR1	Secondary	MED	\$ 35,800
MP19	Davis Street	Dulwich Hill	Local Road		missing footpath	missing footpath	-33.8993079	151.1406957		34	install new footpath	DH21	Secondary	MED	\$ 6,800
MP20	Hercules Street	Dulwich Hill	Local Road		missing footpath	missing footpath	-33.9090103	151.1384791		79	install new footpath	DH53	Secondary	MED	\$ 15,800
MP21	Darley Road	Leichhardt	State Road		missing footpath	missing footpath	-33.8767593	151.1496435		589	install new footpath	LH40	Secondary	MED	\$ 117,800
MP22	Elswick Street	Leichhardt	Local Road		missing footpath	missing footpath	-33.8776302	151.151857		65	install new footpath	LH173	Secondary	MED	\$ 13,000
MP25	Whites Creek Lane	Leichhardt	Local Road		missing footpath	missing footpath	-33.8858388	151.1643535		101	install new footpath	LH159	Secondary	MED	\$ 20,200
MP26	Whites Creek Lane	Leichhardt	Local Road		missing footpath	missing footpath	-33.8824014	151.1662675		57	install new footpath	LH165	Secondary	MED	\$ 11,400
MP28	Mcgill Street	Lewisham	Local Road		missing footpath	missing footpath	-33.8946672	151.1438832		14	install new footpath	LW20	Secondary	MED	\$ 2,800
MP32	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	missing footpath	missing footpath	-33.8728121	151.1668175		31	install new footpath	LF72	Secondary	MED	\$ 6,200
MP33	Maliyawul Street	Lilyfield	Local Road		missing footpath	missing footpath	-33.8721157	151.1517269		91	install new footpath	LF61	Secondary	MED	\$ 18,200
MP34	Maliyawul Street	Lilyfield	Local Road		missing footpath	missing footpath	-33.872296	151.1519547		44	install new footpath	LF61	Secondary	MED	\$ 8,800
MP35	Maliyawul Street	Lilyfield	Local Road		missing footpath	missing footpath	-33.8712746	151.1518537		112	install new footpath	LF11	Secondary	MED	\$ 22,400
MP36	Maliyawul Street	Lilyfield	Local Road		missing footpath	missing footpath	-33.869276	151.1520443		186	install new footpath	LF25	Secondary	MED	\$ 37,200
MP39	Byrnes Street	Marrickville	Local Road		missing footpath	missing footpath	-33.9137244	151.1554301		3	install new footpath	MV188	Secondary	MED	\$ 600
MP40	Carrington Road	Marrickville	Local Road		missing footpath	missing footpath	-33.9210097	151.1542555		86	install new footpath	MV24	Secondary	MED	\$ 17,200
MP41	Edgeware Road	Marrickville	Regional Road	Strategic Route	missing footpath	missing footpath	-33.9080865	151.1746583		19	install new footpath	MV17	Secondary	MED	\$ 3,800
MP44	Meeks Road	Marrickville	Local Road		missing footpath	missing footpath	-33.9147549	151.1580518		105	install new footpath	MV209	Secondary	MED	\$ 21,000
MP47	Victoria Road	Marrickville	State Road	Strategic Route	missing footpath	missing footpath	-33.914457	151.1570861		92	install new footpath	MV228	Secondary	MED	\$ 18,400
MP49	Pearl Lane	Newtown	Local Road		missing footpath	missing footpath	-33.9051035	151.1777804		183	install new footpath	NE64	Secondary	MED	\$ 36,600
MP53	Albion Lane	St Peters	Local Road		missing footpath	missing footpath	-33.9133603	151.1715372		155	install new footpath	SP38	Secondary	MED	\$ 31,000
MP54	James Street	Summer Hill	Local Road		missing footpath	missing footpath	-33.8973479	151.1357232		8	install new footpath	SH38	Secondary	MED	\$ 1,600
MP55	Smith Street	Summer Hill	Local Road		missing footpath	missing footpath	-33.8926484	151.14328		8	install new footpath	SH89	Secondary	MED	\$ 1,600
NP1	Chester Street	Annandale	Local Road	Strategic Route	narrow footpath	narrow footpath	-33.8843619	151.1736401		53	widen footpath	AN31	Primary	MED	\$ 10,600
NP4	Cavill Avenue	Ashfield	Local Road		narrow footpath	narrow footpath	-33.8871718	151.1222793		60	widen footpath	AF33	Primary	MED	\$ 12,000
NP6	Frederick Street	Ashfield	State Road	Strategic Route	narrow footpath	narrow footpath	-33.8775228	151.1287214		9	widen footpath	AF68	Primary	MED	\$ 1,800
NP9	Booth Street	Balmain	Regional Road	Strategic Route	narrow footpath	narrow footpath	-33.860543	151.1819803		118	widen footpath	BA16	Primary	MED	\$ 23,600
NP11	Eaton Street	Balmain	Local Road		narrow footpath	narrow footpath	-33.8582817	151.1837021		11	widen footpath	BA40	Primary	MED	\$ 2,200
NP13	Jane Street	Balmain	Local Road		narrow footpath	narrow footpath	-33.8590963	151.1843974		167	widen footpath	BA41	Primary	MED	\$ 33,400
NP15	Mullens Street	Balmain	Regional Road		narrow footpath	narrow footpath	-33.8614377	151.1766281		14	widen footpath	BA51	Primary	MED	\$ 2,800
NP20	Constitution Road	Dulwich Hill	Local Road		narrow footpath	narrow footpath	-33.9025293	151.1379518		15	widen footpath	DH58	Primary	MED	\$ 3,000
NP21	Denison Road	Dulwich Hill	Local Road		narrow footpath	narrow footpath	-33.9021713	151.1399527		7	widen footpath	DH23	Primary	MED	\$ 1,400
NP26	Mcgill Street	Lewisham	Local Road		narrow footpath	narrow footpath	-33.8942461	151.1438979		57	widen footpath	LW5	Primary	MED	\$ 11,400
NP44	Bailey Street	Newtown	Local Road		narrow footpath	narrow footpath	-33.8993206	151.1772059		206	widen footpath	NE38	Primary	MED	\$ 41,200
NP45	Bailey Street	Newtown	Local Road		narrow footpath	narrow footpath	-33.8992941	151.177282		207	widen footpath	NE38	Primary	MED	\$ 41,400
NP46	Goddard Street	Newtown	Local Road		narrow footpath	narrow footpath	-33.8992963	151.1775529		47	widen footpath	NE48	Primary	MED	\$ 9,400
NP47	Goddard Street	Newtown	Local Road		narrow footpath	narrow footpath	-33.8993631	151.1775798		46	widen footpath	NE49	Primary	MED	\$ 9,200
NP50	Station Street	Newtown	Local Road		narrow footpath	narrow footpath	-33.8997382	151.1770221		231	widen footpath	NE49	Primary	MED	\$ 46,200
NP51	Station Street	Newtown	Local Road		narrow footpath	narrow footpath	-33.8999159	151.1769988		218	widen footpath	NE49	Primary	MED	\$ 43,600
NP52	Wilford Street	Newtown	Local Road		narrow footpath	narrow footpath	-33.8983662	151.1747612		67	widen footpath	NE36	Primary	MED	\$ 13,400
NP53	Wilford Street	Newtown	Local Road		narrow footpath	narrow footpath	-33.89837	151.174804		66	widen footpath	NE36	Primary	MED	\$ 13,200
NP60	Victoria Road	Rozelle	State Road	Strategic Route	narrow footpath	narrow footpath	-33.8669684	151.1751007		44	widen footpath	RO74	Primary	MED	\$ 8,800
NP62	Edith Street	St Peters	Local Road		narrow footpath	narrow footpath	-33.9146491	151.1755715		14	widen footpath	SP21	Primary	MED	\$ 2,800
NP64	Princes Highway	St Peters	State Road	Strategic Route	narrow footpath	narrow footpath	-33.9145422	151.1768965		17	widen footpath	SP19	Primary	MED	\$ 3,400
NP69	Elizabeth Street	Summer Hill	Regional Road		narrow footpath	narrow footpath	-33.8891786	151.1317644		108	widen footpath	SH45	Primary	MED	\$ 21,600
SUBTOTAL (MED)															\$ 5,586,000

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
AC3	Pritchard Street	Annandale	Local Road		access	stairs only access	-33.8736703	151.1709349	1		install accessible ramp	AN123	Tertiary	LOW	\$ 10,000
AC7	Trafalgar Street	Annandale	Regional Road		access	stairs only access	-33.8768212	151.1745155	1		install accessible ramp	AN102	Tertiary	LOW	\$ 10,000
AC9	Holden Street	Ashfield	Local Road		access	stairs only access	-33.8974571	151.1250892	1		no action	AF83	Tertiary	LOW	\$ -
AC10	Booth Street	Balmain	Regional Road	Strategic Route	access	stairs only access	-33.8608842	151.1819549	1		install accessible ramp	BA54	Tertiary	LOW	\$ 10,000
AC13	Birchgrove Oval	Birchgrove	Local Road		access	stairs only access to wharf	-33.8481242	151.1819533	1		refer to Transport for NSW	BI2	Tertiary	LOW	\$ -
AC24	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	access	stairs only access	-33.8721415	151.1510729	1		no action	LF76	Tertiary	LOW	\$ -
AC26	Mary Street	Lilyfield	Local Road		access	no ramp between different height footpaths	-33.8678781	151.154214	1		install new kerb ramp	LF81	Tertiary	LOW	\$ 2,500
AC29	Premier Street	Marrickville	Local Road		access	stairs only access	-33.9178887	151.1476915	1		install accessible ramp	MV160	Tertiary	LOW	\$ 10,000
AC30	Premier Street	Marrickville	Local Road		access	stairs only access	-33.9181347	151.1480469	1		install accessible ramp	MV160	Tertiary	LOW	\$ 10,000
CN1	Pritchard Street	Annandale	Local Road		connectivity	poor connectivity over bayview cres	-33.8721272	151.1729092	1		install new kerb ramp - pair	AN18	Secondary	LOW	\$ 5,000
CN2	Trafalgar Street	Annandale	Regional Road		connectivity	missing footpath connectivity	-33.8767214	151.1745464	1		install new kerb ramp - pair	AN102	Tertiary	LOW	\$ 5,000
CN3	Whites Creek Lane	Annandale	Local Road		connectivity	potential shared zone	-33.8834922	151.1653928	1		investigate shared zone implementation	LH162	Secondary	LOW	\$ 15,000
CN4	Whites Creek Lane	Annandale	Local Road		connectivity	potential shared zone	-33.8858949	-33.88589493	1		investigate shared zone implementation	CP1	Secondary	LOW	\$ 15,000
CN5	Elizabeth Street	Ashfield	Regional Road		connectivity	missing footpath connectivity	-33.8835975	151.1192154	1		no action	CR20	Secondary	LOW	\$ -
CN6	Beattie Street	Balmain	Local Road		connectivity	missing kerb ramp	-33.8577403	151.1809431	1		install new kerb ramp	BA8	Secondary	LOW	\$ 2,500
CN7	Jane Street	Balmain	Local Road		connectivity	missing footpath connectivity	-33.8585463	151.1844424	1		install new kerb ramp	BA44	Primary	LOW	\$ 2,500
CN8	Thames Street	Balmain	Local Road		connectivity	footpath leads to road and driveway	-33.8550629	151.1858924	1		review and implement shared zone	BA72	Secondary	LOW	\$ 40,000
CN9	Rowntree Street	Birchgrove	Local Road		connectivity	poor kerb ramp alignment	-33.8522701	151.1826497	1		install new kerb ramp - pair	BI17	Tertiary	LOW	\$ 5,000
CN10	Bedford Crescent	Dulwich Hill	Local Road		connectivity	inaccessible link	-33.9100234	151.1399939	1		no action	DH24	Secondary	LOW	\$ -
CN11	Blackwood Lane	Dulwich Hill	Local Road		connectivity	inaccessible link	-33.9073253	151.1403851	1		no action	DH5	Secondary	LOW	\$ -
CN12	Constitution Road	Dulwich Hill	Local Road		connectivity	potential shared zone	-33.9014776	151.1371055	1		investigate shared zone implementation	DH16	Secondary	LOW	\$ 15,000
CN13	Ewart Street	Dulwich Hill	Local Road	Strategic Route	connectivity	inaccessible link	-33.9101526	151.13764	1		no action	DH110	Tertiary	LOW	\$ -
CN14	Hercules Street	Dulwich Hill	Local Road		connectivity	inaccessible link	-33.9086582	151.139152	1		no action	DH53	Secondary	LOW	\$ -
CN15	Old Canterbury Road	Dulwich Hill	State Road		connectivity	inaccessible link	-33.9046832	151.1386824	1		no action	DH84	Primary	LOW	\$ -
CN16	Terry Road	Dulwich Hill	Local Road		connectivity	inaccessible link	-33.8999001	151.1386175	1		no action	DH67	Secondary	LOW	\$ -
CN17	Myrtle Street	Leichhardt	Local Road		connectivity	potential shared zone	-33.8863157	151.1516565	1		investigate shared zone implementation	LH111	Tertiary	LOW	\$ 15,000
CN18	White Creek	Leichhardt	Local Road	Strategic Route	connectivity	missing footpath connectivity	-33.8820677	151.1663125	1		no action	LH165	Secondary	LOW	\$ -
CN19	White Creek	Leichhardt	Local Road	Strategic Route	connectivity	missing footpath connectivity	-33.8867764	151.1632535	1		no action	LH157	Secondary	LOW	\$ -
CN20	Hudson Street	Lewisham	Local Road		connectivity	inaccessible link	-33.8940721	151.1432149	1		no action	LW1	Secondary	LOW	\$ -
CN21	Hudson Street	Lewisham	Local Road		connectivity	potential shared zone	-33.8940512	151.1444476	1		investigate shared zone implementation	LW5	Primary	LOW	\$ 15,000
CN22	Malthouse Way	Lewisham	Local Road		connectivity	inaccessible link	-33.8927457	151.1439815	1		no action	LW2	Secondary	LOW	\$ -
CN23	Frazer Street	Marrickville	Regional Road		connectivity	missing crossing point	-33.9011777	151.1511744	1		install new kerb ramp - pair, new refuge	MV77	Secondary	LOW	\$ 7,000
CN24	Shirlow Street	Marrickville	Local Road		connectivity	missing footpath connectivity	-33.90998	151.1695965	1		further investigation required	MV207	Tertiary	LOW	-
CN25	Victoria Road	Marrickville	State Road	Strategic Route	connectivity	missing crossing point	-33.9055668	151.1695634	1		further investigation required	MV211	Secondary	LOW	-
CN26	Station Street	Newtown	Local Road		connectivity	potential shared zone	-33.9139981	151.1533185	1		investigate shared zone implementation	MV189	Primary	LOW	\$ 15,000
CN27	Mary Street	St Peters	Local Road		connectivity	missing footpath connectivity	-33.9131402	151.1724565	1		re-align kerb and footpath	SP36	Tertiary	LOW	\$ 7,500
CN28	Hardie Avenue	Summer Hill	Local Road		connectivity	potential shared zone	-33.8908943	151.1378901	1		investigate shared zone implementation	SH33	Primary	LOW	\$ 15,000
CN29	Old Canterbury Road	Summer Hill	State Road		connectivity	inaccessible link	-33.8950583	151.1425169	1		no action	SH17	Secondary	LOW	\$ -
CN30	Griffiths Street	Tempe	Local Road		connectivity	path terminates	-33.9252779	151.1563645	1		install new kerb ramp - pair	TE32	Secondary	LOW	\$ 5,000
CN31	View Street	Tempe	Local Road	Strategic Route	connectivity	footpath terminates	-33.9268982	151.1579672	1		install new kerb ramp - pair	TE34	Primary	LOW	\$ 5,000
CD23	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8831403	151.1682163	1		install new kerb ramp	AN34	Tertiary	LOW	\$ 2,500
CD44	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	long crossing	-33.8879611	151.166059	1		install kerb extension - pair	AN17	Tertiary	LOW	\$ 20,000
CD8	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8870366	151.1664736	1		install new kerb ramp	AN17	Tertiary	LOW	\$ 2,500
CD9	Annandale Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8869893	151.1664896	1		install new tgsi	AN17	Tertiary	LOW	\$ 650
CD76	Collins Street	Annandale	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8825049	151.1665866	1		install new kerb ramp	AN33	Tertiary	LOW	\$ 2,500
CD77	Collins Street	Annandale	Local Road		crossing deficiency	misaligned kerb ramp	-33.8827604	151.1671929	1		install new kerb ramp	AN33	Tertiary	LOW	\$ 2,500
CD78	Collins Street	Annandale	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8828949	151.167712	1		install new tgsi	AN34	Tertiary	LOW	\$ 650
CD80	Collins Street	Annandale	Local Road		crossing deficiency	misaligned kerb ramp	-33.8828542	151.1673256	1		install new kerb ramp	AN34	Tertiary	LOW	\$ 2,500
CD81	Collins Street	Annandale	Local Road		crossing deficiency	misaligned kerb ramp	-33.8828107	151.1671212	1		install new kerb ramp	AN33	Tertiary	LOW	\$ 2,500
CD82	Collins Street	Annandale	Local Road		crossing deficiency	misaligned refuge island	-33.8828209	151.167196	1		re-construct refuge island	AN33	Tertiary	LOW	\$ 15,000
CD83	Collins Street	Annandale	Local Road		crossing deficiency	misaligned kerb ramp	-33.8827888	151.1671687	1		install new kerb ramp	AN33	Tertiary	LOW	\$ 2,500
CD112	Nelson Street	Annandale	Local Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.8773406	151.1758148	1		install new tgsi	AN94	Tertiary	LOW	\$ 650
CD113	Nelson Street	Annandale	Local Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8773523	151.1758299	1		install new kerb ramp	AN94	Tertiary	LOW	\$ 2,500
CD114	Nelson Street	Annandale	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8772878	151.1758467	1		install new kerb ramp	AN94	Tertiary	LOW	\$ 2,500
CD131	Piper Street	Annandale	Local Road		crossing deficiency	misaligned kerb ramp	-33.8775757	151.1692265	1		install new kerb ramp	AN88	Tertiary	LOW	\$ 2,500
CD136	Pritchard Street	Annandale	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8736286	151.1708963	1		install new kerb ramp - pair	AN123	Tertiary	LOW	\$ 5,000
CD152	The Crescent	Annandale	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8757108	151.1750053	1		install new kerb ramp	AN102	Tertiary	LOW	\$ 2,500
CD171	Trafalgar Street	Annandale	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.8756705	151.1749326	1		install new kerb ramp	AN102	Tertiary	LOW	\$ 2,500
CD173	Trafalgar Street	Annandale	Regional Road		crossing deficiency	at grade crossing missing tgsi	-33.8768092	151.1745027	1		install new tgsi	AN102	Tertiary	LOW	\$ 650
CD189	Holden Street	Ashbury	Local Road		crossing deficiency	missing crossing point	-33.8974791	151.1249723	1		install new kerb ramp - pair	AF83	Tertiary	LOW	\$ 5,000
CD191	Alt Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8797154	151.1301594	1		install new kerb ramp - pair	AF5	Tertiary	LOW	\$ 5,000
CD192	Alt Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8801552	151.1292509	1		install new kerb ramp - pair	AF4	Tertiary	LOW	\$ 5,000
CD193	Alt Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8804571	151.1285936	1		install new kerb ramp - pair	AF3	Tertiary	LOW	\$ 5,000
CD194	Alt Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8814469	151.126593	1		install new tgsi - pair	AF1	Tertiary	LOW	\$ 1,300
CD195	Alt Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8817167	151.1263376	1		install new tgsi	AF8	Tertiary	LOW	\$ 650
CD196	Alt Street	Ashfield	Local Road		crossing deficiency	misaligned refuge island	-33.8817358	151.1263191	1		re-construct refuge island	AF8	Tertiary	LOW	\$ 15,000
CD202	Alt Street	Ashfield	Local Road		crossing deficiency	missing kerb ramp	-33.8816288	151.1263079	1		install new kerb ramp	AF8	Tertiary	LOW	\$ 2,500
CD203	Alt Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8821966	151.1251941	1		install new kerb ramp - pair	AF8	Tertiary	LOW	\$ 5,000
CD204	Alt Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8816868	151.1263474	1		install new tgsi	AF8	Tertiary	LOW	\$ 650
CD205	Alt Street	Ashfield	Local Road		crossing deficiency	missing kerb ramp - pair	-33.881222	151.1272389	1		install new kerb ramp - pair	AF2	Tertiary	LOW	\$ 5,000
CD206	Alt Street	Ashfield	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8812618	151.1271541	1		install new kerb ramp - pair	AF2	Tertiary	LOW	\$ 5,000
CD208	Armstrong Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8981635	151.1255639	1		install new kerb ramp - pair	AF12	Tertiary	LOW	\$ 5,000
CD209	Armstrong Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8976279	151.1251817	1		install new kerb ramp	AF12	Tertiary	LOW	\$ 2,500
CD210	Armstrong Street	Ashfield	Local Road		crossing deficiency	missing kerb ramp	-33.8975395	151.1251312	1		install new kerb ramp	AF83	Tertiary	LOW	\$ 2,500
CD211	Armstrong Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8996024	151.1265387	1		install new kerb ramp - pair	AF14	Tertiary	LOW	\$ 5,000
CD215	Bland Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.881791	151.1291021	1		install new kerb ramp	AF26	Tertiary	LOW	\$ 2,500
CD216	Bland Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8819422	151.129188	1		install new kerb ramp	AF26	Tertiary	LOW	\$ 2,500
CD217	Bland Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8828713	151.127302	1		install new kerb ramp - pair	AF24	Tertiary	LOW	\$ 5,000
CD218	Bland Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8829421	151.1271566	1		install new kerb ramp - pair	AF20	Tertiary	LOW	\$ 5,000
CD219	Bland Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8828047	151.1272095	1		install new kerb ramp - pair	AF24	Tertiary	LOW	\$ 5,000
CD220	Bland Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8829224	151.1271251	1		install new kerb ramp - pair	AF20	Tertiary	LOW	\$ 5,000
CD228	Church Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8780294	151.1248353	1		install new kerb ramp - pair	AF42	Tertiary	LOW	\$ 5,000

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD229	Church Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8772869	151.1244252	1		install new kerb ramp - pair	AF41	Tertiary	LOW	\$ 5,000
CD230	Church Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8780068	151.1249052	1		install new tgsi - pair	AF42	Tertiary	LOW	\$ 1,300
CD232	Church Street	Ashfield	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8779765	151.1248552	1		install new kerb ramp - pair	AF42	Tertiary	LOW	\$ 5,000
CD233	Church Street	Ashfield	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8780694	151.1249066	1		install new kerb ramp - pair	AF42	Tertiary	LOW	\$ 5,000
CD235	Clissold Street	Ashfield	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8959008	151.1318176	1		install new tgsi - pair	AF46	Tertiary	LOW	\$ 1,300
CD236	Clissold Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8958585	151.1311841	1		install new kerb ramp	AF46	Tertiary	LOW	\$ 2,500
CD299	Hardy Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9015681	151.1263686	1		install new kerb ramp - pair	AF81	Tertiary	LOW	\$ 5,000
CD300	Hardy Street	Ashfield	Local Road		crossing deficiency	misaligned kerb ramp	-33.9028651	151.1256092	1		install new kerb ramp	AF79	Tertiary	LOW	\$ 2,500
CD301	Hardy Street	Ashfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9028797	151.1254489	1		install new kerb ramp	AF79	Tertiary	LOW	\$ 2,500
CD310	Holden Street	Ashfield	Local Road		crossing deficiency	missing crossing point	-33.8974704	151.1251013	1		install new kerb ramp - pair	AF83	Tertiary	LOW	\$ 5,000
CD353	Milton Street	Ashfield	State Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.8943308	151.1182156	1		install new tgsi - pair	AF141	Tertiary	LOW	\$ 1,300
CD358	Milton Street	Ashfield	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8945441	151.1184453	1		install new kerb ramp - pair	AF141	Tertiary	LOW	\$ 5,000
CD434	Beattie Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8588107	151.1755737	1		install new kerb ramp	BA1	Tertiary	LOW	\$ 2,500
CD435	Beattie Street	Balmain	Local Road		crossing deficiency	long crossing point	-33.8587258	151.1755311	1		install kerb extension	BA1	Tertiary	LOW	\$ 10,000
CD436	Beattie Street	Balmain	Local Road		crossing deficiency	missing crossing point	-33.8588041	151.1755887	1		install new kerb ramp - pair	BA1	Tertiary	LOW	\$ 5,000
CD504	Hyam Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8609638	151.1809165	1		install new kerb ramp - pair	BA42	Tertiary	LOW	\$ 5,000
CD505	Hyam Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8609546	151.1807321	1		install new kerb ramp - pair	BA42	Tertiary	LOW	\$ 5,000
CD508	Hyam Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8609852	151.1809676	1		install new kerb ramp - pair	BA42	Tertiary	LOW	\$ 5,000
CD509	Hyam Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8611724	151.1809252	1		install new kerb ramp - pair	BA42	Tertiary	LOW	\$ 5,000
CD531	Palmer Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8607091	151.1812787	1		install new kerb ramp - pair	BA54	Tertiary	LOW	\$ 5,000
CD532	Palmer Street	Balmain	Local Road		crossing deficiency	narrow refuge island	-33.8606868	151.1812045	1		install new refuge island	BA42	Tertiary	LOW	\$ 15,000
CD539	Palmer Street	Balmain	Local Road		crossing deficiency	missing crossing point	-33.8606384	151.1812349	1		install new kerb ramp - pair, new refuge	BA54	Tertiary	LOW	\$ 7,000
CD560	Wortley Street	Balmain	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8601806	151.1794252	1		install new kerb ramp - pair	BA75	Tertiary	LOW	\$ 5,000
CD561	Wortley Street	Balmain	Local Road		crossing deficiency	missing crossing point	-33.8603362	151.1792995	1		install new kerb ramp - pair	BA75	Tertiary	LOW	\$ 5,000
CD562	Wortley Street	Balmain	Local Road		crossing deficiency	missing crossing point	-33.8605271	151.1790147	1		install new kerb ramp - pair	BA75	Tertiary	LOW	\$ 5,000
CD573	Birchgrove Road	Birchgrove	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8522091	151.17985	1		install new kerb ramp	BI3	Tertiary	LOW	\$ 2,500
CD574	Cove Street	Birchgrove	Local Road		crossing deficiency	missing crossing point	-33.8520848	151.1798265	1		install new kerb ramp - pair	BI5	Tertiary	LOW	\$ 5,000
CD575	Cove Street	Birchgrove	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8510623	151.1789265	1		install new kerb ramp - pair	BI10	Tertiary	LOW	\$ 5,000
CD576	Louisa Road	Birchgrove	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8500814	151.1796568	1		install new kerb ramp - pair	BI10	Tertiary	LOW	\$ 5,000
CD580	Rowntree Street	Birchgrove	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8514717	151.1842278	1		install new kerb ramp	BI16	Tertiary	LOW	\$ 2,500
CD581	Rowntree Street	Birchgrove	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8522615	151.1825306	1		install new kerb ramp	BI17	Tertiary	LOW	\$ 2,500
CD582	Rowntree Street	Birchgrove	Local Road		crossing deficiency	missing kerb ramp	-33.8523979	151.1825326	1		install new kerb ramp	BI17	Tertiary	LOW	\$ 2,500
CD589	Rowntree Street	Birchgrove	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8522259	151.1826126	1		install new kerb ramp	BI17	Tertiary	LOW	\$ 2,500
CD597	Kingston Road	Camperdown	Local Road		crossing deficiency	misaligned kerb ramp	-33.8939166	151.1720675	1		install new kerb ramp	CA22	Tertiary	LOW	\$ 2,500
CD598	Kingston Road	Camperdown	Local Road		crossing deficiency	raised kerb ramp lip	-33.893119	151.1723058	1		install new kerb ramp	CA21	Tertiary	LOW	\$ 2,500
CD599	Kingston Road	Camperdown	Local Road		crossing deficiency	misaligned kerb ramp	-33.8925392	151.1724243	1		install new kerb ramp	CA21	Tertiary	LOW	\$ 2,500
CD600	Kingston Road	Camperdown	Local Road		crossing deficiency	misaligned kerb ramp	-33.8925364	151.1723455	1		install new kerb ramp	CA21	Tertiary	LOW	\$ 2,500
CD654	Thomas Street	Croydon	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8854854	151.1161573	1		install new kerb ramp - pair	CR40	Tertiary	LOW	\$ 5,000
CD655	Thomas Street	Croydon	Local Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.8850432	151.1153325	1		install new kerb ramp	CR40	Tertiary	LOW	\$ 2,500
CD660	Georges River Drive	Croydon Park	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8937463	151.1146792	1		install new tgsi	CP4	Tertiary	LOW	\$ 650
CD668	Georges River Drive	Croydon Park	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8937798	151.1145477	1		install new kerb ramp	CP4	Tertiary	LOW	\$ 2,500
CD670	Arlington Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9009433	151.1347144	1		install new kerb ramp	DH13	Tertiary	LOW	\$ 2,500
CD672	Arlington Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9010023	151.1348605	1		install new kerb ramp	DH14	Tertiary	LOW	\$ 2,500
CD673	Arlington Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9010434	151.1348026	1		install new kerb ramp - pair	DH14	Tertiary	LOW	\$ 5,000
CD674	Arlington Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9010508	151.1346985	1		install new kerb ramp	DH13	Tertiary	LOW	\$ 2,500
CD675	Arlington Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.901143	151.1336062	1		install new kerb ramp - pair	DH13	Tertiary	LOW	\$ 5,000
CD676	Arlington Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9011687	151.1335684	1		install new kerb ramp - pair	DH13	Tertiary	LOW	\$ 5,000
CD678	Arlington Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.901092	151.1334915	1		install new kerb ramp - pair	DH13	Tertiary	LOW	\$ 5,000
CD684	Challis Avenue	Dulwich Hill	Local Road		crossing deficiency	missing crossing point	-33.9108461	151.1449974	1		install new kerb ramp - pair	DH7	Tertiary	LOW	\$ 5,000
CD685	Challis Avenue	Dulwich Hill	Local Road		crossing deficiency	missing crossing point	-33.9108113	151.1449033	1		install new kerb ramp - pair	DH7	Tertiary	LOW	\$ 5,000
CD686	Challis Avenue	Dulwich Hill	Local Road		crossing deficiency	missing crossing point	-33.910664	151.1453993	1		install new kerb ramp - pair	DH7	Tertiary	LOW	\$ 5,000
CD708	Frazer Street	Dulwich Hill	Regional Road		crossing deficiency	steep kerb ramp	-33.901102	151.1489532	1		install new kerb ramp - pair	DH119	Tertiary	LOW	\$ 5,000
CD709	Frazer Street	Dulwich Hill	Regional Road		crossing deficiency	poor kerb ramp alignment	-33.9009138	151.1464621	1		install new kerb ramp	DH35	Tertiary	LOW	\$ 2,500
CD710	Frazer Street	Dulwich Hill	Regional Road		crossing deficiency	steep kerb ramp	-33.9007974	151.1463669	1		install new kerb ramp - pair	DH35	Tertiary	LOW	\$ 5,000
CD718	Hercules Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9091027	151.1379476	1		install new kerb ramp - pair	DH111	Tertiary	LOW	\$ 5,000
CD770	Old Canterbury Road	Dulwich Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8981766	151.1349999	1		install new kerb ramp - pair	SH59	Tertiary	LOW	\$ 5,000
CD771	Old Canterbury Road	Dulwich Hill	State Road		crossing deficiency	long crossing	-33.8982064	151.1349459	1		install kerb extension - pair	SH59	Tertiary	LOW	\$ 20,000
CD772	Old Canterbury Road	Dulwich Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8987401	151.1341372	1		install new kerb ramp - pair	SH60	Tertiary	LOW	\$ 5,000
CD787	Terrace Road	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9090327	151.1376563	1		install new kerb ramp - pair	DH111	Tertiary	LOW	\$ 5,000
CD790	Terrace Road	Dulwich Hill	Local Road		crossing deficiency	missing crossing point	-33.9084044	151.1376486	1		install new kerb ramp - pair	DH111	Tertiary	LOW	\$ 5,000
CD797	Wardell Road	Dulwich Hill	Regional Road		crossing deficiency	misaligned refuge island	-33.9029159	151.1487568	1		re-construct refuge island	DH120	Tertiary	LOW	\$ 15,000
CD812	Weston Street	Dulwich Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8970057	151.1416816	1		install new kerb ramp - pair	DH46	Tertiary	LOW	\$ 5,000
CD835	Liberty Street	Enmore	Local Road		crossing deficiency	misaligned kerb ramp	-33.8962532	151.1710091	1		install new kerb ramp	EN11	Tertiary	LOW	\$ 2,500
CD836	Liberty Street	Enmore	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8964878	151.1709254	1		install new kerb ramp - pair	EN11	Tertiary	LOW	\$ 5,000
CD838	Liberty Street	Enmore	Local Road		crossing deficiency	missing refuge island	-33.895593	151.1713498	1		install new refuge island	NE43	Tertiary	LOW	\$ 15,000
CD840	Newington Road	Enmore	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9008681	151.1668623	1		install new tgsi	MV156	Tertiary	LOW	\$ 650
CD847	Alt Street	Haberfield	Local Road		crossing deficiency	misaligned kerb ramp	-33.8778904	151.1340119	1		install new kerb ramp	HA4	Tertiary	LOW	\$ 2,500
CD849	Alt Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8778395	151.133856	1		install new kerb ramp - pair	HA4	Tertiary	LOW	\$ 5,000
CD928	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8861547	151.1434847	1		install new kerb ramp	HA59	Tertiary	LOW	\$ 2,500
CD929	Ramsay Street	Haberfield	Regional Road	Strategic Route	crossing deficiency	poor kerb ramp alignment	-33.8862693	151.1434447	1		install new kerb ramp	HA59	Tertiary	LOW	\$ 2,500
CD938	Waratah Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8735265	151.137471	1		install new kerb ramp - pair	HA109	Tertiary	LOW	\$ 5,000
CD939	Waratah Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.873954	151.1380235	1		install new kerb ramp - pair	HA109	Tertiary	LOW	\$ 5,000
CD940	Waratah Street	Haberfield	Local Road		crossing deficiency	long crossing	-33.8739921	151.1380952	1		install kerb extension - pair	HA109	Tertiary	LOW	\$ 20,000
CD946	Waratah Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8765646	151.1442717	1		install new kerb ramp - pair	HA104	Tertiary	LOW	\$ 5,000
CD947	Waratah Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8773775	151.1468	1		install new kerb ramp	HA102	Tertiary	LOW	\$ 2,500
CD948	Waratah Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8769061	151.1456394	1		install new kerb ramp - pair	HA102	Tertiary	LOW	\$ 5,000
CD949	Waratah Street	Haberfield	Local Road		crossing deficiency	long crossing	-33.8768603	151.1455235	1		install kerb extension - pair	HA103	Tertiary	LOW	\$ 20,000
CD950	Waratah Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8764317	151.1444675	1		install new kerb ramp - pair	HA103	Tertiary	LOW	\$ 5,000
CD951	Waratah Street	Haberfield	Local Road		crossing deficiency	long crossing	-33.8764279	151.1444374	1		install kerb extension - pair	HA104	Tertiary	LOW	\$ 20,000
CD952	Waratah Street	Haberfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8760527	151.1434962	1		install new kerb ramp - pair	HA104	Tertiary	LOW	\$ 5,000
CD1037	Elswick Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8854932	151.1523211	1		install new kerb ramp - pair	LH57	Tertiary	LOW	\$ 5,000
CD1040	Elswick Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8861395	151.1524763	1		install new kerb ramp	LH56	Tertiary	LOW	\$ 2,500

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD1041	Elswick Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8830257	151.1520776	1		install new tgsi	LH45	Tertiary	LOW	\$ 650
CD1042	Elswick Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8822733	151.1520843	1		install new tgsi	LH45	Tertiary	LOW	\$ 650
CD1043	Elswick Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8821203	151.1521062	1		install new tgsi	LH45	Tertiary	LOW	\$ 650
CD1045	Elswick Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8812862	151.1521013	1		install new kerb ramp	LH51	Tertiary	LOW	\$ 2,500
CD1050	Elswick Street	Leichhardt	Local Road		crossing deficiency	steep kerb ramp	-33.8824285	151.1518852	1		install new kerb ramp - pair	LH45	Tertiary	LOW	\$ 5,000
CD1051	Elswick Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8880883	151.152855	1		install new kerb ramp	LH54	Tertiary	LOW	\$ 2,500
CD1052	Elswick Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8869718	151.1525809	1		install new tgsi	LH55	Tertiary	LOW	\$ 650
CD1053	Elswick Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8861658	151.1523894	1		install new tgsi	LH111	Tertiary	LOW	\$ 650
CD1067	Flood Street	Leichhardt	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8893683	151.1492235	1		install new kerb ramp - pair	LH61	Tertiary	LOW	\$ 5,000
CD1068	Flood Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8888766	151.1493156	1		install new kerb ramp	LH61	Tertiary	LOW	\$ 2,500
CD1069	Flood Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8883913	151.1493663	1		install new kerb ramp - pair	LH58	Tertiary	LOW	\$ 5,000
CD1072	Flood Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8784313	151.1501933	1		install new kerb ramp - pair	LH63	Tertiary	LOW	\$ 5,000
CD1075	Flood Street	Leichhardt	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8824107	151.1501202	1		install new tgsi	LH66	Tertiary	LOW	\$ 650
CD1079	Flood Street	Leichhardt	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8784454	151.1500154	1		install new kerb ramp - pair	LH63	Tertiary	LOW	\$ 5,000
CD1080	Flood Street	Leichhardt	Local Road		crossing deficiency	kerb blister obstructs crossing path	-33.878986	151.1500337	1		reconstruct kerb blister	LH63	Tertiary	LOW	\$ 1,500
CD1146	Parramatta Road	Leichhardt	State Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8897481	151.1491686	1		install new kerb ramp - pair	LH61	Tertiary	LOW	\$ 5,000
CD1164	Styles Street	Leichhardt	Regional Road		crossing deficiency	narrow refuge island	-33.8826981	151.16639	1		install new refuge island	AN33	Tertiary	LOW	\$ 15,000
CD1250	Wardell Road	Lewisham	Regional Road		crossing deficiency	at grade crossing missing tgsi	-33.8997338	151.1489983	1		install new tgsi	LW40	Tertiary	LOW	\$ 650
CD1251	Wardell Road	Lewisham	Regional Road		crossing deficiency	narrow kerb ramp	-33.9009199	151.1490068	1		install new kerb ramp	LW41	Tertiary	LOW	\$ 2,500
CD1278	Bay Run	Lilyfield	Local Road		crossing deficiency	missing kerb ramp	-33.8722716	151.1512456	1		install new kerb ramp	LF13	Tertiary	LOW	\$ 2,500
CD1289	Frazer Street	Lilyfield	Local Road		crossing deficiency	missing kerb ramp - pair	-33.8698676	151.152698	1		install new kerb ramp - pair	LF43	Tertiary	LOW	\$ 5,000
CD1293	Glover Street	Lilyfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8679282	151.1556686	1		install new tgsi	LF80	Tertiary	LOW	\$ 650
CD1294	Grove Street	Lilyfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8719963	151.1641949	1		install new tgsi	LF55	Tertiary	LOW	\$ 650
CD1295	Grove Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.872128	151.1642665	1		install new kerb ramp	LF55	Tertiary	LOW	\$ 2,500
CD1297	Grove Street	Lilyfield	Local Road		crossing deficiency	long crossing	-33.872038	151.1644052	1		install kerb extension - pair	LF55	Tertiary	LOW	\$ 20,000
CD1298	Grove Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.871943	151.1644025	1		install new kerb ramp	LF55	Tertiary	LOW	\$ 2,500
CD1299	Grove Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8705243	151.1639383	1		install new kerb ramp	LF56	Tertiary	LOW	\$ 2,500
CD1300	Grove Street	Lilyfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8704259	151.1639111	1		install new tgsi	LF56	Tertiary	LOW	\$ 650
CD1301	Grove Street	Lilyfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8700487	151.1637303	1		install new tgsi	LF56	Tertiary	LOW	\$ 650
CD1331	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	crossing deficiency	missing kerb ramp	-33.8725288	151.1512372	1		install new kerb ramp	LF57	Tertiary	LOW	\$ 2,500
CD1337	Mary Street	Lilyfield	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.86965	151.1543613	1		install new tgsi	LF84	Tertiary	LOW	\$ 650
CD1338	Mary Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8699668	151.1544223	1		install new kerb ramp - pair	LF84	Tertiary	LOW	\$ 5,000
CD1341	Mary Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8708017	151.1545876	1		install new kerb ramp - pair	LF85	Tertiary	LOW	\$ 5,000
CD1342	Mary Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8700363	151.1543435	1		install new kerb ramp - pair	LF84	Tertiary	LOW	\$ 5,000
CD1343	Mary Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8684525	151.1534285	1		install new kerb ramp	LF43	Tertiary	LOW	\$ 2,500
CD1344	Mary Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8679029	151.1539099	1		install new kerb ramp	LF81	Tertiary	LOW	\$ 2,500
CD1345	Mary Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8680038	151.1537639	1		install new kerb ramp	LF81	Tertiary	LOW	\$ 2,500
CD1346	Mary Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8677072	151.1542358	1		install new kerb ramp	LF81	Tertiary	LOW	\$ 2,500
CD1355	Piper Street	Lilyfield	Local Road		crossing deficiency	missing crossing point	-33.8774102	151.1684682	1		install new kerb ramp - pair	LF96	Tertiary	LOW	\$ 5,000
CD1356	Piper Street	Lilyfield	Local Road		crossing deficiency	missing kerb ramp	-33.8773693	151.1682877	1		install new kerb ramp	LF96	Tertiary	LOW	\$ 2,500
CD1357	Piper Street	Lilyfield	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8771041	151.1676105	1		install new kerb ramp - pair	LF96	Tertiary	LOW	\$ 5,000
CD1358	Piper Street	Lilyfield	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.877059	151.1674443	1		install new kerb ramp - pair	LF96	Tertiary	LOW	\$ 5,000
CD1359	Piper Street	Lilyfield	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8770225	151.1672637	1		install new kerb ramp - pair	LF95	Tertiary	LOW	\$ 5,000
CD1360	Piper Street	Lilyfield	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8768195	151.1664687	1		install new kerb ramp - pair	LF95	Tertiary	LOW	\$ 5,000
CD1363	Piper Street	Lilyfield	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8767536	151.1659351	1		install new kerb ramp - pair	LF95	Tertiary	LOW	\$ 5,000
CD1364	Piper Street	Lilyfield	Local Road		crossing deficiency	misaligned kerb ramp	-33.8769491	151.1667589	1		install new kerb ramp	LF95	Tertiary	LOW	\$ 2,500
CD1365	Piper Street	Lilyfield	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8771529	151.1675614	1		install new kerb ramp - pair	LF96	Tertiary	LOW	\$ 5,000
CD1366	Piper Street	Lilyfield	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.8761725	151.163454	1		install new kerb ramp - pair	LF92	Tertiary	LOW	\$ 5,000
CD1367	Piper Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8761684	151.1637353	1		install new kerb ramp - pair	LF92	Tertiary	LOW	\$ 5,000
CD1368	Piper Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8759731	151.1629116	1		install new kerb ramp - pair	LF91	Tertiary	LOW	\$ 5,000
CD1369	Piper Street	Lilyfield	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.875753	151.1619544	1		install new kerb ramp - pair	LF90	Tertiary	LOW	\$ 5,000
CD1386	Albermarle Street	Marrickville	Local Road		crossing deficiency	missing kerb ramp	-33.9112886	151.1450901	1		install new kerb ramp	MV13	Tertiary	LOW	\$ 2,500
CD1387	Albermarle Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9117471	151.1455233	1		install new tgsi - pair	MV13	Tertiary	LOW	\$ 1,300
CD1407	Carrington Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9196799	151.1551632	1		install new kerb ramp - pair	MV169	Tertiary	LOW	\$ 5,000
CD1408	Carrington Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9184314	151.1562082	1		install new kerb ramp - pair	MV28	Tertiary	LOW	\$ 5,000
CD1409	Carrington Road	Marrickville	Local Road		crossing deficiency	misaligned refuge island	-33.919799	151.1551504	1		re-construct refuge island	MV25	Tertiary	LOW	\$ 15,000
CD1413	Carrington Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9198168	151.1552572	1		install new kerb ramp	MV25	Tertiary	LOW	\$ 2,500
CD1414	Carrington Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9190955	151.1558404	1		install new kerb ramp - pair	MV27	Tertiary	LOW	\$ 5,000
CD1415	Carrington Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9167325	151.1577221	1		install new kerb ramp - pair	MV26	Tertiary	LOW	\$ 5,000
CD1416	Carrington Road	Marrickville	Local Road		crossing deficiency	long crossing	-33.9167082	151.1576154	1		install kerb extension - pair	MV26	Tertiary	LOW	\$ 20,000
CD1417	Carrington Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9173162	151.1571957	1		install new kerb ramp - pair	MV23	Tertiary	LOW	\$ 5,000
CD1450	Fitzroy Street	Marrickville	Local Road		crossing deficiency	misaligned kerb ramp	-33.9069982	151.1686947	1		install new kerb ramp	MV70	Tertiary	LOW	\$ 2,500
CD1451	Fitzroy Street	Marrickville	Local Road		crossing deficiency	raised kerb ramp lip	-33.9094233	151.1658453	1		install new kerb ramp	MV69	Tertiary	LOW	\$ 2,500
CD1452	Fitzroy Street	Marrickville	Local Road		crossing deficiency	misaligned kerb ramp	-33.9095437	151.1657588	1		install new kerb ramp	MV69	Tertiary	LOW	\$ 2,500
CD1453	Fitzroy Street	Marrickville	Local Road		crossing deficiency	steep kerb ramp	-33.9085386	151.1666136	1		install new kerb ramp - pair	MV73	Tertiary	LOW	\$ 5,000
CD1454	Fitzroy Street	Marrickville	Local Road		crossing deficiency	misaligned kerb ramp - pair	-33.9085789	151.1665956	1		install new kerb ramp - pair	MV73	Tertiary	LOW	\$ 5,000
CD1455	Fitzroy Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9074714	151.1679343	1		install new tgsi	MV70	Tertiary	LOW	\$ 650
CD1500	Kenwick Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9183972	151.1527198	1		install new kerb ramp	MV167	Tertiary	LOW	\$ 2,500
CD1536	Llewellyn Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.904374	151.1715056	1		install new tgsi - pair	MV125	Tertiary	LOW	\$ 1,300
CD1537	Llewellyn Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9043845	151.1719004	1		install new kerb ramp	MV125	Tertiary	LOW	\$ 2,500
CD1538	Llewellyn Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9043495	151.1719086	1		install new kerb ramp - pair	MV125	Tertiary	LOW	\$ 5,000
CD1539	Llewellyn Street	Marrickville	Local Road		crossing deficiency	misaligned refuge island	-33.9041238	151.1709047	1		re-construct refuge island	MV126	Tertiary	LOW	\$ 15,000
CD1589	Myrtle Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9157554	151.1577527	1		install new kerb ramp - pair	MV147	Tertiary	LOW	\$ 5,000
CD1590	Myrtle Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9151397	151.1563847	1		install new kerb ramp - pair	MV146	Tertiary	LOW	\$ 5,000
CD1591	Myrtle Street	Marrickville	Local Road		crossing deficiency	missing crossing point	-33.9151515	151.1565528	1		install new kerb ramp - pair	MV146	Tertiary	LOW	\$ 5,000
CD1594	Newington Road	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9013452	151.167999	1		install new tgsi	MV157	Tertiary	LOW	\$ 650
CD1595	Newington Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9013176	151.1678175	1		install new kerb ramp	MV157	Tertiary	LOW	\$ 2,500
CD1596	Newington Road	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.90111	151.1674897	1		install new tgsi	MV157	Tertiary	LOW	\$ 650
CD1597	Newington Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9008262	151.1664945	1		install new kerb ramp	MV156	Tertiary	LOW	\$ 2,500
CD1598	Newington Road	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9003907	151.1653812	1		install new kerb ramp	MV155	Tertiary	LOW	\$ 2,500
CD1599	Newington Road	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9000027	151.1646213	1		install new tgsi	MV154	Tertiary	LOW	\$ 650
CD1612	Premier Street	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment	-33.918103	151.1483616	1		install new kerb ramp	MV160	Tertiary	LOW	\$ 2,500

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
CD1613	Premier Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9182662	151.1482508	1		install new tgsi	MV160	Tertiary	LOW	\$ 650
CD1614	Premier Street	Marrickville	Local Road		crossing deficiency	missing kerb ramp	-33.9181747	151.1481186	1		install new kerb ramp	MV160	Tertiary	LOW	\$ 2,500
CD1615	Premier Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9182924	151.1483516	1		install new tgsi	MV160	Tertiary	LOW	\$ 650
CD1616	Premier Street	Marrickville	Local Road		crossing deficiency	missing kerb ramp	-33.9180388	151.1481936	1		install new kerb ramp	MV160	Tertiary	LOW	\$ 2,500
CD1622	Renwick Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9181343	151.1524416	1		install new tgsi - pair	MV167	Tertiary	LOW	\$ 1,300
CD1623	Renwick Street	Marrickville	Local Road		crossing deficiency	misaligned refuge island	-33.9196563	151.1550739	1		re-construct refuge island	MV169	Tertiary	LOW	\$ 15,000
CD1624	Renwick Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9185157	151.1527399	1		install new tgsi - pair	MV167	Tertiary	LOW	\$ 1,300
CD1625	Renwick Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9182611	151.1522937	1		install new tgsi - pair	MV167	Tertiary	LOW	\$ 1,300
CD1629	Richardson Crescent	Marrickville	Local Road		crossing deficiency	missing crossing point	-33.9203128	151.1549383	1		install new kerb ramp - pair	MV173	Tertiary	LOW	\$ 5,000
CD1630	Richardson Crescent	Marrickville	Local Road		crossing deficiency	missing crossing point	-33.9219694	151.1563425	1		install new kerb ramp - pair	MV174	Tertiary	LOW	\$ 5,000
CD1635	Riverside Crescent	Marrickville	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.9140946	151.1392269	1		install new kerb ramp - pair	MV177	Tertiary	LOW	\$ 5,000
CD1636	Riverside Crescent	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9148975	151.1402696	1		install new tgsi	MV180	Tertiary	LOW	\$ 650
CD1637	Shirlow Street	Marrickville	Local Road		crossing deficiency	missing kerb ramp	-33.9112201	151.1678907	1		install new kerb ramp	MV184	Tertiary	LOW	\$ 2,500
CD1638	Shirlow Street	Marrickville	Local Road		crossing deficiency	misaligned kerb ramp	-33.9116102	151.1674021	1		install new kerb ramp	MV183	Tertiary	LOW	\$ 2,500
CD1639	Shirlow Street	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.9116762	151.1673296	1		install new tgsi	MV183	Tertiary	LOW	\$ 650
CD1676	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	at grade crossing missing tgsi	-33.9108561	151.1639941	1		install new tgsi	MV72	Tertiary	LOW	\$ 650
CD1677	Sydenham Road	Marrickville	State Road	Strategic Route	crossing deficiency	misaligned kerb ramp	-33.9109194	151.1641368	1		install new kerb ramp	MV72	Tertiary	LOW	\$ 2,500
CD1696	Wardell Road	Marrickville	Regional Road		crossing deficiency	steep kerb ramp	-33.9018326	151.1490996	1		install new kerb ramp - pair	DH119	Tertiary	LOW	\$ 5,000
CD1697	Wardell Road	Marrickville	Regional Road		crossing deficiency	at grade crossing missing tgsi	-33.9019943	151.1490724	1		install new tgsi	DH118	Tertiary	LOW	\$ 650
CD1698	Wardell Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp	-33.9021604	151.1490234	1		install new kerb ramp	DH118	Tertiary	LOW	\$ 2,500
CD1699	Wardell Road	Marrickville	Regional Road		crossing deficiency	misaligned kerb ramp - pair	-33.9036987	151.1489383	1		install new kerb ramp - pair	DH120	Tertiary	LOW	\$ 5,000
CD1700	Wardell Road	Marrickville	Regional Road		crossing deficiency	misaligned refuge island	-33.9037316	151.1489276	1		re-construct refuge island	DH120	Tertiary	LOW	\$ 15,000
CD1701	Wardell Road	Marrickville	Regional Road		crossing deficiency	steep kerb ramp	-33.9058663	151.1469355	1		install new kerb ramp - pair	MV235	Tertiary	LOW	\$ 5,000
CD1702	Wardell Road	Marrickville	Regional Road		crossing deficiency	steep kerb ramp	-33.9059439	151.1468453	1		install new kerb ramp - pair	MV235	Tertiary	LOW	\$ 5,000
CD1713	Warren Road	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9174853	151.1531599	1		install new tgsi - pair	MV241	Tertiary	LOW	\$ 1,300
CD1714	Warren Road	Marrickville	Local Road		crossing deficiency	misaligned kerb ramp	-33.9189116	151.1557118	1		install new kerb ramp	MV27	Tertiary	LOW	\$ 2,500
CD1715	Warren Road	Marrickville	Local Road		crossing deficiency	at grade crossing missing tgsi - pair	-33.9174959	151.1529033	1		install new tgsi - pair	MV241	Tertiary	LOW	\$ 1,300
CD1774	Kingston Road	Newtown	Local Road		crossing deficiency	misaligned kerb ramp	-33.8944111	151.1719707	1		install new kerb ramp	NE39	Tertiary	LOW	\$ 2,500
CD1799	Brighton Street	Petersham	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8922573	151.1533529	1		install new kerb ramp - pair	PE6	Tertiary	LOW	\$ 5,000
CD1915	Denison Street	Rozelle	Local Road		crossing deficiency	missing crossing point	-33.8687874	151.1693321	1		install new kerb ramp - pair	RO31	Tertiary	LOW	\$ 5,000
CD1916	Denison Street	Rozelle	Local Road		crossing deficiency	missing crossing point	-33.8689973	151.1692637	1		install new kerb ramp - pair	RO31	Tertiary	LOW	\$ 5,000
CD1917	Denison Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8695474	151.1693148	1		install new kerb ramp	RO28	Tertiary	LOW	\$ 2,500
CD1918	Denison Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.86953	151.1694775	1		install new kerb ramp - pair	RO28	Tertiary	LOW	\$ 5,000
CD1919	Denison Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8697248	151.1697073	1		install new kerb ramp	RO28	Tertiary	LOW	\$ 2,500
CD1920	Denison Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8701913	151.1703551	1		install new kerb ramp - pair	RO28	Tertiary	LOW	\$ 5,000
CD1921	Denison Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8700234	151.170037	1		install new kerb ramp - pair	RO28	Tertiary	LOW	\$ 5,000
CD1922	Denison Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8690459	151.1691916	1		install new kerb ramp - pair	RO31	Tertiary	LOW	\$ 5,000
CD1923	Denison Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8684359	151.1691623	1		install new kerb ramp	RO31	Tertiary	LOW	\$ 2,500
CD1927	Denison Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8701206	151.1704198	1		install new kerb ramp	RO28	Tertiary	LOW	\$ 2,500
CD1928	Evans Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8662723	151.1708721	1		install new kerb ramp - pair	RO34	Tertiary	LOW	\$ 5,000
CD1932	Evans Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8666237	151.1700473	1		install new kerb ramp - pair	RO34	Tertiary	LOW	\$ 5,000
CD1933	Evans Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8663446	151.1705387	1		install new kerb ramp - pair	RO34	Tertiary	LOW	\$ 5,000
CD1934	Evans Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8659804	151.1710302	1		install new kerb ramp - pair	RO34	Tertiary	LOW	\$ 5,000
CD1962	Manning Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8627638	151.1645369	1		install new kerb ramp - pair	RO50	Tertiary	LOW	\$ 5,000
CD1963	Manning Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8624622	151.1639035	1		install new kerb ramp	RO50	Tertiary	LOW	\$ 2,500
CD1964	Manning Street	Rozelle	Local Road		crossing deficiency	long crossing	-33.8624288	151.16376	1		install kerb extension	RO50	Tertiary	LOW	\$ 10,000
CD1965	Manning Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8628629	151.1645003	1		install new kerb ramp	RO50	Tertiary	LOW	\$ 2,500
CD1973	Mullens Street	Rozelle	Local Road		crossing deficiency	missing crossing point	-33.8655969	151.1770599	1		install new kerb ramp - pair	RO55	Tertiary	LOW	\$ 5,000
CD1974	Mullens Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8650519	151.176816	1		install new kerb ramp - pair	RO55	Tertiary	LOW	\$ 5,000
CD1978	Robert Street	Rozelle	Local Road		crossing deficiency	missing crossing point	-33.8658928	151.1773004	1		install new kerb ramp - pair	RO58	Tertiary	LOW	\$ 5,000
CD1979	Robert Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8638591	151.1805266	1		install new kerb ramp - pair	RO59	Tertiary	LOW	\$ 5,000
CD1981	Terry Street	Rozelle	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8605587	151.1683047	1		install new kerb ramp	RO62	Tertiary	LOW	\$ 2,500
CD2046	Unwins Bridge Road	St Peters	Local Road		crossing deficiency	poor kerb ramp alignment	-33.9125777	151.1719705	1		install new kerb ramp	SP36	Tertiary	LOW	\$ 2,500
CD2048	Bridge Road	Stanmore	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8894799	151.1711196	1		install new kerb ramp	SM4	Tertiary	LOW	\$ 2,500
CD2049	Bridge Road	Stanmore	Local Road		crossing deficiency	misaligned kerb ramp	-33.8892883	151.171299	1		install new kerb ramp	SM4	Tertiary	LOW	\$ 2,500
CD2050	Bridge Road	Stanmore	Local Road		crossing deficiency	poor kerb ramp alignment	-33.888524	151.1715508	1		install new kerb ramp	SM5	Tertiary	LOW	\$ 2,500
CD2051	Cruikshank Street	Stanmore	Local Road		crossing deficiency	missing crossing point	-33.8894243	151.172532	1		install new kerb ramp - pair	SM7	Tertiary	LOW	\$ 5,000
CD2065	Liberty Street	Stanmore	Local Road		crossing deficiency	missing kerb ramp	-33.8963718	151.1707574	1		install new kerb ramp	EN11	Tertiary	LOW	\$ 2,500
CD2072	Northumberland Avenue	Stanmore	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8915821	151.1680595	1		install new kerb ramp	SM23	Tertiary	LOW	\$ 2,500
CD2073	Northumberland Avenue	Stanmore	Local Road		crossing deficiency	misaligned refuge island	-33.8907381	151.1678759	1		install new refuge island	SM23	Tertiary	LOW	\$ 15,000
CD2074	Northumberland Avenue	Stanmore	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8898788	151.1677768	1		install new kerb ramp	SM24	Tertiary	LOW	\$ 2,500
CD2075	Northumberland Avenue	Stanmore	Local Road		crossing deficiency	poor kerb ramp alignment	-33.8880324	151.1676101	1		install new kerb ramp	SM22	Tertiary	LOW	\$ 2,500
CD2076	Northumberland Avenue	Stanmore	Local Road		crossing deficiency	misaligned kerb ramp	-33.8883353	151.1677715	1		install new kerb ramp	SM22	Tertiary	LOW	\$ 2,500
CD2077	Northumberland Avenue	Stanmore	Local Road		crossing deficiency	misaligned kerb ramp	-33.890599	151.1680798	1		install new kerb ramp	SM24	Tertiary	LOW	\$ 2,500
CD2088	Percival Road	Stanmore	Local Road	Strategic Route	crossing deficiency	narrow refuge island	-33.8889444	151.1649328	1		re-construct refuge island	SM27	Tertiary	LOW	\$ 15,000
CD2090	Percival Road	Stanmore	Local Road	Strategic Route	crossing deficiency	poor kerb ramp alignment - pair	-33.8881955	151.1648754	1		install new kerb ramp - pair	SM27	Tertiary	LOW	\$ 5,000
CD2091	Railway Avenue	Stanmore	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8945052	151.1701202	1		install new tgsi	SM38	Tertiary	LOW	\$ 650
CD2092	Railway Avenue	Stanmore	Local Road		crossing deficiency	at grade crossing missing tgsi	-33.8942352	151.1692305	1		install new tgsi	SM39	Tertiary	LOW	\$ 650
CD2093	Railway Avenue	Stanmore	Local Road		crossing deficiency	misaligned refuge island	-33.8938905	151.1683063	1		re-construct refuge island	SM39	Tertiary	LOW	\$ 15,000
CD2118	Clissold Street	Summer Hill	Local Road		crossing deficiency	misaligned kerb ramp	-33.8959217	151.132282	1		install new kerb ramp	AF46	Tertiary	LOW	\$ 2,500
CD2121	Grosvenor Crescent	Summer Hill	Local Road		crossing deficiency	misaligned refuge island	-33.8913122	151.1423709	1		re-construct refuge island	SH25	Tertiary	LOW	\$ 15,000
CD2129	Hurstone Avenue	Summer Hill	Local Road		crossing deficiency	long crossing point	-33.8988382	151.1337927	1		install kerb extension / refuge island	SH60	Tertiary	LOW	\$ 10,000
CD2154	Old Canterbury Road	Summer Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.898388	151.1344444	1		install new kerb ramp - pair	SH60	Tertiary	LOW	\$ 5,000
CD2155	Old Canterbury Road	Summer Hill	State Road		crossing deficiency	long crossing point	-33.8984547	151.1344202	1		install kerb extension / refuge island	SH60	Tertiary	LOW	\$ 10,000
CD2156	Old Canterbury Road	Summer Hill	State Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8989348	151.1336909	1		install new kerb ramp - pair	SH60	Tertiary	LOW	\$ 5,000
CD2169	Prospect Road	Summer Hill	Local Road		crossing deficiency	poor kerb ramp alignment - pair	-33.8978307	151.1322823	1		install new kerb ramp - pair	SH72	Tertiary	LOW	\$ 5,000
IC3	Hutchinson Street	Annandale	Local Road		infrastructure condition	raised pavement lip	-33.8752965	151.1705237	1		repair pavement panel	AN121	Secondary	LOW	\$ 200
IC4	Nelson Street	Annandale	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8796755	151.1747238	1		re-construct footpath pavement	AN69	Secondary	LOW	\$ 200
IC5	Nelson Street	Annandale	Local Road	Strategic Route	infrastructure condition	raised pavement lip	-33.8771246	151.1760637	1		repair pavement panel	AN66	Secondary	LOW	\$ 200
IC9	Parramatta Road	Annandale	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8878194	151.169057	1		re-construct footpath pavement	AN79	Secondary	LOW	\$ 200
IC14	Pymont Bridge Road	Annandale	Local Road		infrastructure condition	uneven pavement surface	-33.8860743	151.1750668	1		re-construct footpath pavement	AN90	Secondary	LOW	\$ 200
IC15	Pymont Bridge Road	Annandale	Local Road		infrastructure condition	uneven pavement surface	-33.8854704	151.1760297	1		re-construct footpath pavement	AN91	Secondary	LOW	\$ 200

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
IC16	Pymont Bridge Road	Annandale	Local Road		infrastructure condition	uneven pavement surface	-33.8857032	151.1755688	1		re-construct footpath pavement	AN91	Secondary	LOW	\$ 200
IC17	Pymont Bridge Road	Annandale	Local Road		infrastructure condition	uneven pavement surface	-33.885755	151.1754805	1		re-construct footpath pavement	AN91	Secondary	LOW	\$ 200
IC18	Pymont Bridge Road	Annandale	Local Road		infrastructure condition	uneven pavement surface	-33.885862	151.1753377	1		re-construct footpath pavement	AN91	Secondary	LOW	\$ 200
IC19	Pymont Bridge Road	Annandale	Local Road		infrastructure condition	uneven pavement surface	-33.8860019	151.1751233	1		re-construct footpath pavement	AN90	Secondary	LOW	\$ 200
IC20	Pymont Bridge Road	Annandale	Local Road		infrastructure condition	uneven pavement surface	-33.8860712	151.1749595	1		re-construct footpath pavement	AN90	Secondary	LOW	\$ 200
IC22	Trafalgar Street	Annandale	Regional Road		infrastructure condition	raised pavement lip	-33.8843545	151.1711241	1		repair pavement panel	AN109	Secondary	LOW	\$ 200
IC23	Trafalgar Street	Annandale	Regional Road		infrastructure condition	raised pavement lip	-33.8826278	151.1718998	1		repair pavement panel	AN108	Secondary	LOW	\$ 200
IC24	Trafalgar Street	Annandale	Regional Road		infrastructure condition	raised pavement lip	-33.8816205	151.1723152	1		repair pavement panel	AN105	Secondary	LOW	\$ 200
IC25	Trafalgar Street	Annandale	Regional Road		infrastructure condition	uneven pavement surface	-33.881508	151.172252	1		re-construct footpath pavement	AN105	Secondary	LOW	\$ 200
IC26	Trafalgar Street	Annandale	Regional Road		infrastructure condition	raised pavement lip	-33.8807859	151.1726292	1		repair pavement panel	AN106	Secondary	LOW	\$ 200
IC27	Trafalgar Street	Annandale	Regional Road		infrastructure condition	raised pavement lip	-33.8810489	151.17258	1		repair pavement panel	AN105	Secondary	LOW	\$ 200
IC28	Trafalgar Street	Annandale	Regional Road		infrastructure condition	uneven pavement surface	-33.8806376	151.1726121	1		re-construct footpath pavement	AN106	Secondary	LOW	\$ 200
IC29	Trafalgar Street	Annandale	Regional Road		infrastructure condition	raised pavement lip	-33.8803705	151.1728644	1		repair pavement panel	AN106	Secondary	LOW	\$ 200
IC30	Trafalgar Street	Annandale	Regional Road		infrastructure condition	raised pavement lip	-33.8775903	151.1740146	1		repair pavement panel	AN103	Secondary	LOW	\$ 200
IC31	Trafalgar Street	Annandale	Regional Road		infrastructure condition	raised pavement lip	-33.8774884	151.1742195	1		repair pavement panel	AN103	Secondary	LOW	\$ 200
IC32	Trafalgar Street	Annandale	Regional Road		infrastructure condition	raised pavement lip	-33.8759706	151.1747739	1		repair pavement panel	AN102	Tertiary	LOW	\$ 200
IC33	Alt Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8841368	151.1238531	1		re-construct footpath pavement	AF7	Secondary	LOW	\$ 200
IC37	Armstrong Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.8979246	151.1254132	1		repair pavement panel	AF12	Tertiary	LOW	\$ 200
IC38	Armstrong Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8982833	151.1255515	1		re-construct footpath pavement	AF13	Tertiary	LOW	\$ 200
IC39	Armstrong Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8999687	151.1269539	1		re-construct footpath pavement	AF11	Secondary	LOW	\$ 200
IC40	Armstrong Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.8998003	151.1268148	1		repair pavement panel	AF11	Secondary	LOW	\$ 200
IC42	Charlotte Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8834826	151.1275085	1		re-construct footpath pavement	AF36	Tertiary	LOW	\$ 200
IC43	Charlotte Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8831153	151.127265	1		re-construct footpath pavement	AF36	Tertiary	LOW	\$ 200
IC44	Church Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8787282	151.1253107	1		re-construct footpath pavement	AF43	Secondary	LOW	\$ 200
IC45	Church Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.8783408	151.1250375	1		repair pavement panel	AF43	Secondary	LOW	\$ 200
IC46	Church Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.8767704	151.1240709	1		repair pavement panel	AF41	Tertiary	LOW	\$ 200
IC47	Church Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8770698	151.1242973	1		re-construct footpath pavement	AF41	Tertiary	LOW	\$ 200
IC48	Church Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8786582	151.1254368	1		re-construct footpath pavement	AF43	Secondary	LOW	\$ 200
IC49	Church Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8809213	151.1268915	1		re-construct footpath pavement	AF45	Tertiary	LOW	\$ 200
IC50	Clissold Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.8956167	151.1266306	1		repair pavement panel	AF48	Secondary	LOW	\$ 200
IC54	Elizabeth Street	Ashfield	Regional Road		infrastructure condition	uneven pavement surface	-33.8884326	151.1294257	1		re-construct footpath pavement	AF63	Secondary	LOW	\$ 200
IC55	Elizabeth Street	Ashfield	Regional Road		infrastructure condition	uneven pavement surface	-33.8883274	151.1294043	1		re-construct footpath pavement	AF63	Secondary	LOW	\$ 200
IC67	Frederick Street	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8843559	151.1202054	1		re-construct footpath pavement	AF75	Secondary	LOW	\$ 200
IC77	Knox Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8885546	151.1230399	1		re-construct footpath pavement	AF90	Secondary	LOW	\$ 200
IC78	Liverpool Road	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8893942	151.1232364	1		re-construct footpath pavement	SH28	Secondary	LOW	\$ 200
IC79	Milton Street	Ashfield	State Road		infrastructure condition	uneven pavement surface	-33.8948041	151.1191556	1		re-construct footpath pavement	AF141	Tertiary	LOW	\$ 200
IC80	Milton Street	Ashfield	State Road		infrastructure condition	uneven pavement surface	-33.8946503	151.1185818	1		re-construct footpath pavement	AF141	Tertiary	LOW	\$ 200
IC81	Milton Street	Ashfield	State Road		infrastructure condition	uneven pavement surface	-33.8949725	151.1194574	1		re-construct footpath pavement	AF142	Secondary	LOW	\$ 200
IC86	Orpington Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8847147	151.1339844	1		re-construct footpath pavement	AF137	Secondary	LOW	\$ 200
IC87	Palace Street	Ashfield	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8949777	151.1200468	1		re-construct footpath pavement	AF142	Secondary	LOW	\$ 200
IC88	Palace Street	Ashfield	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8951444	151.1229295	1		re-construct footpath pavement	AF139	Secondary	LOW	\$ 200
IC89	Palace Street	Ashfield	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8949107	151.1208217	1		re-construct footpath pavement	AF143	Secondary	LOW	\$ 200
IC90	Palace Street	Ashfield	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8948922	151.1201592	1		re-construct footpath pavement	AF142	Secondary	LOW	\$ 200
IC91	Parramatta Road	Ashfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8801899	151.1317292	1		re-construct footpath pavement	HA69	Secondary	LOW	\$ 200
IC94	Premier Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8949672	151.119758	1		re-construct footpath pavement	AF142	Secondary	LOW	\$ 200
IC95	Queen Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.891575	151.127839	1		re-construct footpath pavement	AF154	Secondary	LOW	\$ 200
IC96	Queen Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8922614	151.1277854	1		re-construct footpath pavement	AF149	Secondary	LOW	\$ 200
IC97	Queen Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8926426	151.1277609	1		re-construct footpath pavement	AF149	Secondary	LOW	\$ 200
IC98	Queen Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8944067	151.1276392	1		re-construct footpath pavement	AF152	Secondary	LOW	\$ 200
IC100	Victoria Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.894903	151.1298394	1		re-construct footpath pavement	AF159	Secondary	LOW	\$ 200
IC101	Victoria Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8978707	151.1295555	1		re-construct footpath pavement	AF166	Secondary	LOW	\$ 200
IC102	Victoria Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.8980171	151.1296019	1		repair pavement panel	AF166	Secondary	LOW	\$ 200
IC103	Victoria Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.8980899	151.1295706	1		repair pavement panel	AF167	Secondary	LOW	\$ 200
IC104	Victoria Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8970687	151.1297559	1		re-construct footpath pavement	AF166	Secondary	LOW	\$ 200
IC105	Victoria Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.8981207	151.1295664	1		repair pavement panel	AF167	Secondary	LOW	\$ 200
IC106	Victoria Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.8983232	151.1295513	1		repair pavement panel	AF167	Secondary	LOW	\$ 200
IC107	Victoria Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.8992546	151.1294514	1		repair pavement panel	AF168	Secondary	LOW	\$ 200
IC108	Victoria Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.8995459	151.1294214	1		repair pavement panel	AF168	Secondary	LOW	\$ 200
IC109	Victoria Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.9000118	151.1294124	1		repair pavement panel	AF168	Secondary	LOW	\$ 200
IC110	Victoria Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.9001944	151.1293817	1		repair pavement panel	AF168	Secondary	LOW	\$ 200
IC111	Victoria Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.9002833	151.1293689	1		re-construct footpath pavement	AF168	Secondary	LOW	\$ 200
IC112	Victoria Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.9003831	151.1293581	1		repair pavement panel	AF169	Secondary	LOW	\$ 200
IC113	Victoria Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.9004907	151.1293505	1		re-construct footpath pavement	AF169	Secondary	LOW	\$ 200
IC114	Victoria Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.9005368	151.1293323	1		repair pavement panel	AF169	Secondary	LOW	\$ 200
IC115	Victoria Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.9016308	151.1294511	1		re-construct footpath pavement	AF170	Secondary	LOW	\$ 200
IC116	Victoria Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.9011782	151.1292935	1		repair pavement panel	AF169	Secondary	LOW	\$ 200
IC117	Victoria Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.9022748	151.1293909	1		repair pavement panel	AF170	Secondary	LOW	\$ 200
IC118	Victoria Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.902211	151.1292004	1		re-construct footpath pavement	AF170	Secondary	LOW	\$ 200
IC119	Victoria Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.9029677	151.1293254	1		re-construct footpath pavement	AF164	Secondary	LOW	\$ 200
IC120	Victoria Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.9024375	151.1292029	1		repair pavement panel	AF170	Secondary	LOW	\$ 200
IC121	Victoria Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.9025993	151.1291884	1		re-construct footpath pavement	AF170	Secondary	LOW	\$ 200
IC122	Victoria Street	Ashfield	Local Road		infrastructure condition	raised pavement lip	-33.9027845	151.129167	1		repair pavement panel	AF164	Secondary	LOW	\$ 200
IC99	Victoria Street	Ashfield	Local Road		infrastructure condition	uneven pavement surface	-33.8950273	151.1299329	1		re-construct footpath pavement	AF159	Secondary	LOW	\$ 200
IC123	Buchanan Street	Balmain	Local Road		infrastructure condition	uneven pavement surface	-33.863147	151.1800973	1		re-construct footpath pavement	BA18	Tertiary	LOW	\$ 200
IC124	Buchanan Street	Balmain	Local Road		infrastructure condition	uneven pavement surface	-33.8625343	151.1803468	1		re-construct footpath pavement	BA18	Tertiary	LOW	\$ 200
IC125	Buchanan Street	Balmain	Local Road		infrastructure condition	uneven pavement surface	-33.862707	151.1802943	1		re-construct footpath pavement	BA18	Tertiary	LOW	\$ 200
IC126	Buchanan Street	Balmain	Local Road		infrastructure condition	raised pavement lip	-33.8628958	151.1801591	1		repair pavement panel	BA18	Tertiary	LOW	\$ 200
IC127	Buchanan Street	Balmain	Local Road		infrastructure condition	uneven pavement surface	-33.8635392	151.1804935	1		re-construct footpath pavement	BA17	Tertiary	LOW	\$ 200
IC128	Hyam Street	Balmain	Local Road		infrastructure condition	uneven pavement surface	-33.8609225	151.180949	1		re-construct footpath pavement	BA42	Tertiary	LOW	\$ 200
IC129	Hyam Street	Balmain	Local Road		infrastructure condition	raised pavement lip	-33.8615746	151.1801387	1		repair pavement panel	BA43	Secondary	LOW	\$ 200
IC130	Hyam Street	Balmain	Local Road		infrastructure condition	raised pavement lip	-33.8608543	151.1811074	1		repair pavement panel	BA42	Tertiary	LOW	\$ 200
IC131	Jane Street	Balmain	Local Road		infrastructure condition	raised pavement lip	-33.8592784	151.1844774	1		repair pavement panel	BA45	Secondary	LOW	\$ 200

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
IC133	Montague Street	Balmain	Local Road		infrastructure condition	uneven pavement surface	-33.8585538	151.1775107	1		re-construct footpath pavement	BA48	Secondary	LOW	\$ 200
IC134	Palmer Street	Balmain	Local Road		infrastructure condition	raised pavement lip	-33.8605936	151.181076	1		repair pavement panel	BA55	Secondary	LOW	\$ 200
IC135	Palmer Street	Balmain	Local Road		infrastructure condition	uneven pavement surface	-33.8589133	151.1804656	1		re-construct footpath pavement	BA57	Secondary	LOW	\$ 200
IC136	Palmer Street	Balmain	Local Road		infrastructure condition	uneven pavement surface	-33.8596016	151.1805693	1		re-construct footpath pavement	BA56	Secondary	LOW	\$ 200
IC137	Palmer Street	Balmain	Local Road		infrastructure condition	uneven pavement surface	-33.8583064	151.180626	1		re-construct footpath pavement	BA58	Secondary	LOW	\$ 200
IC138	Palmer Street	Balmain	Local Road		infrastructure condition	uneven pavement surface	-33.8578826	151.1807532	1		re-construct footpath pavement	BA58	Secondary	LOW	\$ 200
IC140	Thames Street	Balmain	Local Road		infrastructure condition	uneven pavement surface	-33.8566194	151.1837715	1		re-construct footpath pavement	BA70	Secondary	LOW	\$ 200
IC141	Wortley Street	Balmain	Local Road		infrastructure condition	uneven pavement surface	-33.8599257	151.1799438	1		re-construct footpath pavement	BA74	Secondary	LOW	\$ 200
IC142	Wortley Street	Balmain	Local Road		infrastructure condition	uneven pavement surface	-33.8610773	151.178034	1		re-construct footpath pavement	BA59	Secondary	LOW	\$ 200
IC143	Louisa Road	Birchgrove	Local Road		infrastructure condition	uneven pavement surface	-33.8468188	151.1856582	1		re-construct footpath pavement	BI7	Secondary	LOW	\$ 200
IC144	Kingston Road	Camperdown	Local Road		infrastructure condition	raised pavement lip	-33.893262	151.1721259	1		repair pavement panel	CA22	Tertiary	LOW	\$ 200
IC145	Croydon Road	Croydon	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8801025	151.1202023	1		re-construct footpath pavement	CR3	Secondary	LOW	\$ 200
IC146	Parramatta Road	Croydon	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8725361	151.1251551	1		re-construct footpath pavement	CR30	Secondary	LOW	\$ 200
IC147	Parramatta Road	Croydon	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8714607	151.1224725	1		re-construct footpath pavement	CR27	Secondary	LOW	\$ 200
IC148	Blackwood Avenue	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9069151	151.1406953	1		re-construct footpath pavement	DH4	Secondary	LOW	\$ 200
IC149	Blackwood Avenue	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9068811	151.1409137	1		re-construct footpath pavement	DH4	Secondary	LOW	\$ 200
IC150	Challis Avenue	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9102333	151.1447975	1		re-construct footpath pavement	DH8	Secondary	LOW	\$ 200
IC151	Challis Avenue	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9104464	151.1452958	1		re-construct footpath pavement	DH8	Secondary	LOW	\$ 200
IC152	Challis Avenue	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9100652	151.1448434	1		re-construct footpath pavement	DH8	Secondary	LOW	\$ 200
IC153	Consett Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9057947	151.1381054	1		re-construct footpath pavement	DH9	Secondary	LOW	\$ 200
IC154	Consett Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9058834	151.1385151	1		re-construct footpath pavement	DH9	Secondary	LOW	\$ 200
IC155	Constitution Road	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9036916	151.1407753	1		re-construct footpath pavement	DH18	Secondary	LOW	\$ 200
IC156	Constitution Road	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9013555	151.1369387	1		re-construct footpath pavement	DH15	Secondary	LOW	\$ 200
IC160	Ewart Street	Dulwich Hill	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9096827	151.1366202	1		re-construct footpath pavement	DH33	Secondary	LOW	\$ 200
IC161	Ewart Street	Dulwich Hill	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9096065	151.1367717	1		re-construct footpath pavement	DH32	Secondary	LOW	\$ 200
IC162	Ewart Street	Dulwich Hill	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9096165	151.1372391	1		re-construct footpath pavement	DH32	Secondary	LOW	\$ 200
IC163	Ewart Street	Dulwich Hill	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9096596	151.1373963	1		re-construct footpath pavement	DH32	Secondary	LOW	\$ 200
IC164	Ewart Street	Dulwich Hill	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9097329	151.1375153	1		re-construct footpath pavement	DH32	Secondary	LOW	\$ 200
IC165	Ewart Street	Dulwich Hill	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9098597	151.1373969	1		re-construct footpath pavement	DH32	Secondary	LOW	\$ 200
IC166	Ewart Street	Dulwich Hill	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9096702	151.1370504	1		re-construct footpath pavement	DH32	Secondary	LOW	\$ 200
IC167	Ewart Street	Dulwich Hill	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9097965	151.1361922	1		re-construct footpath pavement	DH33	Secondary	LOW	\$ 200
IC168	Ewart Street	Dulwich Hill	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9098232	151.1357013	1		re-construct footpath pavement	DH28	Secondary	LOW	\$ 200
IC169	Ewart Street	Dulwich Hill	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9099029	151.1355198	1		re-construct footpath pavement	DH28	Secondary	LOW	\$ 200
IC170	Ewart Street	Dulwich Hill	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9114052	151.1394785	1		re-construct footpath pavement	DH30	Secondary	LOW	\$ 200
IC171	Ewart Street	Dulwich Hill	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9114224	151.1357313	1		re-construct footpath pavement	DH30	Secondary	LOW	\$ 200
IC173	Frazer Street	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.901011	151.1475578	1		re-construct footpath pavement	DH36	Tertiary	LOW	\$ 200
IC174	Frazer Street	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9009277	151.1467837	1		re-construct footpath pavement	DH35	Tertiary	LOW	\$ 200
IC175	Frazer Street	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9009152	151.1461853	1		re-construct footpath pavement	DH35	Tertiary	LOW	\$ 200
IC176	Frazer Street	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9008778	151.1458037	1		re-construct footpath pavement	DH34	Secondary	LOW	\$ 200
IC177	Hampstead Road	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.8981948	151.1376495	1		re-construct footpath pavement	DH63	Secondary	LOW	\$ 200
IC178	Hampstead Road	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.8982851	151.137756	1		re-construct footpath pavement	DH63	Secondary	LOW	\$ 200
IC179	Hampstead Road	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.897286	151.1367351	1		re-construct footpath pavement	DH62	Secondary	LOW	\$ 200
IC180	Hampstead Road	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.8978891	151.1372977	1		re-construct footpath pavement	DH62	Secondary	LOW	\$ 200
IC181	Hercules Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9051196	151.1398866	1		re-construct footpath pavement	DH64	Secondary	LOW	\$ 200
IC182	Hercules Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9066675	151.1390179	1		re-construct footpath pavement	DH65	Secondary	LOW	\$ 200
IC183	Hercules Street	Dulwich Hill	Local Road		infrastructure condition	raised pavement lip	-33.9070268	151.1389877	1		repair pavement panel	DH65	Secondary	LOW	\$ 200
IC184	Hercules Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9086398	151.1388147	1		re-construct footpath pavement	DH53	Secondary	LOW	\$ 200
IC185	Hill Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9008813	151.1392981	1		re-construct footpath pavement	DH68	Secondary	LOW	\$ 200
IC186	Hill Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9006762	151.1389471	1		re-construct footpath pavement	DH68	Secondary	LOW	\$ 200
IC187	Hill Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.900527	151.1390441	1		re-construct footpath pavement	DH68	Secondary	LOW	\$ 200
IC188	Hill Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9008007	151.1393791	1		re-construct footpath pavement	DH68	Secondary	LOW	\$ 200
IC189	Hill Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9009962	151.1397555	1		re-construct footpath pavement	DH68	Secondary	LOW	\$ 200
IC190	Marrickville Road	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9059521	151.1453269	1		install new utility cover	DH77	Secondary	LOW	\$ 2,000
IC193	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	infrastructure condition	poorly defined kerb ramp	-33.904981	151.1317792	1		install new kerb ramp	DH90	Secondary	LOW	\$ 2,500
IC198	Piggott Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9009605	151.1415375	1		re-construct footpath pavement	DH104	Secondary	LOW	\$ 200
IC199	Piggott Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9010545	151.1415344	1		re-construct footpath pavement	DH104	Secondary	LOW	\$ 200
IC200	Piggott Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9013372	151.1420659	1		re-construct footpath pavement	DH104	Secondary	LOW	\$ 200
IC201	Piggott Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9018828	151.1430209	1		re-construct footpath pavement	DH101	Secondary	LOW	\$ 200
IC202	Piggott Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9021336	151.1433971	1		re-construct footpath pavement	DH105	Secondary	LOW	\$ 200
IC203	Piggott Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9024137	151.1438605	1		re-construct footpath pavement	DH105	Secondary	LOW	\$ 200
IC204	Piggott Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9021463	151.1435263	1		re-construct footpath pavement	DH105	Secondary	LOW	\$ 200
IC205	Piggott Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9018461	151.1430344	1		re-construct footpath pavement	DH101	Secondary	LOW	\$ 200
IC206	Piggott Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9017362	151.142851	1		re-construct footpath pavement	DH101	Secondary	LOW	\$ 200
IC207	Piggott Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9015713	151.1424993	1		re-construct footpath pavement	DH101	Secondary	LOW	\$ 200
IC208	Piggott Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9010697	151.1417219	1		re-construct footpath pavement	DH104	Secondary	LOW	\$ 200
IC209	Piggott Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9006443	151.140782	1		re-construct footpath pavement	DH103	Secondary	LOW	\$ 200
IC210	Riverside Crescent	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9119893	151.1385154	1		re-construct footpath pavement	MV236	Secondary	LOW	\$ 200
IC211	Tennyson Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9110687	151.1367772	1		re-construct footpath pavement	DH38	Secondary	LOW	\$ 200
IC212	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9088067	151.1376842	1		re-construct footpath pavement	DH111	Tertiary	LOW	\$ 200
IC213	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9094096	151.1380314	1		re-construct footpath pavement	DH52	Secondary	LOW	\$ 200
IC214	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.909504	151.1379621	1		re-construct footpath pavement	DH39	Secondary	LOW	\$ 200
IC215	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	raised pavement lip	-33.9070782	151.1378721	1		repair pavement panel	DH114	Secondary	LOW	\$ 200
IC216	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	raised pavement lip	-33.9080363	151.1376502	1		repair pavement panel	DH113	Tertiary	LOW	\$ 200
IC217	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	raised pavement lip	-33.9075569	151.1378123	1		repair pavement panel	DH113	Tertiary	LOW	\$ 200
IC218	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	raised pavement lip	-33.9083716	151.1375631	1		repair pavement panel	DH111	Tertiary	LOW	\$ 200
IC219	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	raised pavement lip	-33.9064276	151.1379839	1		repair pavement panel	DH114	Secondary	LOW	\$ 200
IC220	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	raised pavement lip	-33.906169	151.1379819	1		repair pavement panel	DH114	Secondary	LOW	\$ 200
IC221	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	raised pavement lip	-33.9060357	151.1380179	1		repair pavement panel	DH112	Secondary	LOW	\$ 200
IC222	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9053817	151.1379483	1		re-construct footpath pavement	DH112	Secondary	LOW	\$ 200
IC223	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9057665	151.1380389	1		re-construct footpath pavement	DH112	Secondary	LOW	\$ 200
IC224	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	raised pavement lip	-33.9056207	151.1380983	1		repair pavement panel	DH9	Secondary	LOW	\$ 200
IC225	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.905525	151.1380796	1		re-construct footpath pavement	DH112	Secondary	LOW	\$ 200

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
IC226	Terrace Road	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.9051628	151.137979	1		re-construct footpath pavement	DH112	Secondary	LOW	\$ 200
IC228	Wardell Road	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9064773	151.1459028	1		re-construct footpath pavement	DH121	Secondary	LOW	\$ 200
IC229	Wardell Road	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9050263	151.1475316	1		re-construct footpath pavement	DH123	Tertiary	LOW	\$ 200
IC230	Wardell Road	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9042286	151.1482663	1		re-construct footpath pavement	MV234	Secondary	LOW	\$ 200
IC235	Wardell Road	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9133638	151.1375842	1		re-construct footpath pavement	DH106	Tertiary	LOW	\$ 200
IC236	Wardell Road	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9132657	151.1374637	1		re-construct footpath pavement	DH106	Tertiary	LOW	\$ 200
IC237	Wardell Road	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9126572	151.1389467	1		re-construct footpath pavement	MV236	Secondary	LOW	\$ 200
IC238	Wardell Road	Dulwich Hill	Regional Road		infrastructure condition	uneven pavement surface	-33.9125462	151.1391995	1		re-construct footpath pavement	MV236	Secondary	LOW	\$ 200
IC241	Weston Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.8985692	151.1396979	1		re-construct footpath pavement	DH117	Secondary	LOW	\$ 200
IC242	Weston Street	Dulwich Hill	Local Road		infrastructure condition	uneven pavement surface	-33.8985684	151.1399126	1		re-construct footpath pavement	DH117	Secondary	LOW	\$ 200
IC243	Alt Street	Haberfield	Local Road		infrastructure condition	uneven pavement surface	-33.8782472	151.1330467	1		re-construct footpath pavement	HA3	Tertiary	LOW	\$ 200
IC244	Alt Street	Haberfield	Local Road		infrastructure condition	uneven pavement surface	-33.8786851	151.1321131	1		re-construct footpath pavement	HA2	Secondary	LOW	\$ 200
IC245	Bay Run	Haberfield	Local Road		infrastructure condition	uneven pavement surface	-33.8715927	151.1493492	1		re-construct footpath pavement	HA10	Secondary	LOW	\$ 200
IC246	Bay Run	Haberfield	Local Road		infrastructure condition	uneven pavement surface	-33.8719195	151.1497014	1		re-construct footpath pavement	HA10	Secondary	LOW	\$ 200
IC247	Bland Street	Haberfield	Local Road		infrastructure condition	uneven pavement surface	-33.8794642	151.1333657	1		re-construct footpath pavement	HA19	Secondary	LOW	\$ 200
IC248	Boomerang Street	Haberfield	Local Road		infrastructure condition	raised pavement lip	-33.870762	151.1452272	1		repair pavement panel	HA22	Secondary	LOW	\$ 200
IC249	Boomerang Street	Haberfield	Local Road		infrastructure condition	raised pavement lip	-33.8714933	151.144638	1		repair pavement panel	HA23	Secondary	LOW	\$ 200
IC250	Boomerang Street	Haberfield	Local Road		infrastructure condition	raised pavement lip	-33.8741475	151.1428386	1		repair pavement panel	HA27	Secondary	LOW	\$ 200
IC251	Dalhousie Street	Haberfield	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8829792	151.1368833	1		re-construct footpath pavement	HA39	Secondary	LOW	\$ 200
IC252	Denman Avenue	Haberfield	Local Road		infrastructure condition	raised pavement lip	-33.8794823	151.1352206	1		repair pavement panel	HA40	Secondary	LOW	\$ 200
IC253	Denman Avenue	Haberfield	Local Road		infrastructure condition	uneven pavement surface	-33.8802661	151.1354573	1		re-construct footpath pavement	HA43	Secondary	LOW	\$ 200
IC254	Denman Avenue	Haberfield	Local Road		infrastructure condition	raised pavement lip	-33.8802731	151.1355432	1		repair pavement panel	HA43	Secondary	LOW	\$ 200
IC255	Denman Avenue	Haberfield	Local Road		infrastructure condition	uneven pavement surface	-33.8803522	151.1356301	1		re-construct footpath pavement	HA43	Secondary	LOW	\$ 200
IC256	Denman Avenue	Haberfield	Local Road		infrastructure condition	raised pavement lip	-33.8816587	151.1368357	1		repair pavement panel	HA41	Secondary	LOW	\$ 200
IC257	Denman Avenue	Haberfield	Local Road		infrastructure condition	uneven pavement surface	-33.8816892	151.1368456	1		re-construct footpath pavement	HA41	Secondary	LOW	\$ 200
IC258	Denman Avenue	Haberfield	Local Road		infrastructure condition	uneven pavement surface	-33.881729	151.1371173	1		re-construct footpath pavement	HA41	Secondary	LOW	\$ 200
IC260	Paramatta Road	Haberfield	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.874501	151.1280044	1		re-construct footpath pavement	HA80	Secondary	LOW	\$ 200
IC261	Ramsay Street	Haberfield	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.884942	151.1425947	1		re-construct footpath pavement	HA91	Secondary	LOW	\$ 200
IC262	Ramsay Street	Haberfield	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.874588	151.1342239	1		re-construct footpath pavement	HA97	Secondary	LOW	\$ 200
IC263	Waratah Street	Haberfield	Local Road		infrastructure condition	uneven pavement surface	-33.8771329	151.1457118	1		re-construct footpath pavement	HA102	Tertiary	LOW	\$ 200
IC264	Waratah Street	Haberfield	Local Road		infrastructure condition	uneven pavement surface	-33.8772895	151.1461004	1		re-construct footpath pavement	HA102	Tertiary	LOW	\$ 200
IC265	Hardy Street	Hurlstone Park	Local Road		infrastructure condition	raised pavement lip	-33.906386	151.1236182	1		repair pavement panel	HP2	Secondary	LOW	\$ 200
IC266	Hardy Street	Hurlstone Park	Local Road		infrastructure condition	raised pavement lip	-33.9041001	151.1249829	1		repair pavement panel	HP1	Secondary	LOW	\$ 200
IC268	Darley Road	Leichhardt	State Road		infrastructure condition	raised pavement lip	-33.8776393	151.1487955	1		repair pavement panel	LH38	Secondary	LOW	\$ 200
IC269	Darley Road	Leichhardt	State Road		infrastructure condition	uneven pavement surface	-33.8803094	151.1477577	1		re-construct footpath pavement	LH2	Secondary	LOW	\$ 200
IC272	Flood Street	Leichhardt	Local Road		infrastructure condition	uneven pavement surface	-33.8779883	151.1501991	1		re-construct footpath pavement	LH63	Tertiary	LOW	\$ 200
IC273	Flood Street	Leichhardt	Local Road		infrastructure condition	raised pavement lip	-33.8783095	151.1501835	1		repair pavement panel	LH63	Tertiary	LOW	\$ 200
IC274	Flood Street	Leichhardt	Local Road		infrastructure condition	uneven pavement surface	-33.8792073	151.1501651	1		re-construct footpath pavement	LH64	Secondary	LOW	\$ 200
IC275	Flood Street	Leichhardt	Local Road		infrastructure condition	raised pavement lip	-33.8848943	151.1500486	1		repair pavement panel	LH62	Secondary	LOW	\$ 200
IC279	Marion Street	Leichhardt	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8841972	151.1515545	1		re-construct footpath pavement	LH97	Secondary	LOW	\$ 200
IC281	Parramatta Road	Leichhardt	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.889997	151.1483119	1		re-construct footpath pavement	LH134	Secondary	LOW	\$ 200
IC285	Tebutt Street	Leichhardt	Local Road		infrastructure condition	uneven pavement surface	-33.8886683	151.1469807	1		re-construct footpath pavement	LH155	Secondary	LOW	\$ 200
IC286	William Street	Leichhardt	Local Road		infrastructure condition	uneven pavement surface	-33.8776416	151.1526634	1		re-construct footpath pavement	LH174	Secondary	LOW	\$ 200
IC287	William Street	Leichhardt	Local Road		infrastructure condition	raised pavement lip	-33.8774666	151.1539935	1		repair pavement panel	LH168	Secondary	LOW	\$ 200
IC288	William Street	Leichhardt	Local Road		infrastructure condition	raised pavement lip	-33.8775334	151.1543474	1		repair pavement panel	LH168	Secondary	LOW	\$ 200
IC291	Old Canterbury Road	Lewisham	State Road		infrastructure condition	uneven pavement surface	-33.8951649	151.1434909	1		re-construct footpath pavement	LW20	Secondary	LOW	\$ 200
IC292	Parramatta Road	Lewisham	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8899532	151.1489126	1		re-construct footpath pavement	LH134	Secondary	LOW	\$ 200
IC295	Bay Run	Lilyfield	Local Road		infrastructure condition	uneven pavement surface	-33.8721091	151.1515124	1		re-construct footpath pavement	LF12	Secondary	LOW	\$ 200
IC296	Bay Run	Lilyfield	Local Road		infrastructure condition	uneven pavement surface	-33.8678212	151.1520794	1		re-construct footpath pavement	LF25	Secondary	LOW	\$ 200
IC297	Bay Run	Lilyfield	Local Road		infrastructure condition	uneven pavement surface	-33.8671195	151.1526177	1		re-construct footpath pavement	LF24	Secondary	LOW	\$ 200
IC298	Bay Run	Lilyfield	Local Road		infrastructure condition	uneven pavement surface	-33.8660175	151.1554782	1		re-construct footpath pavement	LF20	Secondary	LOW	\$ 200
IC299	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8716781	151.169116	1		re-construct footpath pavement	LF75	Secondary	LOW	\$ 200
IC300	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8729544	151.1655813	1		re-construct footpath pavement	LF71	Secondary	LOW	\$ 200
IC304	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8742942	151.1607585	1		re-construct footpath pavement	LF69	Secondary	LOW	\$ 200
IC305	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8743582	151.1597997	1		re-construct footpath pavement	LF64	Secondary	LOW	\$ 200
IC307	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	infrastructure condition	raised pavement lip	-33.8739504	151.1571366	1		repair pavement panel	LF66	Secondary	LOW	\$ 200
IC308	Mary Street	Lilyfield	Local Road		infrastructure condition	uneven pavement surface	-33.8679112	151.1540674	1		re-construct footpath pavement	LF81	Tertiary	LOW	\$ 200
IC309	Beauchamp Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9141362	151.1439377	1		re-construct footpath pavement	MV16	Secondary	LOW	\$ 200
IC310	Beauchamp Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9143197	151.1435343	1		re-construct footpath pavement	MV16	Secondary	LOW	\$ 200
IC311	Beauchamp Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9143468	151.1437748	1		re-construct footpath pavement	MV16	Secondary	LOW	\$ 200
IC312	Beauchamp Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9141696	151.1443682	1		re-construct footpath pavement	MV15	Secondary	LOW	\$ 200
IC313	Byrnes Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9137794	151.1554623	1		re-construct footpath pavement	MV188	Secondary	LOW	\$ 200
IC314	Calvert Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9117883	151.1555663	1		re-construct footpath pavement	MV20	Secondary	LOW	\$ 200
IC315	Carrington Road	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9185441	151.1561917	1		re-construct footpath pavement	MV27	Tertiary	LOW	\$ 200
IC316	Carrington Road	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9181458	151.1565802	1		re-construct footpath pavement	MV28	Tertiary	LOW	\$ 200
IC317	Carrington Road	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9175742	151.1570042	1		re-construct footpath pavement	MV23	Tertiary	LOW	\$ 200
IC324	Ewart Street	Marrickville	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9143659	151.1427198	1		re-construct footpath pavement	MV68	Secondary	LOW	\$ 200
IC325	Ewart Street	Marrickville	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9142254	151.1425955	1		re-construct footpath pavement	MV68	Secondary	LOW	\$ 200
IC329	Fitzroy Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9075272	151.1680864	1		re-construct footpath pavement	MV70	Tertiary	LOW	\$ 200
IC330	Fitzroy Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9075723	151.1680395	1		re-construct footpath pavement	MV70	Tertiary	LOW	\$ 200
IC331	Fitzroy Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9077012	151.16789	1		re-construct footpath pavement	MV71	Tertiary	LOW	\$ 200
IC332	Fitzroy Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9081565	151.1673563	1		re-construct footpath pavement	MV71	Tertiary	LOW	\$ 200
IC333	Fitzroy Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9110452	151.164243	1		re-construct footpath pavement	MV202	Secondary	LOW	\$ 200
IC334	Fitzroy Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9078597	151.1674559	1		re-construct footpath pavement	MV71	Tertiary	LOW	\$ 200
IC335	Fitzroy Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9071638	151.1682868	1		re-construct footpath pavement	MV70	Tertiary	LOW	\$ 200
IC336	Frazer Street	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.901273	151.1523075	1		re-construct footpath pavement	MV75	Secondary	LOW	\$ 200
IC337	Frazer Street	Marrickville	Regional Road		infrastructure condition	damaged kerb ramp	-33.9011889	151.1507021	1		install new kerb ramp	MV76	Secondary	LOW	\$ 2,500
IC338	Frazer Street	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.9011475	151.1525575	1		re-construct footpath pavement	MV75	Secondary	LOW	\$ 200
IC339	Illawarra Road	Marrickville	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9092214	151.1575734	1		re-construct footpath pavement	MV81	Secondary	LOW	\$ 200
IC340	Illawarra Road	Marrickville	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9090916	151.1578207	1		re-construct footpath pavement	MV81	Secondary	LOW	\$ 200
IC341	Illawarra Road	Marrickville	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9182121	151.1468275	1		re-construct footpath pavement	MV100	Secondary	LOW	\$ 200
IC342	Illawarra Road	Marrickville	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9208336	151.1440597	1		re-construct footpath pavement	MV80	Secondary	LOW	\$ 200

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
IC343	Illawarra Road	Marrickville	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9206573	151.1442342	1		re-construct footpath pavement	MV80	Secondary	LOW	\$ 200
IC366	Llewellyn Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9040713	151.1711219	1		re-construct footpath pavement	MV125	Tertiary	LOW	\$ 200
IC367	Llewellyn Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9040267	151.1710148	1		re-construct footpath pavement	MV126	Tertiary	LOW	\$ 200
IC370	Myrtle Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.915458	151.157292	1		re-construct footpath pavement	MV146	Tertiary	LOW	\$ 200
IC371	Premier Street	Marrickville	Local Road		infrastructure condition	raised pavement lip	-33.9207368	151.1530429	1		repair pavement panel	MV159	Secondary	LOW	\$ 200
IC372	Premier Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9205439	151.1526791	1		re-construct footpath pavement	MV161	Secondary	LOW	\$ 200
IC373	Premier Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9199454	151.1516055	1		re-construct footpath pavement	MV162	Secondary	LOW	\$ 200
IC374	Premier Street	Marrickville	Local Road		infrastructure condition	raised pavement lip	-33.9194252	151.1506479	1		repair pavement panel	MV163	Secondary	LOW	\$ 200
IC375	Premier Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9188394	151.1496238	1		re-construct footpath pavement	MV158	Tertiary	LOW	\$ 200
IC376	Premier Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9186157	151.1489051	1		re-construct footpath pavement	MV158	Tertiary	LOW	\$ 200
IC377	Premier Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9186435	151.149271	1		re-construct footpath pavement	MV158	Tertiary	LOW	\$ 200
IC378	Premier Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9184144	151.14852	1		re-construct footpath pavement	MV160	Tertiary	LOW	\$ 200
IC380	Renwick Street	Marrickville	Local Road		infrastructure condition	raised pavement lip	-33.9194314	151.1546932	1		repair pavement panel	MV169	Tertiary	LOW	\$ 200
IC381	Renwick Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9196575	151.1547561	1		re-construct footpath pavement	MV169	Tertiary	LOW	\$ 200
IC382	Renwick Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9194813	151.1544523	1		re-construct footpath pavement	MV169	Tertiary	LOW	\$ 200
IC383	Renwick Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9189709	151.1535721	1		re-construct footpath pavement	MV172	Tertiary	LOW	\$ 200
IC384	Renwick Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9187998	151.1532698	1		re-construct footpath pavement	MV172	Tertiary	LOW	\$ 200
IC385	Richardson Crescent	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9221387	151.1565811	1		re-construct footpath pavement	MV175	Secondary	LOW	\$ 200
IC386	Richardson Crescent	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9207988	151.1554615	1		re-construct footpath pavement	MV173	Tertiary	LOW	\$ 200
IC387	Riverside Crescent	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9149426	151.1418074	1		re-construct footpath pavement	MV179	Tertiary	LOW	\$ 200
IC388	Riverside Crescent	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9148586	151.1406686	1		re-construct footpath pavement	MV180	Tertiary	LOW	\$ 200
IC389	Riverside Crescent	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9145005	151.1395095	1		re-construct footpath pavement	MV177	Tertiary	LOW	\$ 200
IC390	Riverside Crescent	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.913864	151.1391027	1		re-construct footpath pavement	MV177	Tertiary	LOW	\$ 200
IC391	Riverside Crescent	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9149338	151.1404898	1		re-construct footpath pavement	MV180	Tertiary	LOW	\$ 200
IC392	Shirlow Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9121722	151.1665325	1		re-construct footpath pavement	MV185	Secondary	LOW	\$ 200
IC393	Shirlow Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.912064	151.1666106	1		re-construct footpath pavement	MV185	Secondary	LOW	\$ 200
IC394	Shirlow Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9114837	151.1674853	1		re-construct footpath pavement	MV183	Tertiary	LOW	\$ 200
IC395	Shirlow Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9111593	151.1680057	1		re-construct footpath pavement	MV184	Tertiary	LOW	\$ 200
IC396	Shirlow Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9123804	151.1660897	1		re-construct footpath pavement	MV185	Secondary	LOW	\$ 200
IC397	Station Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9144898	151.1552215	1		re-construct footpath pavement	MV188	Secondary	LOW	\$ 200
IC398	Station Street	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9146734	151.1559477	1		re-construct footpath pavement	MV187	Secondary	LOW	\$ 200
IC399	Sydenham Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9116742	151.1650119	1		re-construct footpath pavement	MV204	Secondary	LOW	\$ 200
IC400	Sydenham Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9118518	151.1652573	1		re-construct footpath pavement	MV204	Secondary	LOW	\$ 200
IC401	Sydenham Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9121328	151.1656023	1		re-construct footpath pavement	MV204	Secondary	LOW	\$ 200
IC402	Sydenham Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9122659	151.1695141	1		re-construct footpath pavement	MV204	Secondary	LOW	\$ 200
IC407	Sydenham Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9115479	151.1646101	1		re-construct footpath pavement	MV202	Secondary	LOW	\$ 200
IC408	Sydenham Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9108333	151.163767	1		re-construct footpath pavement	MV201	Secondary	LOW	\$ 200
IC409	Sydenham Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9107769	151.1637002	1		re-construct footpath pavement	MV201	Secondary	LOW	\$ 200
IC411	Sydenham Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9102531	151.163254	1		re-construct footpath pavement	MV201	Secondary	LOW	\$ 200
IC412	Sydney Steel St	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9098859	151.169796	1		re-construct footpath pavement	MV207	Tertiary	LOW	\$ 200
IC413	Sydney Steel St	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9096561	151.1701487	1		re-construct footpath pavement	MV206	Tertiary	LOW	\$ 200
IC414	Sydney Steel St	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9093634	151.170621	1		re-construct footpath pavement	MV206	Tertiary	LOW	\$ 200
IC415	Sydney Steel St	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9093684	151.1706896	1		re-construct footpath pavement	MV206	Tertiary	LOW	\$ 200
IC416	Sydney Steel St	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9092174	151.1708321	1		re-construct footpath pavement	MV205	Secondary	LOW	\$ 200
IC417	Sydney Steel St	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9088843	151.1712827	1		re-construct footpath pavement	MV205	Secondary	LOW	\$ 200
IC418	Sydney Steel St	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9093082	151.1708787	1		re-construct footpath pavement	MV205	Secondary	LOW	\$ 200
IC419	Sydney Steel St	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9099775	151.1699253	1		re-construct footpath pavement	MV207	Tertiary	LOW	\$ 200
IC420	Sydney Steel St	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9101071	151.1694234	1		re-construct footpath pavement	MV207	Tertiary	LOW	\$ 200
IC422	Victoria Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9057475	151.1710959	1		re-construct footpath pavement	MV222	Secondary	LOW	\$ 200
IC423	Victoria Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.906504	151.1646319	1		re-construct footpath pavement	MV215	Secondary	LOW	\$ 200
IC424	Victoria Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9057561	151.1711318	1		re-construct footpath pavement	MV222	Secondary	LOW	\$ 200
IC431	Victoria Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9147433	151.1564774	1		re-construct footpath pavement	MV228	Secondary	LOW	\$ 200
IC432	Victoria Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9144353	151.1565821	1		re-construct footpath pavement	MV228	Secondary	LOW	\$ 200
IC433	Victoria Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9142941	151.1571369	1		re-construct footpath pavement	MV228	Secondary	LOW	\$ 200
IC434	Victoria Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9144479	151.1574342	1		re-construct footpath pavement	MV209	Secondary	LOW	\$ 200
IC435	Victoria Road	Marrickville	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9145732	151.1576683	1		re-construct footpath pavement	MV209	Secondary	LOW	\$ 200
IC436	Wardell Road	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.9018867	151.149097	1		re-construct footpath pavement	DH119	Tertiary	LOW	\$ 200
IC437	Wardell Road	Marrickville	Regional Road		infrastructure condition	raised pavement lip	-33.90359	151.1489333	1		repair pavement panel	DH120	Tertiary	LOW	\$ 200
IC438	Wardell Road	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.9039382	151.1487554	1		re-construct footpath pavement	MV234	Secondary	LOW	\$ 200
IC439	Wardell Road	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.9043174	151.1484238	1		re-construct footpath pavement	MV234	Secondary	LOW	\$ 200
IC440	Wardell Road	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.904429	151.1483139	1		re-construct footpath pavement	DH122	Secondary	LOW	\$ 200
IC441	Wardell Road	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.9060378	151.1467179	1		re-construct footpath pavement	MV235	Tertiary	LOW	\$ 200
IC442	Wardell Road	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.9073943	151.1451642	1		re-construct footpath pavement	MV240	Secondary	LOW	\$ 200
IC443	Wardell Road	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.9077395	151.1445619	1		re-construct footpath pavement	MV232	Secondary	LOW	\$ 200
IC444	Wardell Road	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.9079254	151.1443829	1		re-construct footpath pavement	MV232	Secondary	LOW	\$ 200
IC448	Wardell Road	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.9126199	151.1392912	1		re-construct footpath pavement	MV236	Secondary	LOW	\$ 200
IC449	Wardell Road	Marrickville	Regional Road		infrastructure condition	uneven pavement surface	-33.912873	151.1388065	1		re-construct footpath pavement	MV236	Secondary	LOW	\$ 200
IC450	Warren Road	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9150646	151.1489471	1		re-construct footpath pavement	MV245	Secondary	LOW	\$ 200
IC454	Warren Road	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9164084	151.1511953	1		re-construct footpath pavement	MV248	Secondary	LOW	\$ 200
IC455	Warren Road	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9174196	151.1529819	1		re-construct footpath pavement	MV241	Tertiary	LOW	\$ 200
IC456	Warren Road	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9181043	151.1541938	1		re-construct footpath pavement	MV250	Tertiary	LOW	\$ 200
IC457	Warren Road	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9184602	151.1546468	1		re-construct footpath pavement	MV250	Tertiary	LOW	\$ 200
IC458	Warren Road	Marrickville	Local Road		infrastructure condition	uneven pavement surface	-33.9138101	151.1467562	1		re-construct footpath pavement	MV243	Secondary	LOW	\$ 200
IC464	Phillip Street	Newtown	Local Road		infrastructure condition	uneven crossing surface	-33.8982919	151.1737634	1		install new pavement surface	NE46	Secondary	LOW	\$ 300
IC465	Station Street	Newtown	Local Road		infrastructure condition	uneven pavement surface	-33.8999861	151.1770471	1		re-construct footpath pavement	NE59	Secondary	LOW	\$ 200
IC466	Crystal Street	Petersham	Local Road		infrastructure condition	uneven pavement surface	-33.893453	151.1575584	1		re-construct footpath pavement	PE13	Secondary	LOW	\$ 200
IC468	Palace Street	Petersham	Local Road	Strategic Route	infrastructure condition	raised pavement lip	-33.890691	151.1544286	1		repair pavement panel	PE42	Secondary	LOW	\$ 200
IC469	Palace Street	Petersham	Local Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8894417	151.154448	1		re-construct footpath pavement	PE40	Secondary	LOW	\$ 200
IC472	Denison Street	Rozelle	Local Road		infrastructure condition	raised pavement lip	-33.8664705	151.1683434	1		repair pavement panel	RO29	Secondary	LOW	\$ 200
IC473	Denison Street	Rozelle	Local Road		infrastructure condition	uneven pavement surface	-33.8694643	151.1694094	1		re-construct footpath pavement	RO209	Tertiary	LOW	\$ 200
IC474	Denison Street	Rozelle	Local Road		infrastructure condition	uneven pavement surface	-33.8696212	151.1696649	1		re-construct footpath pavement	RO28	Tertiary	LOW	\$ 200
IC475	Denison Street	Rozelle	Local Road		infrastructure condition	raised pavement lip	-33.8696762	151.1697346	1		repair pavement panel	RO28	Tertiary	LOW	\$ 200

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
IC476	James Craig Road	Rozelle	Local Road		infrastructure condition	uneven pavement surface	-33.8700367	151.1752912	1		re-construct footpath pavement	RO44	Secondary	LOW	\$ 200
IC477	Lilyfield Road	Rozelle	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8687911	151.1739361	1		re-construct footpath pavement	RO42	Secondary	LOW	\$ 200
IC478	Manning Street	Rozelle	Local Road		infrastructure condition	uneven pavement surface	-33.8655803	151.1666633	1		re-construct footpath pavement	RO52	Secondary	LOW	\$ 200
IC479	Robert Street	Rozelle	Local Road		infrastructure condition	uneven pavement surface	-33.8658416	151.1774775	1		re-construct footpath pavement	RO58	Tertiary	LOW	\$ 200
IC480	Robert Street	Rozelle	Local Road		infrastructure condition	uneven pavement surface	-33.8654393	151.1781039	1		re-construct footpath pavement	RO61	Tertiary	LOW	\$ 200
IC481	Terry Street	Rozelle	Local Road		infrastructure condition	uneven pavement surface	-33.8602597	151.1704715	1		re-construct footpath pavement	RO63	Secondary	LOW	\$ 200
IC485	The Crescent	Rozelle	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8697872	151.175182	1		no action	RO42	Secondary	LOW	\$ -
IC489	Bedwin Road	St Peters	Regional Road		infrastructure condition	uneven pavement surface	-33.9090689	151.1751595	1		re-construct footpath pavement	MV18	Secondary	LOW	\$ 200
IC490	Bedwin Road	St Peters	Regional Road		infrastructure condition	uneven pavement surface	-33.9090515	151.1752245	1		re-construct footpath pavement	MV18	Secondary	LOW	\$ 200
IC491	Church Street	St Peters	Local Road		infrastructure condition	uneven pavement surface	-33.9129791	151.1778331	1		re-construct footpath pavement	SP7	Secondary	LOW	\$ 200
IC492	Edith Street	St Peters	Local Road		infrastructure condition	uneven pavement surface	-33.9123829	151.1732859	1		re-construct footpath pavement	SP35	Tertiary	LOW	\$ 200
IC493	Princes Highway	St Peters	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9168538	151.1722362	1		re-construct footpath pavement	SP25	Secondary	LOW	\$ 200
IC494	Princes Highway	St Peters	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9194633	151.1690592	1		re-construct footpath pavement	SP28	Secondary	LOW	\$ 200
IC495	Princes Highway	St Peters	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9169306	151.1724922	1		re-construct footpath pavement	SP25	Secondary	LOW	\$ 200
IC496	Princes Highway	St Peters	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9167651	151.1727261	1		re-construct footpath pavement	SP25	Secondary	LOW	\$ 200
IC505	Railway Avenue	Stammore	Local Road		infrastructure condition	uneven pavement surface	-33.8943838	151.1699319	1		re-construct footpath pavement	SM38	Tertiary	LOW	\$ 200
IC506	Carlton Crescent	Summer Hill	Regional Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.8897767	151.1319695	1		re-construct footpath pavement	SH8	Secondary	LOW	\$ 200
IC507	Frenchs Lane	Summer Hill	Local Road		infrastructure condition	uneven pavement surface	-33.8898609	151.1445711	1		re-construct footpath pavement	SH16	Secondary	LOW	\$ 200
IC508	Frenchs Lane	Summer Hill	Local Road		infrastructure condition	uneven pavement surface	-33.8901018	151.1443542	1		re-construct footpath pavement	SH16	Secondary	LOW	\$ 200
IC509	Grosvenor Crescent	Summer Hill	Local Road		infrastructure condition	uneven pavement surface	-33.8893289	151.1330275	1		re-construct footpath pavement	SH28	Secondary	LOW	\$ 200
IC510	Henson Street	Summer Hill	Local Road		infrastructure condition	raised pavement lip	-33.8972013	151.1345663	1		repair pavement panel	SH35	Secondary	LOW	\$ 200
IC511	Henson Street	Summer Hill	Local Road		infrastructure condition	raised pavement lip	-33.8971376	151.1344588	1		repair pavement panel	SH35	Secondary	LOW	\$ 200
IC512	Henson Street	Summer Hill	Local Road		infrastructure condition	raised pavement lip	-33.896479	151.1344909	1		repair pavement panel	SH35	Secondary	LOW	\$ 200
IC513	Herbert Street	Summer Hill	Local Road		infrastructure condition	uneven pavement surface	-33.8962774	151.1341811	1		re-construct footpath pavement	SH37	Secondary	LOW	\$ 200
IC514	James Street	Summer Hill	Local Road		infrastructure condition	uneven pavement surface	-33.8973559	151.1356081	1		re-construct footpath pavement	SH38	Secondary	LOW	\$ 200
IC515	Junction Road	Summer Hill	Local Road		infrastructure condition	raised pavement lip	-33.8952711	151.1370186	1		repair pavement panel	SH39	Secondary	LOW	\$ 200
IC516	Junction Road	Summer Hill	Local Road		infrastructure condition	raised pavement lip	-33.8951658	151.1342315	1		repair pavement panel	SH41	Secondary	LOW	\$ 200
IC517	Prospect Road	Summer Hill	Local Road		infrastructure condition	raised pavement lip	-33.8969204	151.1323125	1		repair pavement panel	SH71	Tertiary	LOW	\$ 200
IC518	Prospect Road	Summer Hill	Local Road		infrastructure condition	raised pavement lip	-33.8973311	151.1322348	1		repair pavement panel	SH72	Tertiary	LOW	\$ 200
IC519	Prospect Road	Summer Hill	Local Road		infrastructure condition	uneven pavement surface	-33.8982048	151.1321328	1		re-construct footpath pavement	SH73	Secondary	LOW	\$ 200
IC520	Prospect Road	Summer Hill	Local Road		infrastructure condition	uneven pavement surface	-33.8988988	151.1320957	1		re-construct footpath pavement	SH74	Secondary	LOW	\$ 200
IC522	Smith Street	Summer Hill	Local Road		infrastructure condition	uneven pavement surface	-33.8916451	151.1356949	1		install new utility cover	SH82	Secondary	LOW	\$ 2,000
IC524	Burrows Avenue	Sydenham	Local Road		infrastructure condition	uneven pavement surface	-33.9146559	151.167033	1		re-construct footpath pavement	SY1	Secondary	LOW	\$ 200
IC525	George Street	Sydenham	Local Road		infrastructure condition	raised pavement lip	-33.9147931	151.1674768	1		repair pavement panel	SY3	Secondary	LOW	\$ 200
IC526	George Street	Sydenham	Local Road		infrastructure condition	uneven pavement surface	-33.9145389	151.1672138	1		re-construct footpath pavement	SY1	Secondary	LOW	\$ 200
IC528	Princes Highway	Sydenham	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9194224	151.1688348	1		re-construct footpath pavement	SP28	Secondary	LOW	\$ 200
IC529	Princes Highway	Sydenham	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9199454	151.1682349	1		re-construct footpath pavement	SP29	Secondary	LOW	\$ 200
IC531	Griffiths Street	Tempe	Local Road		infrastructure condition	raised pavement lip	-33.9249771	151.1567292	1		repair pavement panel	TE32	Secondary	LOW	\$ 200
IC532	Princes Highway	Tempe	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9206661	151.1670295	1		re-construct footpath pavement	TE7	Secondary	LOW	\$ 200
IC533	Princes Highway	Tempe	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.920729	151.1668485	1		re-construct footpath pavement	TE7	Secondary	LOW	\$ 200
IC534	Princes Highway	Tempe	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9212894	151.164896	1		re-construct footpath pavement	TE9	Secondary	LOW	\$ 200
IC536	Princes Highway	Tempe	State Road	Strategic Route	infrastructure condition	uneven pavement surface	-33.9277007	151.157903	1		re-construct footpath pavement	TE30	Secondary	LOW	\$ 200
MP17	Challis Avenue	Dulwich Hill	Local Road		missing footpath	missing footpath	-33.9108573	151.1452129		35	install new footpath	DH7	Tertiary	LOW	\$ 7,000
MP18	Challis Avenue	Dulwich Hill	Local Road		missing footpath	missing footpath	-33.9108996	151.1448761		17	install new footpath	DH7	Tertiary	LOW	\$ 3,400
MP29	Canal Road	Lilyfield	Local Road		missing footpath	missing footpath	-33.8724101	151.1510975		43	install new footpath	LF57	Tertiary	LOW	\$ 8,600
MP30	Frazer Street	Lilyfield	Local Road		missing footpath	missing footpath	-33.869215	151.15265		287	install new footpath	LF43	Tertiary	LOW	\$ 57,400
MP31	Glover Street	Lilyfield	Local Road		missing footpath	missing footpath	-33.8677354	151.1557506		347	install new footpath	LF46	Tertiary	LOW	\$ 69,400
MP37	Mary Street	Lilyfield	Local Road		missing footpath	missing footpath	-33.8676798	151.1550397		114	install new footpath	LF80	Tertiary	LOW	\$ 22,800
MP38	Mary Street	Lilyfield	Local Road		missing footpath	missing footpath	-33.8678351	151.1553958		18	install new footpath	LF80	Tertiary	LOW	\$ 3,600
MP45	Myrtle Street	Marrickville	Local Road		missing footpath	missing footpath	-33.9152267	151.1567685		49	install new footpath	MV146	Tertiary	LOW	\$ 9,800
MP46	Premier Street	Marrickville	Local Road		missing footpath	missing footpath	-33.9180257	151.1480742		20	install new footpath	MV160	Tertiary	LOW	\$ 4,000
MP50	Denison Street	Rozelle	Local Road		missing footpath	missing footpath	-33.8699109	151.1701217		116	install new footpath	RO28	Tertiary	LOW	\$ 23,200
MP51	Manning Street	Rozelle	Local Road		missing footpath	missing footpath	-33.8630954	151.1648503		273	install new footpath	RO50	Tertiary	LOW	\$ 54,600
MP52	Robert Street	Rozelle	Local Road		missing footpath	missing footpath	-33.8653797	151.178607		291	install new footpath	RO58	Tertiary	LOW	\$ 58,200
NP2	Gordon Street	Annandale	State Road	Strategic Route	narrow footpath	narrow footpath	-33.8865365	151.1741719		161	widen footpath	AN92	Secondary	LOW	\$ 32,200
NP3	Gordon Street	Annandale	State Road	Strategic Route	narrow footpath	narrow footpath	-33.8865158	151.1742764		163	widen footpath	AN38	Secondary	LOW	\$ 32,600
NP5	Clissold Street	Ashfield	Local Road		narrow footpath	narrow footpath	-33.8957254	151.1300022		429	widen footpath	AF159	Secondary	LOW	\$ 85,800
NP7	Prospect Road	Ashfield	Local Road		narrow footpath	narrow footpath	-33.8969157	151.1322314		222	widen footpath	AF46	Tertiary	LOW	\$ 44,400
NP8	Victoria Street	Ashfield	Local Road		narrow footpath	narrow footpath	-33.8993651	151.1296024		304	widen footpath	AF169	Secondary	LOW	\$ 60,800
NP10	Buchanan Street	Balmain	Local Road		narrow footpath	narrow footpath	-33.8631639	151.1803338		165	widen footpath	BA61	Secondary	LOW	\$ 33,000
NP12	Hyam Street	Balmain	Local Road		narrow footpath	narrow footpath	-33.8614506	151.180362		236	widen footpath	BA42	Tertiary	LOW	\$ 47,200
NP14	Jane Street	Balmain	Local Road		narrow footpath	narrow footpath	-33.8590908	151.1844296		165	widen footpath	BA45	Secondary	LOW	\$ 33,000
NP16	Cardigan Lane	Camperdown	Local Road		narrow footpath	narrow footpath	-33.8896697	151.1728265		31	widen footpath	CA18	Secondary	LOW	\$ 6,200
NP17	Cardigan Lane	Camperdown	Local Road		narrow footpath	narrow footpath	-33.8896763	151.1729097		32	widen footpath	CA18	Secondary	LOW	\$ 6,400
NP18	Parramatta Road	Croydon	State Road	Strategic Route	narrow footpath	narrow footpath	-33.8717467	151.123853		38	widen footpath	CR28	Secondary	LOW	\$ 7,600
NP19	Parramatta Road	Croydon	State Road	Strategic Route	narrow footpath	narrow footpath	-33.8730562	151.1259579		3	widen footpath	CR4	Secondary	LOW	\$ 600
NP22	Piggott Street	Dulwich Hill	Local Road		narrow footpath	narrow footpath	-33.9020312	151.1432572		7	widen footpath	DH105	Secondary	LOW	\$ 1,400
NP23	Weston Street	Dulwich Hill	Local Road		narrow footpath	narrow footpath	-33.8984419	151.1399366		7	widen footpath	DH44	Secondary	LOW	\$ 1,400
NP24	Elswick Street	Leichhardt	Local Road		narrow footpath	narrow footpath	-33.8886267	151.1530079		5	widen footpath	LH53	Secondary	LOW	\$ 1,000
NP25	Mackenzie Street	Leichhardt	Local Road		narrow footpath	narrow footpath	-33.8838123	151.161257		136	widen footpath	LH149	Secondary	LOW	\$ 27,200
NP27	Balmain Road	Lilyfield	State Road	Strategic Route	narrow footpath	narrow footpath	-33.8694281	151.162638		174	widen footpath	LF8	Secondary	LOW	\$ 34,800
NP28	Glover Street	Lilyfield	Local Road		narrow footpath	narrow footpath	-33.8717989	151.1573551		37	widen footpath	LF51	Secondary	LOW	\$ 7,400
NP29	Grove Street	Lilyfield	Local Road		narrow footpath	narrow footpath	-33.8726364	151.164594		128	widen footpath	LF55	Tertiary	LOW	\$ 25,600
NP30	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	narrow footpath	narrow footpath	-33.8704383	151.1707057		22	widen footpath	LF98	Secondary	LOW	\$ 4,400
NP31	Maliyawul Street	Lilyfield	Local Road		narrow footpath	narrow footpath	-33.8704894	151.1520251		65	widen footpath	LF44	Tertiary	LOW	\$ 13,000
NP32	Perry Street	Lilyfield	Local Road		narrow footpath	narrow footpath	-33.8726006	151.1552871		8	widen footpath	LF78	Secondary	LOW	\$ 1,600
NP33	Piper Street	Lilyfield	Local Road		narrow footpath	narrow footpath	-33.8759994	151.1625167		292	widen footpath	LF90	Tertiary	LOW	\$ 58,400
NP34	Bedwin Road	Marrickville	Regional Road		narrow footpath	narrow footpath	-33.9088914	151.1749788		92	widen footpath	MV18	Secondary	LOW	\$ 18,400
NP35	Bedwin Road	Marrickville	Regional Road		narrow footpath	narrow footpath	-33.908878	151.175019		91	widen footpath	MV18	Secondary	LOW	\$ 18,200
NP36	Byrnes Street	Marrickville	Local Road		narrow footpath	narrow footpath	-33.9137223	151.1553195		18	widen footpath	MV188	Secondary	LOW	\$ 3,600
NP37	Premier Street	Marrickville	Local Road		narrow footpath	narrow footpath	-33.921151	151.1535554		78	widen footpath	MV159	Secondary	LOW	\$ 15,600
NP38	Shirlow Street	Marrickville	Local Road		narrow footpath	narrow footpath	-33.9112367	151.1678894		12	widen footpath	MV184	Tertiary	LOW	\$ 2,400

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
NP39	Sydney Steel Road	Marrickville	Local Road		narrow footpath	narrow footpath	-33.9093485	151.1705994		221	widen footpath	MV206	Tertiary	LOW	\$ 44,200
NP40	Sydney Steel Road	Marrickville	Local Road		narrow footpath	narrow footpath	-33.9093847	151.1706795		224	widen footpath	MV207	Tertiary	LOW	\$ 44,800
NP41	Victoria Road	Marrickville	State Road	Strategic Route	narrow footpath	narrow footpath	-33.9142367	151.1568035		34	widen footpath	MV228	Secondary	LOW	\$ 6,800
NP42	Wardell Road	Marrickville	Regional Road		narrow footpath	narrow footpath	-33.9136443	151.1374402		69	widen footpath	MV233	Secondary	LOW	\$ 13,800
NP43	Warren Road	Marrickville	Local Road		narrow footpath	narrow footpath	-33.9182516	151.1544249		4	widen footpath	MV250	Tertiary	LOW	\$ 800
NP48	Lennox Street	Newtown	Local Road		narrow footpath	narrow footpath	-33.8951968	151.1805925		5	widen footpath	NE41	Secondary	LOW	\$ 1,000
NP49	Liberty Street	Newtown	Local Road		narrow footpath	narrow footpath	-33.8956265	151.1713603		7	widen footpath	NE43	Tertiary	LOW	\$ 1,400
NP54	Denison Street	Rozelle	Local Road		narrow footpath	narrow footpath	-33.8695372	151.1695579		15	widen footpath	RO28	Tertiary	LOW	\$ 3,000
NP55	Manning Street	Rozelle	Local Road		narrow footpath	narrow footpath	-33.8651337	151.1661331		211	widen footpath	RO49	Secondary	LOW	\$ 42,200
NP56	Manning Street	Rozelle	Local Road		narrow footpath	narrow footpath	-33.8650922	151.1662052		209	widen footpath	RO49	Secondary	LOW	\$ 41,800
NP57	Robert Street	Rozelle	Local Road		narrow footpath	narrow footpath	-33.8643415	151.180406		106	widen footpath	RO59	Tertiary	LOW	\$ 21,200
NP58	Robert Street	Rozelle	Local Road		narrow footpath	narrow footpath	-33.8655221	151.1780368		171	widen footpath	RO61	Tertiary	LOW	\$ 34,200
NP59	Robert Street	Rozelle	Local Road		narrow footpath	narrow footpath	-33.8665423	151.1755829		18	widen footpath	RO57	Secondary	LOW	\$ 3,600
NP61	Albion Lane	St Peters	Local Road		narrow footpath	narrow footpath	-33.9135205	151.1714326		120	widen footpath	SP36	Tertiary	LOW	\$ 24,000
NP63	Edith Street	St Peters	Local Road		narrow footpath	narrow footpath	-33.9129796	151.1738522		13	widen footpath	SP35	Tertiary	LOW	\$ 2,600
NP65	St Peters Street	St Peters	Local Road		narrow footpath	narrow footpath	-33.9123052	151.1771963		158	widen footpath	SP30	Secondary	LOW	\$ 31,600
NP66	St Peters Street	St Peters	Local Road		narrow footpath	narrow footpath	-33.9123507	151.1772614		158	widen footpath	SP31	Secondary	LOW	\$ 31,600
NP67	Cruikshank Street	Stanmore	Local Road		narrow footpath	narrow footpath	-33.8894448	151.1726616		35	widen footpath	SM7	Tertiary	LOW	\$ 7,000
NP68	Cruikshank Street	Stanmore	Local Road		narrow footpath	narrow footpath	-33.8894921	151.1726489		39	widen footpath	SM7	Tertiary	LOW	\$ 7,800
NP70	Frenchs Lane	Summer Hill	Local Road		narrow footpath	narrow footpath	-33.8905964	151.1439162		41	widen footpath	SH16	Secondary	LOW	\$ 8,200
NP71	Frenchs Lane	Summer Hill	Local Road		narrow footpath	narrow footpath	-33.8906276	151.1439497		41	widen footpath	SH16	Secondary	LOW	\$ 8,200
NP72	Henson Street	Summer Hill	Local Road		narrow footpath	narrow footpath	-33.8944581	151.1346496		476	widen footpath	SH41	Secondary	LOW	\$ 95,200
NP73	James Street	Summer Hill	Local Road		narrow footpath	narrow footpath	-33.8973991	151.135239		127	widen footpath	SH58	Secondary	LOW	\$ 25,400
NP74	Nowranie Street	Summer Hill	Local Road		narrow footpath	narrow footpath	-33.8933839	151.1388129		204	widen footpath	SH50	Secondary	LOW	\$ 40,800
OB1	Annandale Street	Annandale	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8862539	151.1667051	1		refer to maintenance	AN1	Secondary	LOW	\$ -
OB2	Bignell Lane	Annandale	Local Road		obstruction	vehicles narrows footpath	-33.8865181	151.1752761	1		no action	AN19	Secondary	LOW	\$ -
OB3	Bignell Lane	Annandale	Local Road		obstruction	vehicles narrows footpath	-33.8864269	151.1748372	1		no action	AN93	Secondary	LOW	\$ -
OB4	Booth Street	Annandale	Regional Road	Strategic Route	obstruction	storefront narrows footpath - property	-33.882278	151.1731732	1		notify busines/property owner	AN26	Primary	LOW	\$ -
OB5	Booth Street	Annandale	Regional Road	Strategic Route	obstruction	power pole narrows footpath	-33.8850381	151.1759665	1		further investigation required	AN28	Secondary	LOW	-
OB6	Booth Street	Annandale	Regional Road	Strategic Route	obstruction	power pole narrows footpath	-33.8845475	151.1757965	1		no action	AN28	Secondary	LOW	\$ -
OB7	Booth Street	Annandale	Regional Road	Strategic Route	obstruction	power pole narrows footpath	-33.8839905	151.1756266	1		no action	AN27	Primary	LOW	\$ -
OB8	Booth Street	Annandale	Regional Road	Strategic Route	obstruction	power pole narrows footpath	-33.8836093	151.1754883	1		no action	AN27	Primary	LOW	\$ -
OB10	Chester Street	Annandale	Local Road	Strategic Route	obstruction	trees narrows footpath	-33.884181	151.1730539	1		no action	AN31	Primary	LOW	\$ -
OB11	Chester Street	Annandale	Local Road	Strategic Route	obstruction	signpost narrows footpath	-33.8842849	151.1733683	1		relocate signpost	AN31	Primary	LOW	\$ 300
OB9	Chester Street	Annandale	Local Road	Strategic Route	obstruction	vehicles narrows footpath	-33.8847323	151.1741067	1		no action	AN30	Secondary	LOW	\$ -
OB12	Hutchinson Street	Annandale	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8750674	151.1698349	1		refer to maintenance	AN120	Secondary	LOW	\$ -
OB13	Nelson Street	Annandale	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8799873	151.1745275	1		refer to maintenance	AN69	Secondary	LOW	\$ -
OB14	Nelson Street	Annandale	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8798588	151.1745719	1		notify busines/property owner	AN69	Secondary	LOW	\$ -
OB15	Nelson Street	Annandale	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8796369	151.1747476	1		refer to maintenance	AN69	Secondary	LOW	\$ -
OB16	Nelson Street	Annandale	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8789034	151.1750886	1		notify busines/property owner	AN68	Secondary	LOW	\$ -
OB17	Nelson Street	Annandale	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8782796	151.1752757	1		notify busines/property owner	AN67	Secondary	LOW	\$ -
OB18	Nelson Street	Annandale	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8781702	151.1753908	1		notify busines/property owner	AN67	Secondary	LOW	\$ -
OB19	Nelson Street	Annandale	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8839839	151.1728074	1		notify busines/property owner	AN71	Primary	LOW	\$ -
OB20	Nelson Street	Annandale	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8830997	151.1733338	1		notify busines/property owner	AN72	Primary	LOW	\$ -
OB21	Nelson Street	Annandale	Local Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8834194	151.1732048	1		notify busines/property owner	AN72	Primary	LOW	\$ -
OB22	Nelson Street	Annandale	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8838784	151.1730337	1		notify busines/property owner	AN71	Primary	LOW	\$ -
OB23	Piper Street	Annandale	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8779051	151.169783	1		notify busines/property owner	AN89	Secondary	LOW	\$ -
OB24	Pritchard Street	Annandale	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8740277	151.170323	1		refer to maintenance	AN122	Secondary	LOW	\$ -
OB25	Rose Street	Annandale	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8773621	151.176068	1		refer to maintenance	AN95	Secondary	LOW	\$ -
OB26	The Crescent	Annandale	State Road	Strategic Route	obstruction	bus shelter narrows footpath	-33.8742508	151.1748814	1		relocate or remove bus shelter	AN98	Primary	LOW	\$ 5,000
OB27	The Crescent	Annandale	State Road	Strategic Route	obstruction	vehicles narrow crossing path	-33.8739391	151.174763	1		install no stopping sign and signpost	AN98	Primary	LOW	\$ 300
OB28	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.882383	151.1719116	1		notify busines/property owner	AN108	Secondary	LOW	\$ -
OB29	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8822575	151.172072	1		notify busines/property owner	AN108	Secondary	LOW	\$ -
OB30	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8824209	151.1719885	1		notify busines/property owner	AN108	Secondary	LOW	\$ -
OB31	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8825324	151.1719419	1		notify busines/property owner	AN108	Secondary	LOW	\$ -
OB32	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8826854	151.1718913	1		notify busines/property owner	AN108	Secondary	LOW	\$ -
OB33	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8846873	151.1708365	1		notify busines/property owner	AN109	Secondary	LOW	\$ -
OB34	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8840835	151.1712419	1		notify busines/property owner	AN32	Secondary	LOW	\$ -
OB35	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8870143	151.1697458	1		notify busines/property owner	AN111	Secondary	LOW	\$ -
OB36	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath	-33.8844064	151.1711053	1		refer to maintenance	AN109	Secondary	LOW	\$ -
OB37	Trafalgar Street	Annandale	Regional Road		obstruction	vehicle narrows footpath	-33.8844666	151.1710694	1		no action	AN109	Secondary	LOW	\$ -
OB38	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation	-33.8869609	151.1699172	1		refer to maintenance	AN111	Secondary	LOW	\$ -
OB39	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath	-33.8816165	151.1722197	1		refer to maintenance	AN105	Secondary	LOW	\$ -
OB40	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.880147	151.1728146	1		notify busines/property owner	AN106	Secondary	LOW	\$ -
OB41	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8797297	151.1730834	1		notify busines/property owner	AN100	Primary	LOW	\$ -
OB42	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath	-33.8801808	151.1729542	1		refer to maintenance	AN106	Secondary	LOW	\$ -
OB43	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8794886	151.1731537	1		notify busines/property owner	AN100	Primary	LOW	\$ -
OB44	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath	-33.8793512	151.1732628	1		refer to maintenance	AN100	Primary	LOW	\$ -
OB45	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation - property	-33.8799258	151.1730828	1		notify busines/property owner	AN100	Primary	LOW	\$ -
OB46	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation - property	-33.8793036	151.1732552	1		notify busines/property owner	AN100	Primary	LOW	\$ -
OB47	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath	-33.8785877	151.1735745	1		refer to maintenance	AN104	Secondary	LOW	\$ -
OB48	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8783227	151.1736824	1		notify busines/property owner	AN104	Secondary	LOW	\$ -
OB49	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath	-33.8785595	151.1737084	1		refer to maintenance	AN104	Secondary	LOW	\$ -
OB50	Trafalgar Street	Annandale	Regional Road		obstruction	signpost narrows footpath	-33.8768152	151.1744315	1		relocate signpost	AN102	Tertiary	LOW	\$ 300
OB51	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation - property	-33.8764279	151.1746092	1		notify busines/property owner	AN102	Tertiary	LOW	\$ -
OB52	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8763759	151.1746078	1		notify busines/property owner	AN102	Tertiary	LOW	\$ -
OB53	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath	-33.8761903	151.1746854	1		refer to maintenance	AN102	Tertiary	LOW	\$ -
OB54	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.876066	151.1747304	1		notify busines/property owner	AN102	Tertiary	LOW	\$ -
OB55	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation	-33.8761482	151.1748405	1		refer to maintenance	AN102	Tertiary	LOW	\$ -
OB56	Trafalgar Street	Annandale	Regional Road		obstruction	overhanging vegetation - property	-33.8762697	151.1748122	1		notify busines/property owner	AN102	Tertiary	LOW	\$ -
OB57	White Creek	Annandale	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8798225	151.1675724	1		notify busines/property owner	AN113	Secondary	LOW	\$ -
OB58	Hardy Street	Ashbury	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.903204	151.125302	1		notify busines/property owner	AF82	Secondary	LOW	\$ -

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
OB59	Hardy Street	Ashbury	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9041811	151.1247787	1		refer to maintenance	HP1	Secondary	LOW	\$ -
OB60	Hardy Street	Ashbury	Local Road		obstruction	overhanging vegetation narrows footpath	-33.90465	151.1245074	1		refer to maintenance	HP1	Secondary	LOW	\$ -
OB61	Hardy Street	Ashbury	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9055136	151.1239241	1		refer to maintenance	HP1	Secondary	LOW	\$ -
OB62	Hardy Street	Ashbury	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9057266	151.1238427	1		notify busines/property owner	HP2	Secondary	LOW	\$ -
OB63	Hardy Street	Ashbury	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9059481	151.1237638	1		refer to maintenance	HP2	Secondary	LOW	\$ -
OB64	Alt Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8807245	151.128074	1		notify busines/property owner	AF3	Tertiary	LOW	\$ -
OB65	Alt Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.881527	151.126487	1		notify busines/property owner	AF1	Tertiary	LOW	\$ -
OB66	Alt Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8816453	151.1264582	1		notify busines/property owner	AF1	Tertiary	LOW	\$ -
OB67	Alt Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8801222	151.1296272	1		notify busines/property owner	AF4	Tertiary	LOW	\$ -
OB68	Alt Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8796387	151.1305744	1		notify busines/property owner	AF5	Tertiary	LOW	\$ -
OB69	Alt Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8794582	151.1306538	1		notify busines/property owner	AF6	Secondary	LOW	\$ -
OB70	Alt Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.879563	151.1304509	1		notify busines/property owner	AF5	Tertiary	LOW	\$ -
OB71	Alt Street	Ashfield	Local Road		obstruction	overhanging vegetation - property	-33.8831193	151.1245498	1		notify busines/property owner	AF9	Secondary	LOW	\$ -
OB72	Alt Street	Ashfield	Local Road		obstruction	overhanging vegetation - property	-33.8839488	151.1239917	1		notify busines/property owner	AF7	Secondary	LOW	\$ -
OB73	Alt Street	Ashfield	Local Road		obstruction	double pole signpost narrows footpath	-33.8848885	151.1233316	1		review and relocate double pole signpost	AF10	Primary	LOW	\$ 500
OB74	Alt Street	Ashfield	Local Road		obstruction	overhanging vegetation - property	-33.8848351	151.1235378	1		notify busines/property owner	AF10	Primary	LOW	\$ -
OB75	Alt Street	Ashfield	Local Road		obstruction	double pole signpost narrows footpath	-33.8829391	151.1248025	1		review and relocate double pole signpost	AF9	Secondary	LOW	\$ 500
OB76	Alt Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8819613	151.1256729	1		notify busines/property owner	AF8	Tertiary	LOW	\$ -
OB77	Alt Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8823072	151.1250925	1		notify busines/property owner	AF9	Secondary	LOW	\$ -
OB78	Armstrong Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8980607	151.1253774	1		refer to maintenance	AF12	Tertiary	LOW	\$ -
OB79	Armstrong Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8998646	151.1268504	1		refer to maintenance	AF11	Secondary	LOW	\$ -
OB80	Armstrong Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8994802	151.1265889	1		notify busines/property owner	AF14	Tertiary	LOW	\$ -
OB81	Bland Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8812325	151.1305395	1		notify busines/property owner	AF27	Tertiary	LOW	\$ -
OB82	Bland Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.88089	151.1312512	1		notify busines/property owner	AF28	Tertiary	LOW	\$ -
OB83	Bland Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8821532	151.1287315	1		notify busines/property owner	AF25	Tertiary	LOW	\$ -
OB84	Bland Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8827604	151.1275085	1		notify busines/property owner	AF24	Tertiary	LOW	\$ -
OB85	Bland Street	Ashfield	Local Road		obstruction	signpost narrows footpath	-33.8843617	151.1262194	1		relocate signpost	AF19	Secondary	LOW	\$ 300
OB86	Bland Street	Ashfield	Local Road		obstruction	signpost narrows footpath	-33.8850049	151.1258013	1		relocate signpost	AF18	Secondary	LOW	\$ 300
OB87	Bland Street	Ashfield	Local Road		obstruction	signpost narrows footpath	-33.8857954	151.1252408	1		relocate signpost	AF17	Primary	LOW	\$ 300
OB88	Brown Street	Ashfield	Local Road		obstruction	power pole narrows footpath	-33.8879247	151.125954	1		further investigation required	AF31	Primary	LOW	-
OB89	Brown Street	Ashfield	Local Road		obstruction	power pole narrows footpath	-33.8879627	151.1257379	1		no action	AF31	Primary	LOW	\$ -
OB90	Brown Street	Ashfield	Local Road		obstruction	bike locker narrows footpath	-33.8879271	151.1259611	1		relocate or remove bike locker	AF31	Primary	LOW	\$ 400
OB91	Charlotte Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8845796	151.1273986	1		refer to maintenance	AF38	Secondary	LOW	\$ -
OB92	Charlotte Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8849215	151.1271532	1		refer to maintenance	AF38	Secondary	LOW	\$ -
OB100	Church Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8774069	151.1243665	1		refer to maintenance	AF41	Tertiary	LOW	\$ -
OB101	Church Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8772013	151.1242313	1		notify busines/property owner	AF41	Tertiary	LOW	\$ -
OB102	Church Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8777456	151.1247796	1		notify busines/property owner	AF42	Tertiary	LOW	\$ -
OB103	Church Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8811562	151.1270417	1		notify busines/property owner	AF45	Tertiary	LOW	\$ -
OB104	Church Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8807181	151.1267373	1		refer to maintenance	AF45	Tertiary	LOW	\$ -
OB105	Church Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8804296	151.1265196	1		refer to maintenance	AF40	Tertiary	LOW	\$ -
OB93	Church Street	Ashfield	Local Road		obstruction	overhanging vegetation	-33.8799241	151.1261499	1		refer to maintenance	AF40	Tertiary	LOW	\$ -
OB94	Church Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8798328	151.1260692	1		refer to maintenance	AF40	Tertiary	LOW	\$ -
OB95	Church Street	Ashfield	Local Road		obstruction	overhanging vegetation	-33.8797896	151.126044	1		refer to maintenance	AF40	Tertiary	LOW	\$ -
OB96	Church Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8795382	151.1258787	1		refer to maintenance	AF44	Secondary	LOW	\$ -
OB97	Church Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8793667	151.1257628	1		refer to maintenance	AF44	Secondary	LOW	\$ -
OB98	Church Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8791485	151.125659	1		notify busines/property owner	AF44	Secondary	LOW	\$ -
OB99	Church Street	Ashfield	Local Road		obstruction	tree narrows footpath	-33.8778734	151.1247216	1		no action	AF42	Tertiary	LOW	\$ -
OB106	Clissold Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8958136	151.130461	1		notify busines/property owner	AF51	Secondary	LOW	\$ -
OB107	Clissold Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8955898	151.1271917	1		notify busines/property owner	AF48	Secondary	LOW	\$ -
OB108	Clissold Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8956311	151.1282736	1		notify busines/property owner	AF49	Secondary	LOW	\$ -
OB109	Clissold Street	Ashfield	Local Road		obstruction	signposts narrows footpath	-33.8956622	151.1290644	1		relocate signpost	AF50	Secondary	LOW	\$ 300
OB110	Clissold Street	Ashfield	Local Road		obstruction	signposts narrows footpath	-33.8957036	151.1295637	1		relocate signpost	AF50	Secondary	LOW	\$ 300
OB111	Clissold Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8956922	151.1292126	1		notify busines/property owner	AF50	Secondary	LOW	\$ -
OB112	Clissold Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8956484	151.1266975	1		notify busines/property owner	AF48	Secondary	LOW	\$ -
OB113	Clissold Street	Ashfield	Local Road		obstruction	overhanging vegetation - property	-33.8955588	151.1272136	1		notify busines/property owner	AF48	Secondary	LOW	\$ -
OB114	Clissold Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8956581	151.1288956	1		notify busines/property owner	AF50	Secondary	LOW	\$ -
OB115	Elizabeth Street	Ashfield	Regional Road		obstruction	overhanging vegetation - property	-33.8880294	151.1288656	1		notify busines/property owner	AF62	Primary	LOW	\$ -
OB116	Elizabeth Street	Ashfield	Regional Road		obstruction	overhanging vegetation - property	-33.8872713	151.126962	1		notify busines/property owner	AF52	Primary	LOW	\$ -
OB117	Elizabeth Street	Ashfield	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8882895	151.1292175	1		notify busines/property owner	AF63	Secondary	LOW	\$ -
OB118	Elizabeth Street	Ashfield	Regional Road		obstruction	power pole narrows footpath	-33.8884117	151.1293409	1		no action	AF63	Secondary	LOW	\$ -
OB119	Elizabeth Street	Ashfield	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8887258	151.1298493	1		notify busines/property owner	AF63	Secondary	LOW	\$ -
OB120	Elizabeth Street	Ashfield	Regional Road		obstruction	overhanging vegetation - property	-33.8888637	151.1303489	1		notify busines/property owner	AF64	Secondary	LOW	\$ -
OB121	Elizabeth Street	Ashfield	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8889881	151.1305897	1		notify busines/property owner	AF64	Secondary	LOW	\$ -
OB122	Elizabeth Street	Ashfield	Regional Road		obstruction	signpost narrows footpath	-33.8891645	151.1315099	1		relocate signpost	AF61	Secondary	LOW	\$ 300
OB123	Elizabeth Street	Ashfield	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.888224	151.1291669	1		notify busines/property owner	AF63	Secondary	LOW	\$ -
OB124	Frederick Street	Ashfield	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8824567	151.1214989	1		notify busines/property owner	AF74	Primary	LOW	\$ -
OB125	Frederick Street	Ashfield	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.880331	151.1231692	1		notify busines/property owner	AF71	Primary	LOW	\$ -
OB126	Frederick Street	Ashfield	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8771697	151.1292204	1		refer to maintenance	AF68	Primary	LOW	\$ -
OB127	Frederick Street	Ashfield	State Road	Strategic Route	obstruction	signposts narrows footpath	-33.8865916	151.1188383	1		relocate signpost	AF157	Secondary	LOW	\$ 300
OB128	Georges River Drive	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.890428	151.1170808	1		notify busines/property owner	AF114	Primary	LOW	\$ -
OB129	Georges River Drive	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8892839	151.1172267	1		notify busines/property owner	AF113	Primary	LOW	\$ -
OB130	Georges River Drive	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8890022	151.1172744	1		notify busines/property owner	AF112	Primary	LOW	\$ -
OB131	Georges River Drive	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8895768	151.1173151	1		refer to maintenance	AF113	Primary	LOW	\$ -
OB132	Georges River Drive	Ashfield	Local Road		obstruction	overgrown vegetation narrows footpath	-33.8898359	151.1173327	1		refer to maintenance	AF113	Primary	LOW	\$ -
OB133	Holden Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8919592	151.1253996	1		notify busines/property owner	AF86	Primary	LOW	\$ -
OB134	Holden Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8920591	151.1253965	1		notify busines/property owner	AF86	Primary	LOW	\$ -
OB135	Holden Street	Ashfield	Local Road		obstruction	overhanging vegetation	-33.8972604	151.1250348	1		refer to maintenance	AF83	Tertiary	LOW	\$ -
OB136	Holden Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.897375	151.125021	1		notify busines/property owner	AF83	Tertiary	LOW	\$ -
OB137	Holden Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8955721	151.1250789	1		notify busines/property owner	AF89	Secondary	LOW	\$ -
OB138	Holden Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8938274	151.1251576	1		notify busines/property owner	AF87	Secondary	LOW	\$ -
OB139	Liverpool Road	Ashfield	State Road	Strategic Route	obstruction	double pole signpost narrows footpath	-33.8899076	151.1310282	1		review and relocate double pole signpost	AF98	Primary	LOW	\$ 500
OB140	Liverpool Road	Ashfield	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8876164	151.121471	1		notify busines/property owner	AF106	Primary	LOW	\$ -

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
OB141	Milton Street	Ashfield	State Road		obstruction	overhanging vegetation	-33.8946282	151.11885	1		refer to maintenance	AF141	Tertiary	LOW	\$ -
OB142	Milton Street	Ashfield	State Road		obstruction	overhanging vegetation - property	-33.8941172	151.1178449	1		notify busines/property owner	AF140	Secondary	LOW	\$ -
OB143	Milton Street	Ashfield	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8944839	151.118235	1		notify busines/property owner	AF141	Tertiary	LOW	\$ -
OB144	Milton Street	Ashfield	State Road		obstruction	overhanging vegetation - property	-33.8947618	151.1188425	1		notify busines/property owner	AF141	Tertiary	LOW	\$ -
OB145	Milton Street	Ashfield	State Road		obstruction	power pole narrows footpath	-33.8949012	151.1190614	1		no action	AF141	Tertiary	LOW	\$ -
OB146	Milton Street	Ashfield	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8949729	151.1192022	1		notify busines/property owner	AF142	Secondary	LOW	\$ -
OB147	Norton Street	Ashfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8908771	151.1265299	1		notify busines/property owner	AF121	Primary	LOW	\$ -
OB148	Norton Street	Ashfield	Regional Road	Strategic Route	obstruction	power pole narrows footpath	-33.8903184	151.124906	1		no action	AF117	Primary	LOW	\$ -
OB149	Norton Street	Ashfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8901133	151.1242605	1		notify busines/property owner	AF120	Primary	LOW	\$ -
OB150	Norton Street	Ashfield	Regional Road	Strategic Route	obstruction	power pole narrows footpath	-33.8898343	151.1238121	1		no action	AF120	Primary	LOW	\$ -
OB151	Norton Street	Ashfield	Regional Road	Strategic Route	obstruction	power pole narrows footpath	-33.8897449	151.1235699	1		no action	AF120	Primary	LOW	\$ -
OB152	Norton Street	Ashfield	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8896416	151.1232105	1		notify busines/property owner	AF119	Primary	LOW	\$ -
OB153	Norton Street	Ashfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8894774	151.1228304	1		notify busines/property owner	AF119	Primary	LOW	\$ -
OB154	Norton Street	Ashfield	Regional Road	Strategic Route	obstruction	signpost narrows footpath	-33.8902767	151.1249805	1		relocate signpost	AF117	Primary	LOW	\$ 300
OB155	Norton Street	Ashfield	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8915358	151.1314959	1		notify busines/property owner	AF118	Primary	LOW	\$ -
OB156	Old Canterbury Road	Ashfield	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.9045888	151.128531	1		notify busines/property owner	AF130	Primary	LOW	\$ -
OB157	Old Canterbury Road	Ashfield	State Road		obstruction	overhanging vegetation	-33.9031032	151.129898	1		refer to maintenance	AF129	Primary	LOW	\$ -
OB158	Orpington Street	Ashfield	Local Road		obstruction	overhanging vegetation - property	-33.8855364	151.1319518	1		notify busines/property owner	AF136	Secondary	LOW	\$ -
OB159	Orpington Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.887778	151.1282044	1		notify busines/property owner	AF62	Primary	LOW	\$ -
OB160	Palace Street	Ashfield	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8948852	151.1194397	1		notify busines/property owner	AF142	Secondary	LOW	\$ -
OB161	Palace Street	Ashfield	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.894981	151.119999	1		notify busines/property owner	AF142	Secondary	LOW	\$ -
OB162	Palace Street	Ashfield	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8951367	151.122247	1		notify busines/property owner	AF139	Secondary	LOW	\$ -
OB163	Palace Street	Ashfield	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.895134	151.1221946	1		notify busines/property owner	AF139	Secondary	LOW	\$ -
OB164	Palace Street	Ashfield	Local Road	Strategic Route	obstruction	bench narrows footpath	-33.8951692	151.122516	1		relocate or remove bench	AF139	Secondary	LOW	\$ 400
OB165	Palace Street	Ashfield	Local Road	Strategic Route	obstruction	bus stop pole narrows footpath	-33.8951458	151.1225916	1		relocate bus stop pole	AF139	Secondary	LOW	\$ 400
OB166	Palace Street	Ashfield	Local Road	Strategic Route	obstruction	power pole narrows footpath	-33.8951334	151.1227035	1		no action	AF139	Secondary	LOW	\$ -
OB167	Palace Street	Ashfield	Local Road	Strategic Route	obstruction	overhanging vegetation - property	-33.895129	151.1238202	1		notify busines/property owner	AF144	Secondary	LOW	\$ -
OB168	Palace Street	Ashfield	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8950262	151.1240006	1		notify busines/property owner	AF144	Secondary	LOW	\$ -
OB169	Palace Street	Ashfield	Local Road	Strategic Route	obstruction	signpost narrows footpath	-33.8949221	151.1230985	1		relocate signpost	AF139	Secondary	LOW	\$ 300
OB170	Palace Street	Ashfield	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8949449	151.1208813	1		notify busines/property owner	AF143	Secondary	LOW	\$ -
OB171	Parramatta Road	Ashfield	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8790947	151.1309934	1		notify busines/property owner	HA68	Primary	LOW	\$ -
OB172	Queen Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8921661	151.1279582	1		notify busines/property owner	AF149	Secondary	LOW	\$ -
OB173	Queen Street	Ashfield	Local Road		obstruction	overhanging vegetation - property	-33.8914396	151.1278223	1		notify busines/property owner	AF154	Secondary	LOW	\$ -
OB174	Queen Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8933071	151.1277038	1		notify busines/property owner	AF153	Secondary	LOW	\$ -
OB175	Thomas Street	Ashfield	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8870896	151.120086	1		notify busines/property owner	AF156	Secondary	LOW	\$ -
OB176	Thomas Street	Ashfield	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8871515	151.1201317	1		notify busines/property owner	AF156	Secondary	LOW	\$ -
OB177	Victoria Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8924409	151.1301091	1		notify busines/property owner	AF162	Secondary	LOW	\$ -
OB178	Victoria Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8953415	151.1299449	1		refer to maintenance	AF159	Secondary	LOW	\$ -
OB179	Victoria Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8954504	151.1299354	1		refer to maintenance	AF159	Secondary	LOW	\$ -
OB180	Victoria Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8954504	151.1299354	1		refer to maintenance	AF159	Secondary	LOW	\$ -
OB181	Victoria Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8945043	151.1298049	1		notify busines/property owner	AF163	Secondary	LOW	\$ -
OB182	Victoria Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8934028	151.1299387	1		notify busines/property owner	AF163	Secondary	LOW	\$ -
OB183	Victoria Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8932062	151.129898	1		notify busines/property owner	AF162	Secondary	LOW	\$ -
OB184	Victoria Street	Ashfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8927346	151.1299306	1		notify busines/property owner	AF162	Secondary	LOW	\$ -
OB185	Victoria Street	Ashfield	Local Road		obstruction	overhanging vegetation - property	-33.8979912	151.129577	1		notify busines/property owner	AF166	Secondary	LOW	\$ -
OB186	Victoria Street	Ashfield	Local Road		obstruction	overhanging vegetation - property	-33.8997874	151.129427	1		notify busines/property owner	AF168	Secondary	LOW	\$ -
OB187	Victoria Street	Ashfield	Local Road		obstruction	overhanging vegetation - property	-33.9010448	151.1293508	1		notify busines/property owner	AF169	Secondary	LOW	\$ -
OB188	Victoria Street	Ashfield	Local Road		obstruction	overhanging vegetation - property	-33.9013593	151.1292866	1		notify busines/property owner	AF169	Secondary	LOW	\$ -
OB189	Victoria Street	Ashfield	Local Road		obstruction	overhanging vegetation - property	-33.9015687	151.1292758	1		notify busines/property owner	AF170	Secondary	LOW	\$ -
OB190	Beattie Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8579802	151.1800212	1		refer to maintenance	BA3	Secondary	LOW	\$ -
OB191	Beattie Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8586004	151.1780071	1		notify busines/property owner	BA7	Secondary	LOW	\$ -
OB192	Beattie Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8588281	151.1760096	1		refer to maintenance	BA1	Tertiary	LOW	\$ -
OB193	Beattie Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8587897	151.1758724	1		refer to maintenance	BA1	Tertiary	LOW	\$ -
OB194	Beattie Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8587532	151.1754018	1		notify busines/property owner	BA1	Tertiary	LOW	\$ -
OB195	Beattie Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8593924	151.1743282	1		notify busines/property owner	BA5	Secondary	LOW	\$ -
OB196	Beattie Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8594253	151.1742845	1		notify busines/property owner	BA5	Secondary	LOW	\$ -
OB197	Beattie Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8594985	151.174101	1		notify busines/property owner	BA5	Secondary	LOW	\$ -
OB198	Beattie Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8595274	151.1740249	1		refer to maintenance	BA5	Secondary	LOW	\$ -
OB199	Beattie Street	Balmain	Local Road		obstruction	overhanging vegetation - property	-33.8589205	151.1762011	1		notify busines/property owner	BA6	Secondary	LOW	\$ -
OB200	Beattie Street	Balmain	Local Road		obstruction	overhanging vegetation - property	-33.8589478	151.1763465	1		notify busines/property owner	BA6	Secondary	LOW	\$ -
OB201	Booth Street	Balmain	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8607453	151.1820567	1		refer to maintenance	BA14	Secondary	LOW	\$ -
OB202	Booth Street	Balmain	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8606448	151.1820265	1		notify busines/property owner	BA14	Secondary	LOW	\$ -
OB203	Booth Street	Balmain	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8602574	151.1819314	1		notify busines/property owner	BA14	Secondary	LOW	\$ -
OB204	Booth Street	Balmain	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8597	151.182186	1		notify busines/property owner	BA16	Primary	LOW	\$ -
OB205	Booth Street	Balmain	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8601492	151.1818053	1		notify busines/property owner	BA14	Secondary	LOW	\$ -
OB206	Booth Street	Balmain	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8598715	151.1819148	1		notify busines/property owner	BA16	Primary	LOW	\$ -
OB207	Bradford Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8604065	151.1821233	1		refer to maintenance	BA14	Secondary	LOW	\$ -
OB208	Buchanan Street	Balmain	Local Road		obstruction	overhanging vegetation	-33.8634924	151.1802981	1		refer to maintenance	BA17	Tertiary	LOW	\$ -
OB209	Buchanan Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8624008	151.1801699	1		notify busines/property owner	BA61	Secondary	LOW	\$ -
OB210	Buchanan Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.8626017	151.1802945	1		no action	BA18	Tertiary	LOW	\$ -
OB211	Buchanan Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.862552	151.180318	1		no action	BA18	Tertiary	LOW	\$ -
OB212	Buchanan Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.862736	151.1802543	1		no action	BA18	Tertiary	LOW	\$ -
OB213	Buchanan Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.8628199	151.1802342	1		no action	BA18	Tertiary	LOW	\$ -
OB214	Buchanan Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.8629009	151.1802597	1		no action	BA18	Tertiary	LOW	\$ -
OB215	Buchanan Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.8630725	151.1802646	1		no action	BA18	Tertiary	LOW	\$ -
OB216	Buchanan Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.8631217	151.1802879	1		no action	BA18	Tertiary	LOW	\$ -
OB217	Buchanan Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.8632025	151.180313	1		no action	BA17	Tertiary	LOW	\$ -
OB218	Buchanan Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.863446	151.1804843	1		no action	BA17	Tertiary	LOW	\$ -
OB219	Buchanan Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.8635629	151.1804797	1		no action	BA17	Tertiary	LOW	\$ -
OB220	Buchanan Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.8636189	151.180559	1		no action	BA17	Tertiary	LOW	\$ -
OB221	Buchanan Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8636012	151.1805659	1		refer to maintenance	BA17	Tertiary	LOW	\$ -
OB222	Curtis Road	Balmain	Local Road		obstruction	tree narrows footpath	-33.8576782	151.1835525	1		no action	BA20	Primary	LOW	\$ -

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
OB223	Curtis Road	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8576193	151.1835469	1		notify busines/property owner	BA20	Primary	LOW	\$ -
OB224	Curtis Road	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8570394	151.1831109	1		notify busines/property owner	BA21	Secondary	LOW	\$ -
OB225	Curtis Road	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8566072	151.1817939	1		notify busines/property owner	BA22	Secondary	LOW	\$ -
OB226	Curtis Road	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8560211	151.1810216	1		notify busines/property owner	BA22	Secondary	LOW	\$ -
OB227	Curtis Road	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8551644	151.1798832	1		notify busines/property owner	BA19	Secondary	LOW	\$ -
OB228	Curtis Road	Balmain	Local Road		obstruction	storefront narrows footpath - property	-33.8555067	151.180757	1		notify busines/property owner	BA23	Secondary	LOW	\$ -
OB229	Darling Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8560531	151.1737658	1		notify busines/property owner	BA35	Primary	LOW	\$ -
OB230	Darling Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8558881	151.1745387	1		notify busines/property owner	BA34	Primary	LOW	\$ -
OB231	Darling Street	Balmain	Local Road		obstruction	bench narrows footpath	-33.8558885	151.1752194	1		relocate or remove bench	BA34	Primary	LOW	\$ 400
OB232	Darling Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8563807	151.1774319	1		refer to maintenance	BA32	Primary	LOW	\$ -
OB233	Darling Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8560361	151.1753872	1		notify busines/property owner	BA34	Primary	LOW	\$ -
OB234	Darling Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8560381	151.1744106	1		notify busines/property owner	BA34	Primary	LOW	\$ -
OB235	Darling Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8562091	151.1737735	1		notify busines/property owner	BA35	Primary	LOW	\$ -
OB236	Darling Street	Balmain	Local Road		obstruction	bus shelter narrows footpath	-33.8562807	151.1735	1		relocate or remove bus shelter	BA35	Primary	LOW	\$ 5,000
OB237	Darling Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8571004	151.1725415	1		notify busines/property owner	BA36	Primary	LOW	\$ -
OB238	Darling Street	Balmain	Local Road		obstruction	storefront narrows footpath - property	-33.8567337	151.1793778	1		notify busines/property owner	BA31	Primary	LOW	\$ -
OB239	Darling Street	Balmain	Local Road		obstruction	signage narrows footpath - property	-33.8576737	151.1820775	1		notify business owner	BA29	Primary	LOW	\$ -
OB240	Darling Street	Balmain	Local Road		obstruction	footpath trading narrows footpath	-33.8577408	151.1824327	1		notify busines/property owner	BA29	Primary	LOW	\$ -
OB241	Darling Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8581664	151.1837673	1		notify busines/property owner	BA27	Primary	LOW	\$ -
OB242	Darling Street	Balmain	Local Road		obstruction	storefront narrows footpath - property	-33.8581723	151.1860895	1		notify busines/property owner	BA26	Primary	LOW	\$ -
OB243	Darling Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8581977	151.1866234	1		notify busines/property owner	BA26	Primary	LOW	\$ -
OB244	Darling Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8576219	151.1813102	1		refer to maintenance	BA29	Primary	LOW	\$ -
OB245	Darling Street	Balmain	Local Road		obstruction	storefront - property narrows footpath	-33.8577535	151.1820332	1		notify business owner	BA29	Primary	LOW	\$ -
OB246	Darvall Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8595538	151.1825386	1		notify busines/property owner	BA39	Primary	LOW	\$ -
OB247	Darvall Street	Balmain	Local Road		obstruction	overhanging vegetation - property	-33.8596036	151.183265	1		notify busines/property owner	BA39	Primary	LOW	\$ -
OB248	Darvall Street	Balmain	Local Road		obstruction	trees narrows footpath	-33.8595457	151.1835623	1		no action	BA39	Primary	LOW	\$ -
OB249	Eaton Street	Balmain	Local Road		obstruction	overhanging vegetation - property	-33.8585093	151.1837747	1		notify busines/property owner	BA40	Primary	LOW	\$ -
OB250	Hyam Street	Balmain	Local Road		obstruction	bollards narrows footpath	-33.8611901	151.1808595	1		relocate or remove bollard	BA42	Tertiary	LOW	\$ 2,500
OB251	Hyam Street	Balmain	Local Road		obstruction	light post narrows footpath	-33.8615181	151.180382	1		relocate light post	BA43	Secondary	LOW	\$ 10,000
OB252	Jane Street	Balmain	Local Road		obstruction	power pole narrows footpath	-33.8597666	151.184435	1		no action	BA45	Secondary	LOW	\$ -
OB253	Jane Street	Balmain	Local Road		obstruction	power pole narrows footpath	-33.8594879	151.1843882	1		no action	BA45	Secondary	LOW	\$ -
OB254	Jane Street	Balmain	Local Road		obstruction	power pole narrows footpath	-33.8589875	151.1843634	1		no action	BA44	Primary	LOW	\$ -
OB255	Jane Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8588238	151.1844563	1		notify busines/property owner	BA44	Primary	LOW	\$ -
OB256	Macquarie Terrace	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8541958	151.1780068	1		notify busines/property owner	BA46	Primary	LOW	\$ -
OB257	Macquarie Terrace	Balmain	Local Road		obstruction	power pole narrows footpath	-33.8541853	151.179887	1		no action	BA46	Primary	LOW	\$ -
OB258	Montague Street	Balmain	Local Road		obstruction	bike rack narrows footpath	-33.857093	151.1778368	1		relocate or remove bike rack	BA47	Secondary	LOW	\$ 250
OB259	Mullens Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8594008	151.1773485	1		refer to maintenance	BA49	Secondary	LOW	\$ -
OB260	Mullens Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8596977	151.17736	1		refer to maintenance	BA49	Secondary	LOW	\$ -
OB261	Mullens Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8605886	151.1772589	1		refer to maintenance	BA50	Primary	LOW	\$ -
OB262	Mullens Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8605251	151.177281	1		refer to maintenance	BA50	Primary	LOW	\$ -
OB263	Mullens Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8608057	151.1771682	1		notify busines/property owner	BA50	Primary	LOW	\$ -
OB264	Mullens Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8608448	151.1771028	1		refer to maintenance	BA50	Primary	LOW	\$ -
OB265	Mullens Street	Balmain	Local Road		obstruction	overhanging vegetation - property	-33.8619907	151.1764081	1		notify busines/property owner	BA51	Primary	LOW	\$ -
OB266	Mullens Street	Balmain	Local Road		obstruction	bin narrows footpath - council	-33.8613243	151.1767593	1		further investigation required	BA51	Primary	LOW	\$ -
OB267	Mullens Street	Balmain	Local Road		obstruction	bus shelter and signpost narrows footpath	-33.8627715	151.1764589	1		relocate or remove bus shelter and signpost	BA52	Primary	LOW	\$ 5,500
OB268	Mullens Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8622273	151.1764364	1		notify busines/property owner	BA52	Primary	LOW	\$ -
OB269	Mullens Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8622657	151.1764291	1		notify busines/property owner	BA52	Primary	LOW	\$ -
OB270	Palmer Street	Balmain	Local Road		obstruction	overhanging vegetation - property	-33.8606739	151.1814774	1		notify busines/property owner	BA54	Tertiary	LOW	\$ -
OB271	Palmer Street	Balmain	Local Road		obstruction	overhanging vegetation - property	-33.8606596	151.1814097	1		notify busines/property owner	BA54	Tertiary	LOW	\$ -
OB272	Palmer Street	Balmain	Local Road		obstruction	overhanging vegetation	-33.8604698	151.1811296	1		refer to maintenance	BA55	Secondary	LOW	\$ -
OB273	Palmer Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8603655	151.1810145	1		refer to maintenance	BA55	Secondary	LOW	\$ -
OB274	Palmer Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath - council and private	-33.8604603	151.1809815	1		refer to maintenance	BA55	Secondary	LOW	\$ -
OB275	Palmer Street	Balmain	Local Road		obstruction	overhanging vegetation	-33.8588658	151.180298	1		refer to maintenance	BA57	Secondary	LOW	\$ -
OB276	Palmer Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.8583114	151.180461	1		no action	BA53	Secondary	LOW	\$ -
OB277	Palmer Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.8596971	151.1805892	1		no action	BA56	Secondary	LOW	\$ -
OB278	Palmer Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8590963	151.1804697	1		refer to maintenance	BA57	Secondary	LOW	\$ -
OB279	Palmer Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8587469	151.1799195	1		refer to maintenance	BA57	Secondary	LOW	\$ -
OB280	Terry Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.8567837	151.171193	1		no action	BA69	Secondary	LOW	\$ -
OB281	Thames Street	Balmain	Local Road		obstruction	power pole narrows footpath	-33.855813	151.184879	1		no action	BA71	Secondary	LOW	\$ -
OB282	Wortley Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8610006	151.1784633	1		refer to maintenance	BA76	Secondary	LOW	\$ -
OB283	Wortley Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8609159	151.1785898	1		refer to maintenance	BA76	Secondary	LOW	\$ -
OB284	Wortley Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8607111	151.1788513	1		refer to maintenance	BA76	Secondary	LOW	\$ -
OB285	Wortley Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.8602635	151.1796469	1		no action	BA75	Tertiary	LOW	\$ -
OB286	Wortley Street	Balmain	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8603072	151.1792763	1		refer to maintenance	BA75	Tertiary	LOW	\$ -
OB287	Wortley Street	Balmain	Local Road		obstruction	trees narrows footpath	-33.86064	151.1787553	1		no action	BA76	Secondary	LOW	\$ -
OB288	Wortley Street	Balmain	Local Road		obstruction	trees narrows footpath	-33.8608795	151.1783477	1		no action	BA76	Secondary	LOW	\$ -
OB289	Wortley Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.861146	151.1778785	1		no action	BA59	Secondary	LOW	\$ -
OB290	Wortley Street	Balmain	Local Road		obstruction	tree narrows footpath	-33.8612739	151.1775714	1		no action	BA59	Secondary	LOW	\$ -
OB291	Darling Street	Balmain East	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8579634	151.1895633	1		notify busines/property owner	BA24	Secondary	LOW	\$ -
OB292	Darling Street	Balmain East	Local Road		obstruction	tree narrows footpath - property	-33.857517	151.1920966	1		notify property owner	BE3	Primary	LOW	\$ -
OB293	Louisa Road	Birchgrove	Local Road		obstruction	power pole narrows footpath	-33.8506088	151.1791398	1		no action	BI10	Tertiary	LOW	\$ -
OB294	Louisa Road	Birchgrove	Local Road		obstruction	power pole narrows footpath	-33.8501986	151.1794372	1		no action	BI10	Tertiary	LOW	\$ -
OB295	Louisa Road	Birchgrove	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8500436	151.1795421	1		notify busines/property owner	BI10	Tertiary	LOW	\$ -
OB296	Louisa Road	Birchgrove	Local Road		obstruction	power pole narrows footpath	-33.8494805	151.1800146	1		no action	BI11	Tertiary	LOW	\$ -
OB297	Louisa Road	Birchgrove	Local Road		obstruction	electricity box narrows footpath	-33.8492524	151.1801761	1		no action	BI9	Tertiary	LOW	\$ -
OB298	Louisa Road	Birchgrove	Local Road		obstruction	power pole narrows footpath	-33.8483176	151.1811077	1		no action	BI12	Tertiary	LOW	\$ -
OB299	Louisa Road	Birchgrove	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8482488	151.1812805	1		notify busines/property owner	BI12	Tertiary	LOW	\$ -
OB300	Louisa Road	Birchgrove	Local Road		obstruction	bollards narrows footpath	-33.8480393	151.1819834	1		relocate or remove bollard	BI6	Tertiary	LOW	\$ 2,500
OB301	Louisa Road	Birchgrove	Local Road		obstruction	bollard narrows footpath	-33.8479768	151.1822133	1		repair bollard	BI6	Tertiary	LOW	\$ 2,500
OB302	Louisa Road	Birchgrove	Local Road		obstruction	power pole narrows footpath	-33.8479192	151.182383	1		no action	BI6	Tertiary	LOW	\$ -
OB303	Louisa Road	Birchgrove	Local Road		obstruction	power pole narrows footpath	-33.8474872	151.1841208	1		no action	BI13	Tertiary	LOW	\$ -
OB304	Louisa Road	Birchgrove	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8471194	151.1849029	1		notify busines/property owner	BI14	Secondary	LOW	\$ -

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
OB305	Louisa Road	Birchgrove	Local Road		obstruction	bollard narrows footpath	-33.846821	151.1854249	1		relocate or remove bollard	BI7	Secondary	LOW	\$ 2,500
OB306	Louisa Road	Birchgrove	Local Road		obstruction	pot plants narrows footpath - property	-33.8479178	151.1824124	1		notify property owner	BI6	Tertiary	LOW	\$ -
OB307	Louisa Road	Birchgrove	Local Road		obstruction	power pole narrows footpath	-33.8492269	151.1801918	1		no action	BI9	Tertiary	LOW	\$ -
OB308	Rowntree Street	Birchgrove	Local Road		obstruction	vehicles narrows footpath	-33.8515849	151.1839276	1		no action	BI16	Tertiary	LOW	\$ -
OB309	Rowntree Street	Birchgrove	Local Road		obstruction	tree narrows footpath	-33.851713	151.1836036	1		no action	BI16	Tertiary	LOW	\$ -
OB310	Rowntree Street	Birchgrove	Local Road		obstruction	tree narrows footpath	-33.8517829	151.1834622	1		no action	BI16	Tertiary	LOW	\$ -
OB311	Rowntree Street	Birchgrove	Local Road		obstruction	tree narrows footpath	-33.8518201	151.183382	1		no action	BI16	Tertiary	LOW	\$ -
OB312	Rowntree Street	Birchgrove	Local Road		obstruction	tree narrows footpath	-33.8519695	151.1832604	1		no action	BI16	Tertiary	LOW	\$ -
OB313	Rowntree Street	Birchgrove	Local Road		obstruction	tree narrows footpath	-33.851984	151.1831159	1		no action	BI17	Tertiary	LOW	\$ -
OB314	Rowntree Street	Birchgrove	Local Road		obstruction	tree narrows footpath	-33.8521741	151.1829282	1		no action	BI17	Tertiary	LOW	\$ -
OB315	Australia Street	Camperdown	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8929466	151.1767085	1		notify busines/property owner	CA8	Secondary	LOW	\$ -
OB316	Hordern Place	Camperdown	Local Road		obstruction	vehicles narrows footpath	-33.8895707	151.1732791	1		no action	CA18	Secondary	LOW	\$ -
OB317	Church Street	Croydon	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8757641	151.122047	1		refer to maintenance	CR1	Secondary	LOW	\$ -
OB318	Church Street	Croydon	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8758608	151.1225656	1		refer to maintenance	CR1	Secondary	LOW	\$ -
OB319	Church Street	Croydon	Local Road		obstruction	overhanging vegetation narrows footpath	-33.876371	151.1235492	1		refer to maintenance	CR2	Secondary	LOW	\$ -
OB320	Croydon Road	Croydon	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.87351	151.1256147	1		notify busines/property owner	CR4	Secondary	LOW	\$ -
OB321	Croydon Road	Croydon	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8736548	151.1254741	1		refer to maintenance	CR4	Secondary	LOW	\$ -
OB322	Croydon Road	Croydon	Local Road	Strategic Route	obstruction	overhanging vegetation	-33.8813701	151.1194655	1		refer to maintenance	CR15	Secondary	LOW	\$ -
OB323	Croydon Road	Croydon	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8804723	151.1199153	1		refer to maintenance	CR3	Secondary	LOW	\$ -
OB324	Croydon Road	Croydon	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8794318	151.1206371	1		notify busines/property owner	CR14	Secondary	LOW	\$ -
OB325	Croydon Road	Croydon	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.876955	151.1223313	1		notify busines/property owner	CR9	Secondary	LOW	\$ -
OB326	Etonville Parade	Croydon	Local Road		obstruction	tree narrows footpath	-33.8835099	151.1192421	1		no action	CR20	Secondary	LOW	\$ -
OB327	Liverpool Road	Croydon	State Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8871339	151.1135478	1		notify busines/property owner	CR23	Primary	LOW	\$ -
OB328	Parramatta Road	Croydon	State Road	Strategic Route	obstruction	tree narrows footpath	-33.8742044	151.1274416	1		no action	CR33	Secondary	LOW	\$ -
OB329	Parramatta Road	Croydon	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8717498	151.1238072	1		notify busines/property owner	CR29	Secondary	LOW	\$ -
OB330	Parramatta Road	Croydon	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.871698	151.1236578	1		notify busines/property owner	CR28	Secondary	LOW	\$ -
OB331	Georges River Drive	Croydon Park	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.893618	151.1151704	1		notify busines/property owner	CP4	Tertiary	LOW	\$ -
OB332	Georges River Drive	Croydon Park	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8933284	151.1160136	1		notify busines/property owner	CP3	Secondary	LOW	\$ -
OB333	Georges River Drive	Croydon Park	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8934719	151.1161573	1		notify busines/property owner	CP2	Secondary	LOW	\$ -
OB334	Georges River Drive	Croydon Park	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8943702	151.1125413	1		notify busines/property owner	CP1	Secondary	LOW	\$ -
OB335	Georges River Drive	Croydon Park	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8938383	151.1140536	1		notify busines/property owner	CP5	Secondary	LOW	\$ -
OB336	Arlington Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9010191	151.1341177	1		notify busines/property owner	DH13	Tertiary	LOW	\$ -
OB337	Arlington Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9009738	151.1343993	1		notify busines/property owner	DH13	Tertiary	LOW	\$ -
OB338	Arlington Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9009087	151.1350566	1		notify busines/property owner	DH14	Tertiary	LOW	\$ -
OB339	Arlington Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9008261	151.1357239	1		notify busines/property owner	DH14	Tertiary	LOW	\$ -
OB340	Arlington Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9011166	151.1342486	1		notify busines/property owner	DH13	Tertiary	LOW	\$ -
OB341	Arlington Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9011619	151.1337371	1		notify busines/property owner	DH13	Tertiary	LOW	\$ -
OB342	Arlington Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9010026	151.1330187	1		notify busines/property owner	DH12	Secondary	LOW	\$ -
OB343	Bedford Crescent	Dulwich Hill	Local Road		obstruction	overhanging vegetation	-33.9097963	151.1399664	1		refer to maintenance	DH3	Secondary	LOW	\$ -
OB344	Bedford Crescent	Dulwich Hill	Local Road		obstruction	overhanging vegetation	-33.9105589	151.1408442	1		refer to maintenance	DH2	Secondary	LOW	\$ -
OB345	Bedford Crescent	Dulwich Hill	Local Road		obstruction	overhanging vegetation	-33.9104826	151.1406637	1		refer to maintenance	DH2	Secondary	LOW	\$ -
OB346	Bedford Crescent	Dulwich Hill	Local Road		obstruction	overhanging vegetation	-33.9103095	151.1403326	1		refer to maintenance	DH3	Secondary	LOW	\$ -
OB347	Blackwood Avenue	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9070341	151.1406042	1		notify busines/property owner	DH4	Secondary	LOW	\$ -
OB348	Blackwood Avenue	Dulwich Hill	Local Road		obstruction	overhanging vegetation - property	-33.9071463	151.1405126	1		notify busines/property owner	DH4	Secondary	LOW	\$ -
OB349	Blackwood Avenue	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9071887	151.1405695	1		notify busines/property owner	DH4	Secondary	LOW	\$ -
OB350	Blackwood Avenue	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9070958	151.1406707	1		notify busines/property owner	DH4	Secondary	LOW	\$ -
OB351	Challis Avenue	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9105323	151.1455201	1		notify busines/property owner	DH7	Tertiary	LOW	\$ -
OB352	Challis Avenue	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9103999	151.14526	1		notify busines/property owner	DH8	Secondary	LOW	\$ -
OB353	Consett Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9061448	151.1388257	1		notify busines/property owner	DH9	Secondary	LOW	\$ -
OB354	Constitution Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9025281	151.1380839	1		refer to maintenance	DH17	Secondary	LOW	\$ -
OB355	Constitution Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9025372	151.1383289	1		notify busines/property owner	DH17	Secondary	LOW	\$ -
OB356	Constitution Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9029262	151.1395357	1		notify busines/property owner	DH10	Primary	LOW	\$ -
OB357	Constitution Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9034116	151.1404554	1		notify busines/property owner	DH18	Secondary	LOW	\$ -
OB358	Constitution Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation	-33.9029937	151.1398163	1		refer to maintenance	DH10	Primary	LOW	\$ -
OB359	Constitution Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9025937	151.1391297	1		refer to maintenance	DH10	Primary	LOW	\$ -
OB360	Constitution Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9025353	151.1390211	1		refer to maintenance	DH10	Primary	LOW	\$ -
OB361	Davis Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8992894	151.140375	1		refer to maintenance	DH116	Secondary	LOW	\$ -
OB362	Davis Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8991366	151.1402083	1		refer to maintenance	DH116	Secondary	LOW	\$ -
OB363	Denison Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9025716	151.1396314	1		refer to maintenance	DH23	Primary	LOW	\$ -
OB364	Denison Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9024447	151.1396965	1		notify busines/property owner	DH23	Primary	LOW	\$ -
OB365	Denison Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9022253	151.1398721	1		notify busines/property owner	DH23	Primary	LOW	\$ -
OB366	Denison Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9020056	151.1400559	1		refer to maintenance	DH22	Primary	LOW	\$ -
OB367	Dulwich Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9024772	151.1410278	1		notify busines/property owner	DH25	Primary	LOW	\$ -
OB368	Dulwich Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9029788	151.1421377	1		notify busines/property owner	DH26	Primary	LOW	\$ -
OB369	Dulwich Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9026367	151.1414807	1		refer to maintenance	DH26	Primary	LOW	\$ -
OB370	Dulwich Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9022053	151.1407196	1		notify busines/property owner	DH25	Primary	LOW	\$ -
OB371	Ewart Street	Dulwich Hill	Local Road	Strategic Route	obstruction	power pole narrows footpath	-33.9095988	151.1371057	1		no action	DH32	Secondary	LOW	\$ -
OB372	Ewart Street	Dulwich Hill	Local Road	Strategic Route	obstruction	overhanging vegetation - property	-33.9097512	151.1372075	1		notify busines/property owner	DH32	Secondary	LOW	\$ -
OB373	Frazer Street	Dulwich Hill	Regional Road		obstruction	overhanging vegetation - property	-33.9009954	151.1473073	1		notify busines/property owner	DH36	Tertiary	LOW	\$ -
OB374	Frazer Street	Dulwich Hill	Regional Road		obstruction	overhanging vegetation - property	-33.9008987	151.1463412	1		notify busines/property owner	DH35	Tertiary	LOW	\$ -
OB375	Frazer Street	Dulwich Hill	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.9009071	151.1461552	1		notify busines/property owner	DH35	Tertiary	LOW	\$ -
OB376	Frazer Street	Dulwich Hill	Regional Road		obstruction	overhanging vegetation - property	-33.900808	151.1469234	1		notify busines/property owner	DH35	Tertiary	LOW	\$ -
OB377	Frazer Street	Dulwich Hill	Regional Road		obstruction	overhanging vegetation - property	-33.9008388	151.1474457	1		notify busines/property owner	DH36	Tertiary	LOW	\$ -
OB378	Grove Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9013339	151.1394373	1		refer to maintenance	DH61	Secondary	LOW	\$ -
OB379	Grove Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9014493	151.1393072	1		refer to maintenance	DH61	Secondary	LOW	\$ -
OB380	Grove Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9015709	151.1392664	1		refer to maintenance	DH61	Secondary	LOW	\$ -
OB381	Grove Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9016652	151.1391763	1		refer to maintenance	DH61	Secondary	LOW	\$ -
OB382	Grove Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9019508	151.1389041	1		refer to maintenance	DH60	Secondary	LOW	\$ -
OB383	Grove Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9022755	151.1387714	1		refer to maintenance	DH60	Secondary	LOW	\$ -
OB384	Grove Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9020862	151.1389873	1		refer to maintenance	DH60	Secondary	LOW	\$ -
OB385	Grove Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9017512	151.1391862	1		notify busines/property owner	DH60	Secondary	LOW	\$ -
OB386	Grove Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9013238	151.1395482	1		refer to maintenance	DH61	Secondary	LOW	\$ -

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
OB387	Grove Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9011798	151.1397284	1		refer to maintenance	DH61	Secondary	LOW	\$ -
OB388	Hampstead Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8985278	151.1380122	1		notify busines/property owner	DH63	Secondary	LOW	\$ -
OB389	Hampstead Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8986651	151.1383244	1		notify busines/property owner	DH63	Secondary	LOW	\$ -
OB390	Hampstead Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.898572	151.138218	1		notify busines/property owner	DH63	Secondary	LOW	\$ -
OB391	Hampstead Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8977812	151.1372059	1		notify busines/property owner	DH62	Secondary	LOW	\$ -
OB392	Hercules Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9072103	151.1389807	1		notify busines/property owner	DH65	Secondary	LOW	\$ -
OB393	Hercules Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9062848	151.1389032	1		notify busines/property owner	DH65	Secondary	LOW	\$ -
OB394	Hercules Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9062276	151.1389562	1		notify busines/property owner	DH65	Secondary	LOW	\$ -
OB395	Hercules Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9053879	151.1394306	1		notify busines/property owner	DH66	Secondary	LOW	\$ -
OB396	Hercules Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9051879	151.139581	1		notify busines/property owner	DH64	Secondary	LOW	\$ -
OB397	Hercules Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation - property	-33.9051879	151.139581	1		notify busines/property owner	DH64	Secondary	LOW	\$ -
OB398	Hercules Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9050519	151.1400468	1		notify busines/property owner	DH64	Secondary	LOW	\$ -
OB399	Hercules Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9062815	151.1390707	1		refer to maintenance	DH65	Secondary	LOW	\$ -
OB400	Hercules Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation - property	-33.9065217	151.1390347	1		notify busines/property owner	DH65	Secondary	LOW	\$ -
OB401	Hercules Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9068819	151.1389992	1		refer to maintenance	DH65	Secondary	LOW	\$ -
OB402	Hercules Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9085463	151.1386964	1		notify busines/property owner	DH53	Secondary	LOW	\$ -
OB403	Hercules Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9087402	151.1386737	1		notify busines/property owner	DH53	Secondary	LOW	\$ -
OB404	Hercules Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9073803	151.138942	1		notify busines/property owner	DH65	Secondary	LOW	\$ -
OB405	Hill Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9009279	151.1393621	1		refer to maintenance	DH68	Secondary	LOW	\$ -
OB406	Hill Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9007129	151.1390821	1		notify busines/property owner	DH68	Secondary	LOW	\$ -
OB407	Hill Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9004821	151.1389351	1		notify busines/property owner	DH68	Secondary	LOW	\$ -
OB408	Hill Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9001285	151.1391694	1		notify busines/property owner	DH67	Secondary	LOW	\$ -
OB409	Hill Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9003911	151.1391641	1		refer to maintenance	DH67	Secondary	LOW	\$ -
OB410	Hill Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.900929	151.139589	1		refer to maintenance	DH68	Secondary	LOW	\$ -
OB411	Hill Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9012368	151.1400065	1		refer to maintenance	DH69	Secondary	LOW	\$ -
OB412	Kintore Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation - property	-33.9051855	151.1403225	1		notify busines/property owner	DH72	Secondary	LOW	\$ -
OB413	Kintore Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9058942	151.1407167	1		notify busines/property owner	DH72	Secondary	LOW	\$ -
OB414	Kintore Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9060287	151.1407839	1		notify busines/property owner	DH74	Secondary	LOW	\$ -
OB415	Kintore Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9064978	151.141069	1		notify busines/property owner	DH74	Secondary	LOW	\$ -
OB416	Kintore Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation	-33.9068403	151.1413149	1		refer to maintenance	DH73	Secondary	LOW	\$ -
OB417	Kintore Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9066498	151.1413315	1		notify busines/property owner	DH73	Secondary	LOW	\$ -
OB418	Kintore Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9057937	151.1408364	1		notify busines/property owner	DH72	Secondary	LOW	\$ -
OB419	Kintore Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9055094	151.140686	1		notify busines/property owner	DH72	Secondary	LOW	\$ -
OB420	Kintore Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation - property	-33.9053356	151.1405938	1		notify busines/property owner	DH72	Secondary	LOW	\$ -
OB421	Marrickville Road	Dulwich Hill	Regional Road		obstruction	overhanging vegetation - property	-33.9061193	151.1452344	1		notify busines/property owner	DH77	Secondary	LOW	\$ -
OB422	Marrickville Road	Dulwich Hill	Regional Road		obstruction	overhanging vegetation - property	-33.9055797	151.1449334	1		notify busines/property owner	DH79	Primary	LOW	\$ -
OB423	Ness Avenue	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9107407	151.1368357	1		refer to maintenance	DH80	Tertiary	LOW	\$ -
OB424	Ness Avenue	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9102807	151.1374318	1		notify busines/property owner	DH110	Tertiary	LOW	\$ -
OB425	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	obstruction	overhanging vegetation - property	-33.9015217	151.144786	1		notify busines/property owner	DH93	Primary	LOW	\$ -
OB426	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9051269	151.1379748	1		notify busines/property owner	DH112	Secondary	LOW	\$ -
OB427	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	obstruction	overhanging vegetation - property	-33.905789	151.1361935	1		notify busines/property owner	DH86	Primary	LOW	\$ -
OB428	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	obstruction	overhanging vegetation - property	-33.9056437	151.1342373	1		notify busines/property owner	DH88	Secondary	LOW	\$ -
OB429	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9057416	151.134575	1		refer to maintenance	DH87	Primary	LOW	\$ -
OB430	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9055921	151.1363168	1		refer to maintenance	DH86	Primary	LOW	\$ -
OB431	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9053894	151.136789	1		refer to maintenance	DH85	Primary	LOW	\$ -
OB432	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	obstruction	overhanging vegetation - property	-33.9025356	151.1440564	1		notify busines/property owner	DH95	Primary	LOW	\$ -
OB433	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	obstruction	overhanging vegetation - property	-33.9012321	151.1446597	1		notify busines/property owner	DH93	Primary	LOW	\$ -
OB434	Old Canterbury Road	Dulwich Hill	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8959847	151.1381042	1		notify busines/property owner	SH56	Primary	LOW	\$ -
OB435	Old Canterbury Road	Dulwich Hill	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8968116	151.1369653	1		notify busines/property owner	SH57	Secondary	LOW	\$ -
OB436	Old Canterbury Road	Dulwich Hill	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8974822	151.1359938	1		notify busines/property owner	SH58	Secondary	LOW	\$ -
OB437	Old Canterbury Road	Dulwich Hill	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8982639	151.1348518	1		notify busines/property owner	SH59	Tertiary	LOW	\$ -
OB438	Old Canterbury Road	Dulwich Hill	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8986511	151.1342687	1		notify busines/property owner	SH60	Tertiary	LOW	\$ -
OB439	Old Canterbury Road	Dulwich Hill	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.9020212	151.1310356	1		notify busines/property owner	AF127	Secondary	LOW	\$ -
OB440	Old Canterbury Road	Dulwich Hill	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.9021355	151.1309455	1		notify busines/property owner	AF127	Secondary	LOW	\$ -
OB441	Piggott Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9009362	151.1413049	1		notify busines/property owner	DH104	Secondary	LOW	\$ -
OB442	Piggott Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9016007	151.1425174	1		notify busines/property owner	DH101	Secondary	LOW	\$ -
OB443	Piggott Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.902059	151.1432102	1		notify busines/property owner	DH105	Secondary	LOW	\$ -
OB444	Piggott Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9022183	151.1436297	1		notify busines/property owner	DH105	Secondary	LOW	\$ -
OB445	Piggott Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9003448	151.1402758	1		refer to maintenance	DH103	Secondary	LOW	\$ -
OB446	Piggott Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9007351	151.1409593	1		notify busines/property owner	DH103	Secondary	LOW	\$ -
OB447	Riverside Crescent	Dulwich Hill	Local Road		obstruction	bollards narrows footpath	-33.9126873	151.1382352	1		relocate or remove bollard	MV236	Secondary	LOW	\$ 2,500
OB448	Tennyson Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9109587	151.1368494	1		notify busines/property owner	DH38	Secondary	LOW	\$ -
OB449	Tennyson Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9111967	151.1367817	1		notify busines/property owner	DH38	Secondary	LOW	\$ -
OB450	Terrace Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9090358	151.1379043	1		notify busines/property owner	DH111	Tertiary	LOW	\$ -
OB451	Terrace Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9086772	151.1376944	1		notify busines/property owner	DH111	Tertiary	LOW	\$ -
OB452	Terrace Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9086021	151.1375859	1		notify busines/property owner	DH111	Tertiary	LOW	\$ -
OB453	Terrace Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9090255	151.1377231	1		refer to maintenance	DH111	Tertiary	LOW	\$ -
OB454	Terrace Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9092653	151.1380601	1		refer to maintenance	DH52	Secondary	LOW	\$ -
OB455	Terrace Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9074461	151.1376942	1		notify busines/property owner	DH113	Tertiary	LOW	\$ -
OB456	Terrace Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation	-33.90749	151.1378178	1		refer to maintenance	DH113	Tertiary	LOW	\$ -
OB457	Terrace Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation	-33.9078219	151.1377871	1		refer to maintenance	DH113	Tertiary	LOW	\$ -
OB458	Terrace Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation	-33.9083456	151.1375517	1		refer to maintenance	DH111	Tertiary	LOW	\$ -
OB459	Terrace Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9082285	151.137741	1		notify busines/property owner	DH113	Tertiary	LOW	\$ -
OB460	Terrace Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9083214	151.1377409	1		refer to maintenance	DH113	Tertiary	LOW	\$ -
OB461	Terrace Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9062243	151.1380004	1		notify busines/property owner	DH114	Secondary	LOW	\$ -
OB462	Terrace Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9060588	151.1379989	1		refer to maintenance	DH112	Secondary	LOW	\$ -
OB463	Terry Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8995192	151.1380208	1		notify busines/property owner	DH115	Secondary	LOW	\$ -
OB464	Terry Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8997664	151.1384981	1		refer to maintenance	DH115	Secondary	LOW	\$ -
OB465	Terry Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8995417	151.1379244	1		notify busines/property owner	DH115	Secondary	LOW	\$ -
OB466	Terry Road	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8994924	151.1378123	1		refer to maintenance	DH115	Secondary	LOW	\$ -
OB467	Wardell Road	Dulwich Hill	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.909172	151.143132	1		notify busines/property owner	DH126	Primary	LOW	\$ -
OB468	Wardell Road	Dulwich Hill	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.909972	151.1423089	1		notify busines/property owner	DH125	Primary	LOW	\$ -

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
OB469	Wardell Road	Dulwich Hill	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.9103785	151.1419688	1		notify busines/property owner	DH125	Primary	LOW	\$ -
OB470	Wardell Road	Dulwich Hill	Regional Road		obstruction	overhanging vegetation - property	-33.9108265	151.1414594	1		notify busines/property owner	DH124	Primary	LOW	\$ -
OB471	Weston Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8986051	151.1397504	1		refer to maintenance	DH117	Secondary	LOW	\$ -
OB472	Weston Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8981609	151.1402557	1		refer to maintenance	DH44	Secondary	LOW	\$ -
OB473	Weston Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8980508	151.1404179	1		notify busines/property owner	DH44	Secondary	LOW	\$ -
OB474	Weston Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8972457	151.1414498	1		notify busines/property owner	DH47	Secondary	LOW	\$ -
OB475	Weston Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8970237	151.1417274	1		refer to maintenance	DH46	Tertiary	LOW	\$ -
OB476	Weston Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8962844	151.1416772	1		notify busines/property owner	DH45	Secondary	LOW	\$ -
OB477	Weston Street	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8968128	151.1416658	1		refer to maintenance	DH46	Tertiary	LOW	\$ -
OB478	Williams Parade	Dulwich Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9026549	151.137307	1		refer to maintenance	DH127	Secondary	LOW	\$ -
OB479	Edgeware Road	Enmore	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.9000969	151.1714356	1		notify busines/property owner	EN1	Primary	LOW	\$ -
OB480	Edgeware Road	Enmore	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9012635	151.1715984	1		notify busines/property owner	EN2	Primary	LOW	\$ -
OB481	Edgeware Road	Enmore	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.9018898	151.1717333	1		notify busines/property owner	EN3	Primary	LOW	\$ -
OB482	Edgeware Road	Enmore	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9024918	151.1719769	1		notify busines/property owner	EN4	Secondary	LOW	\$ -
OB483	Edgeware Road	Enmore	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.9033246	151.1723316	1		notify busines/property owner	EN5	Secondary	LOW	\$ -
OB484	Edgeware Road	Enmore	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9036311	151.1725168	1		notify busines/property owner	EN5	Secondary	LOW	\$ -
OB485	Edgeware Road	Enmore	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.9036797	151.1725721	1		notify busines/property owner	EN5	Secondary	LOW	\$ -
OB486	Liberty Street	Enmore	Local Road		obstruction	empty tree pit narrows footpath	-33.8961034	151.1710277		2	widen footpath	EN11	Tertiary	LOW	\$ 400
OB487	Alt Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8783188	151.1329236	1		refer to maintenance	HA3	Tertiary	LOW	\$ -
OB488	Bland Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8792298	151.1340319	1		refer to maintenance	HA20	Secondary	LOW	\$ -
OB489	Bland Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8795665	151.1335161	1		notify busines/property owner	HA19	Secondary	LOW	\$ -
OB490	Bland Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8802435	151.13251	1		refer to maintenance	HA18	Secondary	LOW	\$ -
OB491	Bland Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8801777	151.1322648	1		refer to maintenance	AF29	Secondary	LOW	\$ -
OB492	Bland Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8796686	151.1330408	1		notify busines/property owner	HA18	Secondary	LOW	\$ -
OB493	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8707486	151.1452207	1		notify busines/property owner	HA22	Secondary	LOW	\$ -
OB494	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8709553	151.1449829	1		notify busines/property owner	HA22	Secondary	LOW	\$ -
OB495	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8711725	151.1448482	1		notify busines/property owner	HA22	Secondary	LOW	\$ -
OB496	Boomerang Street	Haberfield	Local Road		obstruction	comms pillar narrows footpath	-33.8736209	151.143176	1		no action	HA26	Secondary	LOW	\$ -
OB497	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation	-33.8737797	151.1431454	1		refer to maintenance	HA27	Secondary	LOW	\$ -
OB498	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.8739155	151.1430966	1		notify busines/property owner	HA27	Secondary	LOW	\$ -
OB499	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8741865	151.1430105	1		notify busines/property owner	HA27	Secondary	LOW	\$ -
OB500	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.8746565	151.1427605	1		notify busines/property owner	HA27	Secondary	LOW	\$ -
OB501	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.874813	151.1426629	1		notify busines/property owner	HA25	Secondary	LOW	\$ -
OB502	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.875434	151.142108	1		notify busines/property owner	HA106	Secondary	LOW	\$ -
OB503	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation	-33.8751678	151.1422233	1		refer to maintenance	HA25	Secondary	LOW	\$ -
OB504	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation	-33.8749972	151.1423024	1		refer to maintenance	HA25	Secondary	LOW	\$ -
OB505	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation	-33.8748436	151.1423913	1		refer to maintenance	HA25	Secondary	LOW	\$ -
OB506	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.8744735	151.1426673	1		notify busines/property owner	HA27	Secondary	LOW	\$ -
OB507	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation	-33.8742188	151.1427955	1		refer to maintenance	HA27	Secondary	LOW	\$ -
OB508	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.8740333	151.1428558	1		notify busines/property owner	HA27	Secondary	LOW	\$ -
OB509	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation	-33.87388	151.142899	1		refer to maintenance	HA27	Secondary	LOW	\$ -
OB510	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.8737328	151.1429366	1		notify busines/property owner	HA27	Secondary	LOW	\$ -
OB511	Boomerang Street	Haberfield	Local Road		obstruction	overhanging vegetation	-33.8729791	151.1433433	1		refer to maintenance	HA26	Secondary	LOW	\$ -
OB512	Dalhousie Street	Haberfield	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8778788	151.1406117	1		notify busines/property owner	HA32	Primary	LOW	\$ -
OB513	Dalhousie Street	Haberfield	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8817804	151.1379966	1		notify busines/property owner	HA36	Primary	LOW	\$ -
OB514	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation	-33.8805255	151.1356372	1		refer to maintenance	HA43	Secondary	LOW	\$ -
OB515	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation	-33.8804454	151.1355808	1		refer to maintenance	HA43	Secondary	LOW	\$ -
OB516	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation	-33.8807109	151.1358334	1		refer to maintenance	HA42	Secondary	LOW	\$ -
OB517	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.8812974	151.1364634	1		notify busines/property owner	HA42	Secondary	LOW	\$ -
OB518	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8814423	151.1366128	1		notify busines/property owner	HA41	Secondary	LOW	\$ -
OB519	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.8815744	151.1367594	1		notify busines/property owner	HA41	Secondary	LOW	\$ -
OB520	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation	-33.8815819	151.1367794	1		refer to maintenance	HA41	Secondary	LOW	\$ -
OB521	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8817325	151.1369332	1		refer to maintenance	HA41	Secondary	LOW	\$ -
OB522	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.8818023	151.1369826	1		notify busines/property owner	HA41	Secondary	LOW	\$ -
OB523	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation	-33.8818008	151.137028	1		refer to maintenance	HA41	Secondary	LOW	\$ -
OB524	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.8818639	151.1370593	1		notify busines/property owner	HA41	Secondary	LOW	\$ -
OB525	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.8820014	151.1372275	1		notify busines/property owner	HA41	Secondary	LOW	\$ -
OB526	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.8819469	151.1373931	1		notify busines/property owner	HA41	Secondary	LOW	\$ -
OB527	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.8819646	151.1373976	1		notify busines/property owner	HA41	Secondary	LOW	\$ -
OB528	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8819061	151.13732	1		refer to maintenance	HA41	Secondary	LOW	\$ -
OB529	Denman Avenue	Haberfield	Local Road		obstruction	signpost narrows footpath	-33.8815106	151.1369151	1		relocate signpost	HA41	Secondary	LOW	\$ 300
OB530	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation	-33.8814673	151.1368886	1		refer to maintenance	HA41	Secondary	LOW	\$ -
OB531	Denman Avenue	Haberfield	Local Road		obstruction	overhanging vegetation	-33.8813663	151.136764	1		refer to maintenance	HA41	Secondary	LOW	\$ -
OB532	Hawthorn Parade	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8857538	151.1442245	1		notify busines/property owner	HA56	Secondary	LOW	\$ -
OB533	Hawthorn Parade	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8849334	151.1441244	1		notify busines/property owner	HA56	Secondary	LOW	\$ -
OB534	Hawthorn Parade	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.8851255	151.1439659	1		notify busines/property owner	HA56	Secondary	LOW	\$ -
OB535	Hawthorn Parade	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8869598	151.1441357	1		refer to maintenance	HA55	Secondary	LOW	\$ -
OB536	Hawthorn Parade	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.885667	151.1440746	1		refer to maintenance	HA56	Secondary	LOW	\$ -
OB537	Hawthorn Parade	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8866425	151.1439867	1		refer to maintenance	HA55	Secondary	LOW	\$ -
OB538	Hawthorn Parade	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8799151	151.1459645	1		refer to maintenance	HA50	Secondary	LOW	\$ -
OB539	Marion Street	Haberfield	Regional Road	Strategic Route	obstruction	overhanging vegetation	-33.8840686	151.1446373	1		refer to maintenance	HA54	Primary	LOW	\$ -
OB540	Mortley Avenue	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.8720737	151.1431169	1		notify busines/property owner	HA63	Secondary	LOW	\$ -
OB541	Mortley Avenue	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.870926	151.1419812	1		refer to maintenance	HA62	Secondary	LOW	\$ -
OB542	Parramatta Road	Haberfield	State Road	Strategic Route	obstruction	signposts narrows footpath	-33.8746863	151.1281848	1		relocate signpost	HA80	Secondary	LOW	\$ 300
OB543	Parramatta Road	Haberfield	State Road	Strategic Route	obstruction	light post narrows footpath	-33.8765948	151.1296482	1		relocate light post	HA82	Primary	LOW	\$ 10,000
OB544	Parramatta Road	Haberfield	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8832028	151.1341736	1		notify busines/property owner	HA71	Primary	LOW	\$ -
OB545	Ramsay Street	Haberfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.882598	151.1404576	1		notify busines/property owner	HA95	Primary	LOW	\$ -
OB546	Ramsay Street	Haberfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8851712	151.1425669	1		notify busines/property owner	HA91	Secondary	LOW	\$ -
OB547	Ramsay Street	Haberfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8849548	151.1424018	1		refer to maintenance	HA91	Secondary	LOW	\$ -
OB548	Ramsay Street	Haberfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8850641	151.1426735	1		notify busines/property owner	HA91	Secondary	LOW	\$ -
OB549	Ramsay Street	Haberfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8850641	151.1426735	1		notify busines/property owner	HA91	Secondary	LOW	\$ -
OB550	Ramsay Street	Haberfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8867641	151.1428502	1		notify busines/property owner	HA99	Tertiary	LOW	\$ -

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
OB551	Ramsay Street	Haberfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8871047	151.1424439	1		notify busines/property owner	HA100	Secondary	LOW	\$ -
OB552	Ramsay Street	Haberfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8740518	151.1335944	1		notify busines/property owner	HA98	Secondary	LOW	\$ -
OB553	Ramsay Street	Haberfield	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8737681	151.1334321	1		notify busines/property owner	HA96	Secondary	LOW	\$ -
OB554	Ramsay Street	Haberfield	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8735933	151.1334329	1		notify busines/property owner	HA96	Secondary	LOW	\$ -
OB555	Ramsay Street	Haberfield	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8739099	151.1337109	1		notify busines/property owner	HA98	Secondary	LOW	\$ -
OB556	Ramsay Street	Haberfield	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.874891	151.1344028	1		notify busines/property owner	HA97	Secondary	LOW	\$ -
OB557	Ramsay Street	Haberfield	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8747627	151.1341673	1		notify busines/property owner	HA97	Secondary	LOW	\$ -
OB558	Ramsay Street	Haberfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8746097	151.1340506	1		notify busines/property owner	HA97	Secondary	LOW	\$ -
OB559	Sloane Street	Haberfield	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8864278	151.1429781	1		notify busines/property owner	HA99	Tertiary	LOW	\$ -
OB560	Waratah Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8744067	151.1395293	1		refer to maintenance	HA108	Secondary	LOW	\$ -
OB561	Waratah Street	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.873891	151.1382702	1		notify busines/property owner	HA101	Secondary	LOW	\$ -
OB562	Waratah Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8736386	151.1377687	1		notify busines/property owner	HA109	Tertiary	LOW	\$ -
OB563	Waratah Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8736313	151.1377018	1		refer to maintenance	HA109	Tertiary	LOW	\$ -
OB564	Waratah Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.873708	151.1374961	1		notify busines/property owner	HA109	Tertiary	LOW	\$ -
OB565	Waratah Street	Haberfield	Local Road		obstruction	overhanging vegetation - property	-33.8739424	151.1378815	1		notify busines/property owner	HA109	Tertiary	LOW	\$ -
OB566	Waratah Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8743603	151.1390037	1		refer to maintenance	HA101	Secondary	LOW	\$ -
OB567	Waratah Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8758847	151.1426584	1		notify busines/property owner	HA105	Secondary	LOW	\$ -
OB568	Waratah Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8758267	151.142729	1		refer to maintenance	HA105	Secondary	LOW	\$ -
OB569	Waratah Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8766775	151.1446192	1		notify busines/property owner	HA103	Tertiary	LOW	\$ -
OB570	Waratah Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8766208	151.1449717	1		refer to maintenance	HA103	Tertiary	LOW	\$ -
OB571	Waratah Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8749741	151.140947	1		notify busines/property owner	HA107	Secondary	LOW	\$ -
OB572	Waratah Street	Haberfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8749662	151.1407723	1		notify busines/property owner	HA107	Secondary	LOW	\$ -
OB573	Hardy Street	Hurlstone Park	Local Road		obstruction	overhanging vegetation narrows footpath	-33.90623	151.1236742	1		refer to maintenance	HP2	Secondary	LOW	\$ -
OB574	Hardy Street	Hurlstone Park	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9060739	151.1237959	1		notify busines/property owner	HP2	Secondary	LOW	\$ -
OB575	Hardy Street	Hurlstone Park	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9057562	151.1239636	1		refer to maintenance	HP2	Secondary	LOW	\$ -
OB576	Hardy Street	Hurlstone Park	Local Road		obstruction	overhanging vegetation narrows footpath	-33.905457	151.124148	1		refer to maintenance	HP1	Secondary	LOW	\$ -
OB577	Allen Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8802988	151.1483633	1		notify busines/property owner	LH2	Secondary	LOW	\$ -
OB578	Allen Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.880389	151.1486573	1		refer to maintenance	LH2	Secondary	LOW	\$ -
OB579	Allen Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8804011	151.1527912	1		notify busines/property owner	LH6	Secondary	LOW	\$ -
OB580	Allen Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8803405	151.1532282	1		notify busines/property owner	LH6	Secondary	LOW	\$ -
OB581	Allen Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8803195	151.1535036	1		refer to maintenance	LH7	Secondary	LOW	\$ -
OB582	Allen Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8799889	151.1553401	1		refer to maintenance	LH1	Secondary	LOW	\$ -
OB583	Allen Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8799889	151.1553401	1		refer to maintenance	LH1	Secondary	LOW	\$ -
OB584	Balmain Road	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8800233	151.159283	1		notify busines/property owner	LH11	Primary	LOW	\$ -
OB585	Balmain Road	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8809673	151.1590294	1		notify busines/property owner	LH10	Primary	LOW	\$ -
OB586	Balmain Road	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8822861	151.1589434	1		notify busines/property owner	LH21	Primary	LOW	\$ -
OB587	Balmain Road	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8832198	151.1590666	1		notify busines/property owner	LH17	Primary	LOW	\$ -
OB588	Darley Road	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath	-33.8750817	151.1553009	1		refer to maintenance	LH114	Primary	LOW	\$ -
OB589	Darley Road	Leichhardt	State Road		obstruction	signpost narrows footpath	-33.875379	151.1551797	1		relocate signpost	LF59	Secondary	LOW	\$ 300
OB590	Darley Road	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath	-33.8755031	151.1539339	1		refer to maintenance	LH32	Secondary	LOW	\$ -
OB591	Darley Road	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath	-33.8752836	151.1548551	1		refer to maintenance	LH31	Secondary	LOW	\$ -
OB592	Darley Road	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8755209	151.1525629	1		notify busines/property owner	LH33	Secondary	LOW	\$ -
OB593	Darley Road	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath	-33.8755604	151.1523805	1		refer to maintenance	LH34	Secondary	LOW	\$ -
OB594	Darley Road	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath	-33.8756046	151.1522864	1		refer to maintenance	LH34	Secondary	LOW	\$ -
OB595	Darley Road	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8757451	151.1514467	1		notify busines/property owner	LH35	Secondary	LOW	\$ -
OB596	Darley Road	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8769807	151.1496364	1		notify busines/property owner	LH37	Secondary	LOW	\$ -
OB597	Darley Road	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath	-33.8774442	151.149054	1		refer to maintenance	LH38	Secondary	LOW	\$ -
OB598	Darley Road	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8777797	151.148713	1		notify busines/property owner	LH39	Secondary	LOW	\$ -
OB599	Darley Road	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8779448	151.1484743	1		notify busines/property owner	LH39	Secondary	LOW	\$ -
OB600	Darley Road	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath	-33.8789806	151.1480959	1		refer to maintenance	LH40	Secondary	LOW	\$ -
OB601	Darley Road	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath	-33.8790985	151.1478414	1		refer to maintenance	LH40	Secondary	LOW	\$ -
OB602	Darley Road	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8794073	151.1477961	1		notify busines/property owner	LH30	Secondary	LOW	\$ -
OB603	Darley Road	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8808231	151.1476971	1		notify busines/property owner	LH69	Secondary	LOW	\$ -
OB604	Darley Road	Leichhardt	State Road		obstruction	bollard narrows footpath	-33.8802674	151.1475211	1		relocate bollard	LH30	Secondary	LOW	\$ 2,500
OB605	Derbyshire Road	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8806703	151.1587173	1		refer to maintenance	LH44	Primary	LOW	\$ -
OB606	Elswick Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8824481	151.1520916	1		notify busines/property owner	LH45	Tertiary	LOW	\$ -
OB607	Elswick Street	Leichhardt	Local Road		obstruction	overhanging vegetation - property	-33.8871362	151.1528173	1		notify busines/property owner	LH54	Tertiary	LOW	\$ -
OB608	Elswick Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8883667	151.1530544	1		refer to maintenance	LH53	Secondary	LOW	\$ -
OB609	Elswick Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8817977	151.1528645	1		notify busines/property owner	LH51	Tertiary	LOW	\$ -
OB610	Elswick Street	Leichhardt	Local Road		obstruction	overhanging vegetation - property	-33.8810565	151.151924	1		notify busines/property owner	LH50	Tertiary	LOW	\$ -
OB611	Elswick Street	Leichhardt	Local Road		obstruction	structure narrows footpath	-33.8866751	151.1530294	1		re-align kerb and footpath	LH53	Secondary	LOW	\$ 7,500
OB612	Elswick Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8819283	151.1519144	1		refer to maintenance	LH51	Tertiary	LOW	\$ -
OB613	Elswick Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8834154	151.1519109	1		refer to maintenance	LH52	Secondary	LOW	\$ -
OB614	Elswick Street	Leichhardt	Local Road		obstruction	overhanging vegetation - property	-33.8879785	151.1528062	1		notify busines/property owner	LH54	Tertiary	LOW	\$ -
OB615	Elswick Street	Leichhardt	Local Road		obstruction	overhanging vegetation	-33.8868962	151.1525191	1		refer to maintenance	LH55	Tertiary	LOW	\$ -
OB616	Elswick Street	Leichhardt	Local Road		obstruction	vehicle narrows footpath	-33.8858128	151.1522571	1		no action	LH56	Tertiary	LOW	\$ -
OB617	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8795459	151.1519585	1		refer to maintenance	LH48	Secondary	LOW	\$ -
OB618	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8781211	151.1519621	1		refer to maintenance	LH47	Secondary	LOW	\$ -
OB619	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8877886	151.1494214	1		notify busines/property owner	LH58	Tertiary	LOW	\$ -
OB620	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8881868	151.1494799	1		refer to maintenance	LH58	Tertiary	LOW	\$ -
OB621	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8876593	151.1495933	1		refer to maintenance	LH60	Secondary	LOW	\$ -
OB622	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8867714	151.1497243	1		refer to maintenance	LH59	Secondary	LOW	\$ -
OB623	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8864816	151.1498518	1		refer to maintenance	LH59	Secondary	LOW	\$ -
OB624	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation - property	-33.8861591	151.1498379	1		notify busines/property owner	LH59	Secondary	LOW	\$ -
OB625	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8783406	151.1501942	1		notify busines/property owner	LH63	Tertiary	LOW	\$ -
OB626	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8786811	151.1501944	1		notify busines/property owner	LH63	Tertiary	LOW	\$ -
OB627	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8788435	151.1501854	1		notify busines/property owner	LH63	Tertiary	LOW	\$ -
OB628	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8791725	151.1501729	1		notify busines/property owner	LH64	Secondary	LOW	\$ -
OB629	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8798575	151.1501188	1		notify busines/property owner	LH64	Secondary	LOW	\$ -
OB630	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation - property	-33.879998	151.1501156	1		notify busines/property owner	LH64	Secondary	LOW	\$ -
OB631	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8809459	151.1501475	1		notify busines/property owner	LH65	Secondary	LOW	\$ -
OB632	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation	-33.8812693	151.1501294	1		refer to maintenance	LH65	Secondary	LOW	\$ -

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
OB633	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8816877	151.1501047	1		refer to maintenance	LH66	Tertiary	LOW	\$ -
OB634	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8817588	151.1501315	1		refer to maintenance	LH66	Tertiary	LOW	\$ -
OB635	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation - property	-33.8826032	151.1501109	1		notify busines/property owner	LH66	Tertiary	LOW	\$ -
OB636	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation	-33.8827992	151.1500958	1		refer to maintenance	LH66	Tertiary	LOW	\$ -
OB637	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation - property	-33.8833196	151.1500948	1		notify busines/property owner	LH67	Secondary	LOW	\$ -
OB638	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8852246	151.15006	1		refer to maintenance	LH62	Secondary	LOW	\$ -
OB639	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation	-33.8849437	151.1500418	1		refer to maintenance	LH62	Secondary	LOW	\$ -
OB640	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.883612	151.1499259	1		refer to maintenance	LH67	Secondary	LOW	\$ -
OB641	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8832839	151.1499337	1		notify busines/property owner	LH67	Secondary	LOW	\$ -
OB642	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8830425	151.1499278	1		refer to maintenance	LH67	Secondary	LOW	\$ -
OB643	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation - property	-33.8827531	151.1499544	1		notify busines/property owner	LH66	Tertiary	LOW	\$ -
OB644	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.882298	151.1499349	1		refer to maintenance	LH66	Tertiary	LOW	\$ -
OB645	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8822489	151.1499824	1		notify busines/property owner	LH66	Tertiary	LOW	\$ -
OB646	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation - property	-33.881921	151.1499586	1		notify busines/property owner	LH66	Tertiary	LOW	\$ -
OB647	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation - property	-33.8815035	151.1499608	1		notify busines/property owner	LH65	Secondary	LOW	\$ -
OB648	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8792481	151.150016	1		notify busines/property owner	LH64	Secondary	LOW	\$ -
OB649	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation - property	-33.8786817	151.1499899	1		notify busines/property owner	LH63	Tertiary	LOW	\$ -
OB650	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8781924	151.1499923	1		notify busines/property owner	LH63	Tertiary	LOW	\$ -
OB651	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation - property	-33.8778229	151.1500168	1		notify busines/property owner	LH63	Tertiary	LOW	\$ -
OB652	Flood Street	Leichhardt	Local Road		obstruction	overhanging vegetation	-33.8777928	151.1500193	1		refer to maintenance	LH63	Tertiary	LOW	\$ -
OB653	Foster Street	Leichhardt	State Road		obstruction	overhanging vegetation - property	-33.8808466	151.1475449	1		notify busines/property owner	LH69	Secondary	LOW	\$ -
OB654	Foster Street	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8811218	151.1475445	1		notify busines/property owner	LH69	Secondary	LOW	\$ -
OB655	Foster Street	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8820464	151.1475419	1		notify busines/property owner	LH70	Secondary	LOW	\$ -
OB656	Foster Street	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath	-33.8824088	151.1475426	1		refer to maintenance	LH70	Secondary	LOW	\$ -
OB657	Foster Street	Leichhardt	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.885053	151.1475746	1		notify busines/property owner	LH68	Primary	LOW	\$ -
OB658	Greenway	Leichhardt	Local Road	Strategic Route	obstruction	overgrown vegetation narrows footpath	-33.8865556	151.1447264	1		refer to maintenance	LH76	Tertiary	LOW	\$ -
OB659	Hawthorne Light Rail St	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8795598	151.1470885	1		refer to maintenance	LH79	Secondary	LOW	\$ -
OB660	Hawthorne Light Rail St	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8800035	151.146971	1		refer to maintenance	LH81	Secondary	LOW	\$ -
OB661	Lords Road	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.885829	151.1492897	1		refer to maintenance	LH89	Primary	LOW	\$ -
OB662	Lords Road	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8862885	151.1458011	1		refer to maintenance	LH86	Secondary	LOW	\$ -
OB663	Lords Road	Leichhardt	Local Road		obstruction	overhanging vegetation - property	-33.8858354	151.1481201	1		notify busines/property owner	LH88	Secondary	LOW	\$ -
OB664	Lords Road	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8860079	151.1468172	1		refer to maintenance	LH87	Secondary	LOW	\$ -
OB665	Lords Road	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8861841	151.1459087	1		notify busines/property owner	LH86	Secondary	LOW	\$ -
OB666	Mackenzie Street	Leichhardt	Local Road		obstruction	signpost narrows footpath	-33.8837185	151.1612966	1		relocate signpost	LH90	Secondary	LOW	\$ 300
OB667	Mackenzie Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8837959	151.1612448	1		notify busines/property owner	LH90	Secondary	LOW	\$ -
OB668	Marion Street	Leichhardt	Regional Road	Strategic Route	obstruction	signpost narrows footpath	-33.883726	151.1566376	1		relocate signpost	LH101	Primary	LOW	\$ 300
OB669	Marion Street	Leichhardt	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8839215	151.1557662	1		notify busines/property owner	LH91	Primary	LOW	\$ -
OB670	Marion Street	Leichhardt	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8839865	151.1552555	1		notify busines/property owner	LH91	Primary	LOW	\$ -
OB671	Marion Street	Leichhardt	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8839608	151.1548796	1		notify busines/property owner	LH91	Primary	LOW	\$ -
OB672	Marion Street	Leichhardt	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8841339	151.1521949	1		notify busines/property owner	LH98	Secondary	LOW	\$ -
OB673	Marion Street	Leichhardt	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8841072	151.1494867	1		notify busines/property owner	LH95	Primary	LOW	\$ -
OB674	Marion Street	Leichhardt	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8841823	151.1448445	1		notify busines/property owner	HA61	Primary	LOW	\$ -
OB675	Marion Street	Leichhardt	Regional Road	Strategic Route	obstruction	signpost narrows footpath	-33.8842347	151.1447124	1		relocate signpost	HA61	Primary	LOW	\$ 300
OB676	Marion Street	Leichhardt	Regional Road	Strategic Route	obstruction	bus shelter narrows footpath	-33.8840845	151.1471869	1		relocate or remove bus shelter	LH93	Primary	LOW	\$ 5,000
OB677	Moore Street	Leichhardt	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8786523	151.1613956	1		notify busines/property owner	LH104	Secondary	LOW	\$ -
OB678	Norton Street	Leichhardt	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8869019	151.157415	1		refer to maintenance	LH115	Primary	LOW	\$ -
OB679	Norton Street	Leichhardt	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8865064	151.1573615	1		refer to maintenance	LH116	Secondary	LOW	\$ -
OB680	Norton Street	Leichhardt	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8854206	151.1571854	1		refer to maintenance	LH117	Primary	LOW	\$ -
OB681	Norton Street	Leichhardt	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8806487	151.1565935	1		refer to maintenance	LH122	Primary	LOW	\$ -
OB682	Norton Street	Leichhardt	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8795719	151.1564317	1		refer to maintenance	LH123	Primary	LOW	\$ -
OB683	Norton Street	Leichhardt	Regional Road	Strategic Route	obstruction	damaged bollard narrows footpath	-33.8772888	151.1563453	1		repair bollard	LH170	Secondary	LOW	\$ 2,500
OB684	Norton Street	Leichhardt	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8760607	151.1562479	1		refer to maintenance	LH127	Primary	LOW	\$ -
OB685	Norton Street	Leichhardt	Regional Road	Strategic Route	obstruction	bus shelter and signpost narrows footpath	-33.8756261	151.1561723	1		relocate signpost	LH127	Primary	LOW	\$ 300
OB686	Norton Street	Leichhardt	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8757271	151.1559802	1		notify busines/property owner	LH127	Primary	LOW	\$ -
OB687	Parramatta Road	Leichhardt	State Road	Strategic Route	obstruction	double pole signpost narrows footpath	-33.8893621	151.1509055	1		review and relocate double pole signpost	LH136	Primary	LOW	\$ 500
OB688	Styles Street	Leichhardt	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8826553	151.1664018	1		notify busines/property owner	AN33	Tertiary	LOW	\$ -
OB689	Styles Street	Leichhardt	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8830931	151.1632375	1		notify busines/property owner	LH152	Secondary	LOW	\$ -
OB690	Styles Street	Leichhardt	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8830665	151.1637687	1		notify busines/property owner	LH148	Secondary	LOW	\$ -
OB691	Styles Street	Leichhardt	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8829651	151.1644591	1		notify busines/property owner	LH148	Secondary	LOW	\$ -
OB692	Styles Street	Leichhardt	Regional Road		obstruction	overhanging vegetation narrows footpath	-33.8827315	151.1663458	1		refer to maintenance	AN33	Tertiary	LOW	\$ -
OB693	Styles Street	Leichhardt	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8830263	151.1640839	1		notify busines/property owner	LH148	Secondary	LOW	\$ -
OB694	Styles Street	Leichhardt	Regional Road		obstruction	power pole narrows footpath	-33.8829967	151.1643611	1		no action	LH148	Secondary	LOW	\$ -
OB695	Styles Street	Leichhardt	Regional Road		obstruction	power pole narrows footpath	-33.8826984	151.1661063	1		no action	LH150	Secondary	LOW	\$ -
OB696	Styles Street	Leichhardt	Regional Road		obstruction	power pole narrows footpath	-33.8826908	151.1658844	1		no action	LH150	Secondary	LOW	\$ -
OB697	Styles Street	Leichhardt	Regional Road		obstruction	power pole narrows footpath	-33.8827766	151.1655008	1		no action	LH150	Secondary	LOW	\$ -
OB698	Styles Street	Leichhardt	Regional Road		obstruction	power pole narrows footpath	-33.8828098	151.1651935	1		no action	LH151	Secondary	LOW	\$ -
OB699	Styles Street	Leichhardt	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8828187	151.1652037	1		notify busines/property owner	LH151	Secondary	LOW	\$ -
OB700	Styles Street	Leichhardt	Regional Road		obstruction	power pole narrows footpath	-33.8829217	151.1644746	1		no action	LH148	Secondary	LOW	\$ -
OB701	Tebutt Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8890184	151.1469066	1		notify busines/property owner	LH156	Secondary	LOW	\$ -
OB702	Tebutt Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8890195	151.147055	1		notify busines/property owner	LH155	Secondary	LOW	\$ -
OB703	Tebutt Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8879361	151.147312	1		notify busines/property owner	LH154	Secondary	LOW	\$ -
OB704	Tebutt Street	Leichhardt	Local Road		obstruction	overhanging vegetation - property	-33.887791	151.1473658	1		notify busines/property owner	LH154	Secondary	LOW	\$ -
OB705	White Creek	Leichhardt	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8852736	151.1647631	1		notify busines/property owner	LH160	Secondary	LOW	\$ -
OB706	White Creek	Leichhardt	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8850787	151.164802	1		notify busines/property owner	LH160	Secondary	LOW	\$ -
OB707	White Creek	Leichhardt	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8853834	151.164761	1		notify busines/property owner	LH159	Secondary	LOW	\$ -
OB708	White Creek	Leichhardt	Local Road	Strategic Route	obstruction	vehicles narrows footpath	-33.8864831	151.1637827	1		no action	LH158	Secondary	LOW	\$ -
OB709	White Creek Lane	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8813507	151.1665671	1		notify busines/property owner	LH166	Secondary	LOW	\$ -
OB710	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.877364	151.1572892	1		refer to maintenance	LH170	Secondary	LOW	\$ -
OB711	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8773343	151.1575434	1		refer to maintenance	LH170	Secondary	LOW	\$ -
OB712	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8773343	151.1576466	1		refer to maintenance	LH169	Secondary	LOW	\$ -
OB713	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8773401	151.1577518	1		refer to maintenance	LH169	Secondary	LOW	\$ -
OB714	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation	-33.8773421	151.1578134	1		refer to maintenance	LH169	Secondary	LOW	\$ -

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
OB715	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8773436	151.1579325	1		refer to maintenance	LH169	Secondary	LOW	\$ -
OB716	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation	-33.8772308	151.1582351	1		refer to maintenance	LH169	Secondary	LOW	\$ -
OB717	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation	-33.8772458	151.1578997	1		refer to maintenance	LH169	Secondary	LOW	\$ -
OB718	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.87726	151.1572554	1		notify busines/property owner	LH170	Secondary	LOW	\$ -
OB719	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.87766	151.1524755	1		notify busines/property owner	LH174	Secondary	LOW	\$ -
OB720	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8776658	151.1523345	1		notify busines/property owner	LH174	Secondary	LOW	\$ -
OB721	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8779323	151.1511715	1		notify busines/property owner	LH173	Secondary	LOW	\$ -
OB722	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8779155	151.1510578	1		notify busines/property owner	LH173	Secondary	LOW	\$ -
OB723	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation	-33.8779107	151.1509665	1		refer to maintenance	LH173	Secondary	LOW	\$ -
OB724	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8776268	151.1499194	1		refer to maintenance	LH172	Secondary	LOW	\$ -
OB725	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation	-33.8775012	151.1496204	1		refer to maintenance	LH172	Secondary	LOW	\$ -
OB726	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8773895	151.1495201	1		notify busines/property owner	LH172	Secondary	LOW	\$ -
OB727	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8773099	151.1496841	1		refer to maintenance	LH172	Secondary	LOW	\$ -
OB728	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8774106	151.1498394	1		notify busines/property owner	LH172	Secondary	LOW	\$ -
OB729	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation	-33.8775515	151.1500661	1		refer to maintenance	LH172	Secondary	LOW	\$ -
OB730	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation - property	-33.8778277	151.150542	1		notify busines/property owner	LH172	Secondary	LOW	\$ -
OB731	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8777992	151.151267	1		refer to maintenance	LH173	Secondary	LOW	\$ -
OB732	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8777335	151.1515971	1		refer to maintenance	LH173	Secondary	LOW	\$ -
OB733	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation	-33.8773293	151.1557373	1		refer to maintenance	LH175	Secondary	LOW	\$ -
OB734	William Street	Leichhardt	Local Road		obstruction	overhanging vegetation	-33.8773049	151.1558628	1		refer to maintenance	LH175	Secondary	LOW	\$ -
OB735	Carrington Road	Lewisham	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8914021	151.1478828	1		refer to maintenance	LW28	Secondary	LOW	\$ -
OB736	Carrington Street	Lewisham	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8908282	151.1478587	1		notify busines/property owner	LW28	Secondary	LOW	\$ -
OB737	Frazer Street	Lewisham	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.9009884	151.1488641	1		notify busines/property owner	DH37	Tertiary	LOW	\$ -
OB738	New Canterbury Road	Lewisham	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8970649	151.1477338	1		refer to maintenance	LW13	Primary	LOW	\$ -
OB739	New Canterbury Road	Lewisham	State Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8973633	151.1475246	1		notify busines/property owner	LW13	Primary	LOW	\$ -
OB740	New Canterbury Road	Lewisham	State Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8976765	151.1471676	1		notify busines/property owner	LW13	Primary	LOW	\$ -
OB741	New Canterbury Road	Lewisham	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8983688	151.146304	1		refer to maintenance	LW15	Primary	LOW	\$ -
OB742	New Canterbury Road	Lewisham	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8989151	151.1456109	1		notify busines/property owner	LW16	Primary	LOW	\$ -
OB743	New Canterbury Road	Lewisham	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8991254	151.1453822	1		refer to maintenance	LW16	Primary	LOW	\$ -
OB744	New Canterbury Road	Lewisham	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8985639	151.1491495	1		refer to maintenance	LW39	Secondary	LOW	\$ -
OB745	Thomas Street	Lewisham	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8919677	151.1476874	1		notify busines/property owner	LW33	Primary	LOW	\$ -
OB746	Thomas Street	Lewisham	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8932332	151.1480294	1		refer to maintenance	LW34	Primary	LOW	\$ -
OB747	Toothill Street	Lewisham	Regional Road		obstruction	double pole signpost narrows footpath	-33.8970201	151.1465329	1		review and relocate double pole signp	LW35	Secondary	LOW	\$ 500
OB748	Toothill Street	Lewisham	Regional Road		obstruction	signposts narrow footpath	-33.897168	151.1466927	1		relocate signpost	LW35	Secondary	LOW	\$ 300
OB749	Toothill Street	Lewisham	Regional Road		obstruction	double pole signpost narrows footpath	-33.8971479	151.1467119	1		review and relocate double pole signp	LW35	Secondary	LOW	\$ 500
OB750	Trafalgar Street	Lewisham	Regional Road		obstruction	power pole narrows footpath	-33.8930899	151.1458857	1		no action	LW18	Secondary	LOW	\$ -
OB751	Trafalgar Street	Lewisham	Regional Road		obstruction	overhanging vegetation narrows footpath	-33.892952	151.1456557	1		refer to maintenance	LW22	Primary	LOW	\$ -
OB752	Trafalgar Street	Lewisham	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8936958	151.1483381	1		notify busines/property owner	LW34	Primary	LOW	\$ -
OB753	Balmain Road	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8760892	151.1607991	1		notify busines/property owner	LH15	Secondary	LOW	\$ -
OB754	Balmain Road	Lilyfield	Local Road		obstruction	power pole narrows footpath	-33.876182	151.1607346	1		no action	LH15	Secondary	LOW	\$ -
OB755	Balmain Road	Lilyfield	Local Road		obstruction	power pole narrows footpath	-33.8662508	151.1662947	1		no action	LF3	Primary	LOW	\$ -
OB756	Balmain Road	Lilyfield	Local Road		obstruction	power pole narrows footpath	-33.8709589	151.161142	1		no action	LF7	Primary	LOW	\$ -
OB757	Balmain Road	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8705429	151.161463	1		notify busines/property owner	LF8	Secondary	LOW	\$ -
OB758	Balmain Road	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8702713	151.1617439	1		notify busines/property owner	LF8	Secondary	LOW	\$ -
OB759	Balmain Road	Lilyfield	Local Road		obstruction	power pole narrows footpath	-33.8695139	151.1625612	1		no action	LF2	Primary	LOW	\$ -
OB760	Balmain Road	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8733338	151.1602267	1		refer to maintenance	LF9	Primary	LOW	\$ -
OB761	Bay Run	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8722321	151.1511349	1		refer to maintenance	LF13	Tertiary	LOW	\$ -
OB762	Bay Run	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8722826	151.1512526	1		notify busines/property owner	LF13	Tertiary	LOW	\$ -
OB763	Bay Run	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8720392	151.1514349	1		refer to maintenance	LF12	Secondary	LOW	\$ -
OB764	Bay Run	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8672402	151.1522615	1		refer to maintenance	LF24	Secondary	LOW	\$ -
OB765	Catherine Street	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8760509	151.1648416	1		notify busines/property owner	LF40	Primary	LOW	\$ -
OB766	City West Link Bridge	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8745869	151.1548864	1		refer to maintenance	LF59	Secondary	LOW	\$ -
OB767	Darley Road	Lilyfield	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8753823	151.1526465	1		notify busines/property owner	LH33	Secondary	LOW	\$ -
OB768	Glover Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8697795	151.1566849	1		notify busines/property owner	LF50	Secondary	LOW	\$ -
OB769	Glover Street	Lilyfield	Local Road		obstruction	overhanging vegetation - property	-33.8698778	151.1566056	1		notify busines/property owner	LF50	Secondary	LOW	\$ -
OB770	Grove Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8715606	151.1640795	1		refer to maintenance	LF55	Tertiary	LOW	\$ -
OB771	Grove Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8721519	151.1643199	1		notify busines/property owner	LF55	Tertiary	LOW	\$ -
OB772	Grove Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8723224	151.164373	1		notify busines/property owner	LF54	Secondary	LOW	\$ -
OB773	Grove Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8727787	151.1645414	1		notify busines/property owner	LF54	Secondary	LOW	\$ -
OB774	Grove Street	Lilyfield	Local Road		obstruction	signpost narrows footpath	-33.8696187	151.1635042	1		relocate signpost	LF53	Secondary	LOW	\$ 300
OB775	Grove Street	Lilyfield	Local Road		obstruction	signpost narrows footpath	-33.8692129	151.1632571	1		relocate signpost	LF53	Secondary	LOW	\$ 300
OB776	Grove Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8699357	151.1635364	1		notify busines/property owner	LF53	Secondary	LOW	\$ -
OB777	Grove Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8702334	151.1636081	1		refer to maintenance	LF56	Tertiary	LOW	\$ -
OB778	Grove Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8710707	151.1639169	1		refer to maintenance	LF56	Tertiary	LOW	\$ -
OB779	James Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8740118	151.1551682	1		notify busines/property owner	LF58	Secondary	LOW	\$ -
OB780	James Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8737754	151.1551375	1		notify busines/property owner	LF58	Secondary	LOW	\$ -
OB781	James Street	Lilyfield	Local Road		obstruction	overhanging vegetation - property	-33.8738799	151.1551441	1		notify busines/property owner	LF58	Secondary	LOW	\$ -
OB782	James Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8741942	151.1552022	1		refer to maintenance	LF58	Secondary	LOW	\$ -
OB783	James Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8744407	151.155054	1		notify busines/property owner	LF59	Secondary	LOW	\$ -
OB784	James Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8741891	151.1550276	1		notify busines/property owner	LF58	Secondary	LOW	\$ -
OB785	James Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.874027	151.1550071	1		refer to maintenance	LF58	Secondary	LOW	\$ -
OB786	James Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8738788	151.1549942	1		refer to maintenance	LF58	Secondary	LOW	\$ -
OB787	James Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.873584	151.1549508	1		notify busines/property owner	LF58	Secondary	LOW	\$ -
OB788	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8720958	151.1682033	1		notify busines/property owner	LF74	Secondary	LOW	\$ -
OB789	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8731873	151.1650511	1		refer to maintenance	LF71	Secondary	LOW	\$ -
OB790	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8731362	151.1653645	1		refer to maintenance	LF71	Secondary	LOW	\$ -
OB791	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	power pole narrows footpath	-33.8727447	151.1671174	1		no action	LF73	Secondary	LOW	\$ -
OB792	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8726525	151.1674746	1		refer to maintenance	LF73	Secondary	LOW	\$ -
OB793	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	double pole signpost narrows footpath	-33.8719861	151.1687703	1		relocate signpost	LF75	Secondary	LOW	\$ 300
OB794	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	power pole narrows path	-33.8717753	151.1692205	1		no action	LF75	Secondary	LOW	\$ -
OB795	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8734214	151.1637028	1		refer to maintenance	LF68	Primary	LOW	\$ -
OB796	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	signposts narrows footpath	-33.8732169	151.1643385	1		relocate signpost	LF68	Primary	LOW	\$ 300

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
OB797	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	double pole signpost narrows footpath	-33.8736055	151.163396	1		review and relocate double pole signpost	LF68	Primary	LOW	\$ 500
OB798	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8737386	151.1629337	1		refer to maintenance	LF70	Primary	LOW	\$ -
OB799	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8738571	151.1623455	1		refer to maintenance	LF70	Primary	LOW	\$ -
OB800	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	power pole narrows footpath	-33.8739137	151.1621215	1		no action	LF70	Primary	LOW	\$ -
OB801	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8743149	151.1603957	1		notify busines/property owner	LF64	Secondary	LOW	\$ -
OB802	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.874273	151.1579704	1		notify busines/property owner	LF67	Secondary	LOW	\$ -
OB803	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8743971	151.1583216	1		notify busines/property owner	LF67	Secondary	LOW	\$ -
OB804	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8741848	151.1575623	1		refer to maintenance	LF66	Secondary	LOW	\$ -
OB805	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8738809	151.1564544	1		notify busines/property owner	LF65	Primary	LOW	\$ -
OB806	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8738386	151.1563373	1		notify busines/property owner	LF65	Primary	LOW	\$ -
OB807	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8734686	151.1548886	1		notify busines/property owner	LF63	Primary	LOW	\$ -
OB808	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8731808	151.153884	1		notify busines/property owner	LF60	Secondary	LOW	\$ -
OB809	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8731349	151.1537546	1		refer to maintenance	LF60	Secondary	LOW	\$ -
OB810	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8727457	151.1523681	1		notify busines/property owner	LF61	Secondary	LOW	\$ -
OB811	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8723217	151.1515119	1		refer to maintenance	LF13	Tertiary	LOW	\$ -
OB812	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8732534	151.1546551	1		refer to maintenance	LF63	Primary	LOW	\$ -
OB813	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8735651	151.1556962	1		notify busines/property owner	LF65	Primary	LOW	\$ -
OB814	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8738894	151.1569341	1		notify busines/property owner	LF66	Secondary	LOW	\$ -
OB815	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation	-33.8739983	151.1572947	1		refer to maintenance	LF66	Secondary	LOW	\$ -
OB816	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation	-33.8743003	151.1584466	1		refer to maintenance	LF67	Secondary	LOW	\$ -
OB817	Lilyfield Road	Lilyfield	Regional Road	Strategic Route	obstruction	overhanging vegetation	-33.8743003	151.1585451	1		refer to maintenance	LF67	Secondary	LOW	\$ -
OB818	Mary Street	Lilyfield	Local Road		obstruction	overhanging vegetation - property	-33.8708982	151.1546039	1		notify busines/property owner	LF85	Tertiary	LOW	\$ -
OB819	Mary Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8727222	151.1557181	1		notify busines/property owner	LF79	Secondary	LOW	\$ -
OB820	Perry Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8723275	151.1565664	1		refer to maintenance	LF87	Secondary	LOW	\$ -
OB821	Piper Street	Lilyfield	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8767632	151.1659906	1		notify busines/property owner	LF95	Tertiary	LOW	\$ -
OB822	Piper Street	Lilyfield	Local Road		obstruction	power pole narrows footpath	-33.8757816	151.161782	1		no action	LF90	Tertiary	LOW	\$ -
OB823	Albermarle Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9115392	151.1455367	1		refer to maintenance	MV13	Tertiary	LOW	\$ -
OB824	Albermarle Street	Marrickville	Local Road		obstruction	overhanging vegetation - property	-33.9115059	151.1451861	1		notify busines/property owner	MV13	Tertiary	LOW	\$ -
OB825	Albermarle Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9115706	151.1453291	1		refer to maintenance	MV13	Tertiary	LOW	\$ -
OB826	Albermarle Street	Marrickville	Local Road		obstruction	overhanging vegetation	-33.9124947	151.1467973	1		refer to maintenance	MV12	Secondary	LOW	\$ -
OB827	Beauchamp Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9146564	151.1430987	1		refer to maintenance	MV16	Secondary	LOW	\$ -
OB828	Beauchamp Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9137168	151.1461638	1		notify busines/property owner	MV14	Secondary	LOW	\$ -
OB829	Byrnes Street	Marrickville	Local Road		obstruction	power pole narrows footpath	-33.9137235	151.1553875	1		no action	MV188	Secondary	LOW	\$ -
OB830	Calvert Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9126572	151.1569807	1		notify busines/property owner	MV21	Secondary	LOW	\$ -
OB831	Calvert Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9130121	151.1575705	1		refer to maintenance	MV19	Secondary	LOW	\$ -
OB832	Calvert Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9131515	151.1578431	1		notify busines/property owner	MV19	Secondary	LOW	\$ -
OB833	Calvert Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9133687	151.1582645	1		notify busines/property owner	MV22	Secondary	LOW	\$ -
OB834	Calvert Street	Marrickville	Local Road		obstruction	overhanging vegetation - property	-33.9134904	151.1584761	1		notify busines/property owner	MV22	Secondary	LOW	\$ -
OB835	Calvert Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9135468	151.1588396	1		refer to maintenance	MV22	Secondary	LOW	\$ -
OB836	Calvert Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.913007	151.1578101	1		notify busines/property owner	MV19	Secondary	LOW	\$ -
OB837	Calvert Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9128716	151.1575357	1		refer to maintenance	MV19	Secondary	LOW	\$ -
OB838	Calvert Street	Marrickville	Local Road		obstruction	overhanging vegetation - property	-33.9122779	151.15643	1		notify busines/property owner	MV21	Secondary	LOW	\$ -
OB839	Calvert Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9119415	151.1559232	1		notify busines/property owner	MV20	Secondary	LOW	\$ -
OB840	Calvert Street	Marrickville	Local Road		obstruction	overhanging vegetation - property	-33.9118437	151.1557464	1		notify busines/property owner	MV20	Secondary	LOW	\$ -
OB841	Calvert Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9117085	151.1555334	1		refer to maintenance	MV20	Secondary	LOW	\$ -
OB842	Calvert Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9121462	151.1561493	1		notify busines/property owner	MV20	Secondary	LOW	\$ -
OB843	Carrington Road	Marrickville	Local Road		obstruction	overhanging vegetation - property	-33.9163908	151.1580553	1		notify busines/property owner	MV26	Tertiary	LOW	\$ -
OB844	Chapel Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9055809	151.1622874	1		notify busines/property owner	MV31	Secondary	LOW	\$ -
OB845	Chapel Street	Marrickville	Local Road		obstruction	double pole signpost narrows footpath	-33.9059475	151.1628763	1		review and relocate double pole signpost	MV32	Secondary	LOW	\$ 500
OB846	Edgeware Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.9052588	151.1733492	1		notify busines/property owner	NE24	Primary	LOW	\$ -
OB847	Edinburgh Road	Marrickville	Local Road		obstruction	tree narrows footpath	-33.9078805	151.1705412	1		no action	MV58	Secondary	LOW	\$ -
OB848	Edinburgh Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9080461	151.1706293	1		notify busines/property owner	MV58	Secondary	LOW	\$ -
OB849	Edinburgh Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.907463	151.1696848	1		notify busines/property owner	MV57	Secondary	LOW	\$ -
OB850	Edinburgh Road	Marrickville	Local Road		obstruction	bollards narrows footpath	-33.90706	151.1691234		2	widen footpath	MV56	Secondary	LOW	\$ 400
OB851	Edinburgh Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9057768	151.1674419	1		refer to maintenance	MV54	Tertiary	LOW	\$ -
OB852	Elizabeth Street	Marrickville	Regional Road		obstruction	overhanging vegetation - property	-33.9090067	151.162856	1		notify busines/property owner	MV210	Secondary	LOW	\$ -
OB853	Ewart Street	Marrickville	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9122944	151.1403115	1		notify busines/property owner	MV66	Primary	LOW	\$ -
OB854	Ewart Street	Marrickville	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9140427	151.1421579	1		notify busines/property owner	MV68	Secondary	LOW	\$ -
OB855	Ewart Street	Marrickville	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9142484	151.1424057	1		notify busines/property owner	MV68	Secondary	LOW	\$ -
OB856	Fitzroy Street	Marrickville	Local Road		obstruction	power pole narrows footpath	-33.9081948	151.1673237	1		no action	MV71	Tertiary	LOW	\$ -
OB857	Fitzroy Street	Marrickville	Local Road		obstruction	power pole narrows footpath	-33.9095696	151.1657289	1		no action	MV69	Tertiary	LOW	\$ -
OB858	Fitzroy Street	Marrickville	Local Road		obstruction	vehicle narrows footpath	-33.9119209	151.1659112	1		no action	MV204	Secondary	LOW	\$ -
OB859	Fitzroy Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9069962	151.1684747	1		notify busines/property owner	MV70	Tertiary	LOW	\$ -
OB860	Frazer Street	Marrickville	Regional Road		obstruction	overhanging vegetation	-33.9012932	151.1529778	1		refer to maintenance	MV75	Secondary	LOW	\$ -
OB861	Frazer Street	Marrickville	Regional Road		obstruction	overhanging vegetation - property	-33.9011885	151.1505753	1		notify busines/property owner	MV76	Secondary	LOW	\$ -
OB862	Frazer Street	Marrickville	Regional Road		obstruction	overhanging vegetation - property	-33.9011188	151.1493852	1		notify busines/property owner	PE20	Secondary	LOW	\$ -
OB863	Frazer Street	Marrickville	Regional Road		obstruction	overhanging vegetation - property	-33.9010992	151.1493588	1		notify busines/property owner	PE20	Secondary	LOW	\$ -
OB864	Frazer Street	Marrickville	Regional Road		obstruction	overhanging vegetation narrows footpath	-33.9010028	151.1500249	1		refer to maintenance	PE20	Secondary	LOW	\$ -
OB865	Frazer Street	Marrickville	Regional Road		obstruction	overhanging vegetation narrows footpath	-33.90103	151.1503218	1		refer to maintenance	MV76	Secondary	LOW	\$ -
OB866	Frazer Street	Marrickville	Regional Road		obstruction	overhanging vegetation narrows footpath	-33.901051	151.150767	1		refer to maintenance	MV76	Secondary	LOW	\$ -
OB867	Frazer Street	Marrickville	Regional Road		obstruction	overhanging vegetation	-33.901063	151.1512095	1		refer to maintenance	MV77	Secondary	LOW	\$ -
OB868	Frazer Street	Marrickville	Regional Road		obstruction	overhanging vegetation - property	-33.901189	151.1530187	1		notify busines/property owner	MV75	Secondary	LOW	\$ -
OB869	Hawkshurst Street	Marrickville	Local Road		obstruction	overhanging vegetation	-33.9055978	151.1538876	1		refer to maintenance	MV78	Secondary	LOW	\$ -
OB870	Hawkshurst Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9051032	151.1554659	1		notify busines/property owner	MV29	Secondary	LOW	\$ -
OB871	Hawkshurst Street	Marrickville	Local Road		obstruction	overhanging vegetation	-33.9046547	151.1562622	1		refer to maintenance	MV29	Secondary	LOW	\$ -
OB872	Hawkshurst Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9053925	151.1552745	1		refer to maintenance	MV29	Secondary	LOW	\$ -
OB873	Hawkshurst Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9057743	151.1546807	1		notify busines/property owner	MV78	Secondary	LOW	\$ -
OB874	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9073476	151.1594169	1		notify busines/property owner	MV82	Secondary	LOW	\$ -
OB875	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9069551	151.1597737	1		notify busines/property owner	MV82	Secondary	LOW	\$ -
OB876	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9069657	151.1595969	1		notify busines/property owner	MV82	Secondary	LOW	\$ -
OB877	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9068867	151.1596618	1		notify busines/property owner	MV82	Secondary	LOW	\$ -
OB878	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9060107	151.1604226	1		notify busines/property owner	MV84	Secondary	LOW	\$ -

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
OB879	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9059141	151.1605077	1		notify busines/property owner	MV84	Secondary	LOW	\$ -
OB880	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9045992	151.1617404	1		refer to maintenance	MV79	Secondary	LOW	\$ -
OB881	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9045662	151.1615656	1		notify busines/property owner	MV79	Secondary	LOW	\$ -
OB882	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9044644	151.1618457	1		notify busines/property owner	MV79	Secondary	LOW	\$ -
OB883	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9039431	151.1622454	1		notify busines/property owner	MV86	Secondary	LOW	\$ -
OB884	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9031843	151.1626865	1		refer to maintenance	MV86	Secondary	LOW	\$ -
OB885	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9029047	151.162882	1		refer to maintenance	MV85	Secondary	LOW	\$ -
OB886	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9027508	151.1629764	1		refer to maintenance	MV85	Secondary	LOW	\$ -
OB887	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9027364	151.1630595	1		refer to maintenance	MV85	Secondary	LOW	\$ -
OB888	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.9082512	151.1584325	1		notify busines/property owner	MV87	Secondary	LOW	\$ -
OB889	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9085088	151.1583709	1		notify busines/property owner	MV81	Secondary	LOW	\$ -
OB890	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.9167364	151.1491102	1		notify busines/property owner	MV97	Primary	LOW	\$ -
OB891	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9190258	151.145448	1		refer to maintenance	MV101	Secondary	LOW	\$ -
OB892	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	signpost narrows footpath	-33.9200164	151.1447386	1		relocate signpost	MV102	Secondary	LOW	\$ 300
OB893	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9199513	151.1447945	1		notify busines/property owner	MV102	Secondary	LOW	\$ -
OB894	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9173791	151.1486046	1		notify busines/property owner	MV98	Primary	LOW	\$ -
OB895	Illawarra Road	Marrickville	Regional Road	Strategic Route	obstruction	signpost narrows footpath	-33.9128741	151.1539575	1		relocate signpost	MV91	Primary	LOW	\$ 300
OB896	Kays Avenue	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9113755	151.1443737	1		refer to maintenance	MV105	Tertiary	LOW	\$ -
OB897	Livingstone Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation	-33.9011724	151.1534685	1		refer to maintenance	PE27	Primary	LOW	\$ -
OB898	Livingstone Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation	-33.9055598	151.1532221	1		refer to maintenance	MV78	Secondary	LOW	\$ -
OB899	Livingstone Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation	-33.9072682	151.1528609	1		refer to maintenance	MV115	Secondary	LOW	\$ -
OB900	Livingstone Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation	-33.9071692	151.1527469	1		refer to maintenance	MV115	Secondary	LOW	\$ -
OB901	Livingstone Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9068648	151.1527972	1		refer to maintenance	MV114	Primary	LOW	\$ -
OB902	Livingstone Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9113316	151.1486924	1		notify busines/property owner	MV106	Primary	LOW	\$ -
OB903	Livingstone Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation - property	-33.9122152	151.1478863	1		notify busines/property owner	MV116	Primary	LOW	\$ -
OB904	Livingstone Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9105956	151.1503716	1		notify busines/property owner	MV121	Primary	LOW	\$ -
OB905	Livingstone Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9103655	151.1506038	1		notify busines/property owner	MV120	Primary	LOW	\$ -
OB906	Llewellyn Street	Marrickville	Local Road		obstruction	overhanging vegetation - property	-33.9041438	151.17143	1		notify busines/property owner	MV125	Tertiary	LOW	\$ -
OB907	Llewellyn Street	Marrickville	Local Road		obstruction	overhanging vegetation	-33.9041677	151.1708875	1		refer to maintenance	MV126	Tertiary	LOW	\$ -
OB908	Marrickville Road	Marrickville	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.9074485	151.1480946	1		notify busines/property owner	MV143	Tertiary	LOW	\$ -
OB909	Marrickville Road	Marrickville	Regional Road		obstruction	overhanging vegetation - property	-33.9072682	151.1475811	1		notify busines/property owner	MV142	Secondary	LOW	\$ -
OB910	Marrickville Road	Marrickville	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.9074001	151.1485344	1		notify busines/property owner	MV143	Tertiary	LOW	\$ -
OB911	Marrickville Road	Marrickville	Regional Road		obstruction	overhanging vegetation - property	-33.9075627	151.1490616	1		notify busines/property owner	MV144	Secondary	LOW	\$ -
OB912	Marrickville Road	Marrickville	Regional Road		obstruction	overhanging vegetation - property	-33.9081672	151.1510718	1		notify busines/property owner	MV127	Secondary	LOW	\$ -
OB913	Marrickville Road	Marrickville	Regional Road		obstruction	overhanging vegetation	-33.9151344	151.1644837	1		refer to maintenance	MV131	Primary	LOW	\$ -
OB914	Marrickville Road	Marrickville	Regional Road		obstruction	overhanging vegetation	-33.9149972	151.164298	1		refer to maintenance	MV131	Primary	LOW	\$ -
OB915	Marrickville Road	Marrickville	Regional Road		obstruction	vehicle narrows footpath	-33.9141786	151.162952	1		no action	MV130	Primary	LOW	\$ -
OB916	Marrickville Road	Marrickville	Regional Road		obstruction	overhanging vegetation	-33.9086856	151.1526259	1		refer to maintenance	MV138	Primary	LOW	\$ -
OB917	Marrickville Road	Marrickville	Regional Road		obstruction	bollard narrows footpath	-33.9130084	151.1615658	1		relocate or remove bollard	MV128	Secondary	LOW	\$ 2,500
OB918	Myrtle Street	Marrickville	Local Road		obstruction	overhanging vegetation - property	-33.9156827	151.1572985	1		notify busines/property owner	MV147	Tertiary	LOW	\$ -
OB919	Myrtle Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9158787	151.1576598	1		refer to maintenance	MV147	Tertiary	LOW	\$ -
OB920	Newington Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9010369	151.1672432	1		refer to maintenance	MV156	Tertiary	LOW	\$ -
OB921	Premier Street	Marrickville	Local Road		obstruction	overhanging vegetation	-33.9210829	151.1535646	1		refer to maintenance	MV159	Secondary	LOW	\$ -
OB922	Premier Street	Marrickville	Local Road		obstruction	overhanging vegetation	-33.9193566	151.1505188	1		refer to maintenance	MV163	Secondary	LOW	\$ -
OB923	Premier Street	Marrickville	Local Road		obstruction	overhanging vegetation - property	-33.9191151	151.1501372	1		notify busines/property owner	MV163	Secondary	LOW	\$ -
OB924	Premier Street	Marrickville	Local Road		obstruction	overhanging vegetation - property	-33.918897	151.1497732	1		notify busines/property owner	MV158	Tertiary	LOW	\$ -
OB925	Premier Street	Marrickville	Local Road		obstruction	overhanging vegetation	-33.9187012	151.1494381	1		refer to maintenance	MV158	Tertiary	LOW	\$ -
OB926	Premier Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9184588	151.1489835	1		refer to maintenance	MV158	Tertiary	LOW	\$ -
OB927	Premier Street	Marrickville	Local Road		obstruction	overhanging vegetation - property	-33.9184031	151.1488299	1		notify busines/property owner	MV158	Tertiary	LOW	\$ -
OB928	Premier Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9179729	151.1476958	1		refer to maintenance	MV160	Tertiary	LOW	\$ -
OB929	Renwick Street	Marrickville	Local Road		obstruction	overhanging vegetation	-33.9185427	151.1531039	1		refer to maintenance	MV167	Tertiary	LOW	\$ -
OB930	Renwick Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9192701	151.1540843	1		notify busines/property owner	MV169	Tertiary	LOW	\$ -
OB931	Renwick Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9184347	151.1526078	1		refer to maintenance	MV167	Tertiary	LOW	\$ -
OB932	Renwick Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9184347	151.1526078	1		refer to maintenance	MV167	Tertiary	LOW	\$ -
OB933	Renwick Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9175831	151.1510495	1		notify busines/property owner	MV170	Secondary	LOW	\$ -
OB934	Renwick Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9174768	151.1508909	1		notify busines/property owner	MV170	Secondary	LOW	\$ -
OB935	Renwick Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9169626	151.1499733	1		refer to maintenance	MV168	Secondary	LOW	\$ -
OB936	Renwick Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9169179	151.1498643	1		notify busines/property owner	MV168	Secondary	LOW	\$ -
OB937	Renwick Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9167693	151.1497473	1		refer to maintenance	MV168	Secondary	LOW	\$ -
OB938	Richardson Crescent	Marrickville	Local Road		obstruction	power pole narrows footpath	-33.9211544	151.1556344	1		no action	MV173	Tertiary	LOW	\$ -
OB939	Richardson Crescent	Marrickville	Local Road		obstruction	overhanging vegetation	-33.921979	151.1567551	1		refer to maintenance	TE14	Secondary	LOW	\$ -
OB940	Richardson Crescent	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9218647	151.1565334	1		refer to maintenance	MV174	Tertiary	LOW	\$ -
OB941	Richardson Crescent	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9216588	151.1562902	1		refer to maintenance	MV174	Tertiary	LOW	\$ -
OB942	Richardson Crescent	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9215055	151.1561063	1		refer to maintenance	MV174	Tertiary	LOW	\$ -
OB943	Richardson Crescent	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9213768	151.1559534	1		refer to maintenance	MV174	Tertiary	LOW	\$ -
OB944	Richardson Crescent	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9212532	151.1558867	1		refer to maintenance	MV174	Tertiary	LOW	\$ -
OB945	Richardson Crescent	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9210612	151.1557349	1		refer to maintenance	MV173	Tertiary	LOW	\$ -
OB946	Richardson Crescent	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9204184	151.1551218	1		refer to maintenance	MV173	Tertiary	LOW	\$ -
OB947	Richardson Crescent	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9232819	151.1562143	1		refer to maintenance	MV175	Secondary	LOW	\$ -
OB948	Richardson Crescent	Marrickville	Local Road		obstruction	power pole narrows footpath	-33.9222909	151.1562999	1		no action	MV175	Secondary	LOW	\$ -
OB949	Riverside Crescent	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9149615	151.1422218	1		notify busines/property owner	MV178	Secondary	LOW	\$ -
OB950	Riverside Crescent	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9148653	151.1404746	1		notify busines/property owner	MV180	Tertiary	LOW	\$ -
OB951	Riverside Crescent	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9148395	151.1402971	1		notify busines/property owner	MV180	Tertiary	LOW	\$ -
OB952	Riverside Crescent	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9150057	151.1411852	1		refer to maintenance	MV179	Tertiary	LOW	\$ -
OB953	Riverside Crescent	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9150328	151.1413895	1		refer to maintenance	MV179	Tertiary	LOW	\$ -
OB954	Shirlow Street	Marrickville	Local Road		obstruction	vehicle narrows footpath	-33.912358	151.1663671	1		no action	MV185	Secondary	LOW	\$ -
OB955	Shirlow Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9118177	151.1670532	1		notify busines/property owner	MV183	Tertiary	LOW	\$ -
OB956	Shirlow Street	Marrickville	Local Road		obstruction	vehicle narrows footpath	-33.9115272	151.1674442	1		no action	MV183	Tertiary	LOW	\$ -
OB957	Shirlow Street	Marrickville	Local Road		obstruction	overhanging vegetation - property	-33.9117025	151.1672469	1		notify busines/property owner	MV183	Tertiary	LOW	\$ -
OB958	Smidmore Street	Marrickville	Local Road		obstruction	vehicle narrows footpath	-33.9076423	151.1741756	1		no action	NE21	Primary	LOW	\$ -
OB959	Smidmore Street	Marrickville	Local Road		obstruction	concrete structure obstructs crossing	-33.9077663	151.1718472	1		refer to Marrickville Metro	MV50	Primary	LOW	-
OB960	Station Street	Marrickville	Local Road		obstruction	overhanging vegetation - property	-33.9141869	151.1539962	1		notify busines/property owner	MV186	Secondary	LOW	\$ -

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
OB961	Station Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9144559	151.1549045	1		refer to maintenance	MV188	Secondary	LOW	\$ -
OB962	Station Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.914533	151.1554429	1		notify busines/property owner	MV188	Secondary	LOW	\$ -
OB963	Station Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9146192	151.1557712	1		notify busines/property owner	MV187	Secondary	LOW	\$ -
OB964	Station Street	Marrickville	Local Road		obstruction	overhanging vegetation - property	-33.9146998	151.1559566	1		notify busines/property owner	MV187	Secondary	LOW	\$ -
OB965	Sydenham Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9085912	151.1605036	1		refer to maintenance	MV192	Secondary	LOW	\$ -
OB966	Sydenham Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9072344	151.1586675	1		refer to maintenance	MV195	Secondary	LOW	\$ -
OB967	Sydenham Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9090298	151.1609379	1		notify busines/property owner	MV192	Secondary	LOW	\$ -
OB968	Sydenham Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9083108	151.159998	1		refer to maintenance	MV193	Secondary	LOW	\$ -
OB969	Sydenham Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9082718	151.1599356	1		refer to maintenance	MV193	Secondary	LOW	\$ -
OB970	Sydenham Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9068503	151.1583486	1		notify busines/property owner	MV196	Primary	LOW	\$ -
OB971	Sydenham Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9054656	151.1572938	1		notify busines/property owner	MV197	Primary	LOW	\$ -
OB972	Sydenham Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9045674	151.1563698	1		notify busines/property owner	MV190	Primary	LOW	\$ -
OB973	Sydenham Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9036576	151.1555669	1		notify busines/property owner	MV190	Primary	LOW	\$ -
OB974	Sydenham Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation	-33.9026016	151.154497	1		refer to maintenance	MV199	Primary	LOW	\$ -
OB975	Sydenham Road	Marrickville	State Road	Strategic Route	obstruction	light post narrows footpath	-33.9026614	151.1543841	1		relocate light post	MV199	Primary	LOW	\$ 10,000
OB976	Sydenham Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9021921	151.1540133	1		notify busines/property owner	MV194	Primary	LOW	\$ -
OB977	Sydenham Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation	-33.912235	151.1655006	1		refer to maintenance	MV204	Secondary	LOW	\$ -
OB978	Sydenham Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation	-33.9100366	151.1626671	1		refer to maintenance	MV200	Primary	LOW	\$ -
OB979	Sydenham Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation	-33.9097236	151.1624433	1		refer to maintenance	MV200	Primary	LOW	\$ -
OB980	Sydney Steel St	Marrickville	Local Road		obstruction	vehicles narrows footpath	-33.9098613	151.1698783	1		no action	MV207	Tertiary	LOW	\$ -
OB981	Sydney Steel St	Marrickville	Local Road		obstruction	tree narrows footpath	-33.9098208	151.1699603	1		no action	MV207	Tertiary	LOW	\$ -
OB982	Sydney Steel St	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9090774	151.170993	1		notify busines/property owner	MV205	Secondary	LOW	\$ -
OB983	Victoria Road	Marrickville	State Road	Strategic Route	obstruction	vehicle narrows footpath	-33.9055582	151.1667917	1		no action	MV213	Primary	LOW	\$ -
OB984	Victoria Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9060359	151.1650647	1		notify busines/property owner	MV215	Secondary	LOW	\$ -
OB985	Victoria Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9065136	151.164888	1		refer to maintenance	MV215	Secondary	LOW	\$ -
OB986	Victoria Road	Marrickville	State Road	Strategic Route	obstruction	vehicle narrows footpath	-33.9086041	151.1631573	1		no action	MV210	Secondary	LOW	\$ -
OB987	Victoria Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation	-33.9103224	151.1615688	1		refer to maintenance	MV219	Primary	LOW	\$ -
OB988	Victoria Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation	-33.9099286	151.162148	1		refer to maintenance	MV219	Primary	LOW	\$ -
OB989	Victoria Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9099716	151.1620992	1		notify busines/property owner	MV219	Primary	LOW	\$ -
OB990	Victoria Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9110052	151.1613334	1		notify busines/property owner	MV212	Primary	LOW	\$ -
OB991	Victoria Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation - property	-33.9115512	151.1608243	1		notify busines/property owner	MV220	Primary	LOW	\$ -
OB992	Victoria Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.914405	151.158536	1		refer to maintenance	MV227	Primary	LOW	\$ -
OB993	Victoria Road	Marrickville	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9146227	151.1578311	1		notify busines/property owner	MV209	Secondary	LOW	\$ -
OB994	Victoria Street	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9078004	151.1636072	1		refer to maintenance	MV217	Secondary	LOW	\$ -
OB995	Wardell Road	Marrickville	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.9069859	151.1525406	1		notify busines/property owner	MV240	Secondary	LOW	\$ -
OB1000	Warren Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9183582	151.1546958	1		refer to maintenance	MV250	Tertiary	LOW	\$ -
OB1001	Warren Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9184753	151.1549049	1		notify busines/property owner	MV247	Tertiary	LOW	\$ -
OB1002	Warren Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9187347	151.1549277	1		refer to maintenance	MV247	Tertiary	LOW	\$ -
OB1003	Warren Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9182793	151.1543459	1		notify busines/property owner	MV250	Tertiary	LOW	\$ -
OB1004	Warren Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9181402	151.1541004	1		notify busines/property owner	MV250	Tertiary	LOW	\$ -
OB1005	Warren Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.918064	151.1540073	1		notify busines/property owner	MV250	Tertiary	LOW	\$ -
OB1006	Warren Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9167086	151.1515282	1		refer to maintenance	MV248	Secondary	LOW	\$ -
OB1007	Warren Road	Marrickville	Local Road		obstruction	vehicle narrows footpath	-33.9147309	151.1480163	1		no action	MV244	Secondary	LOW	\$ -
OB1008	Warren Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9140803	151.1469756	1		notify busines/property owner	MV243	Secondary	LOW	\$ -
OB1009	Warren Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9139797	151.1467524	1		notify busines/property owner	MV243	Secondary	LOW	\$ -
OB996	Warren Road	Marrickville	Local Road		obstruction	vehicle narrows footpath	-33.9144356	151.147853	1		no action	MV244	Secondary	LOW	\$ -
OB997	Warren Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.916583	151.1515221	1		refer to maintenance	MV248	Secondary	LOW	\$ -
OB998	Warren Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.917158	151.1525465	1		notify busines/property owner	MV249	Secondary	LOW	\$ -
OB999	Warren Road	Marrickville	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9177436	151.1536031	1		refer to maintenance	MV241	Tertiary	LOW	\$ -
OB1010	Albermarle Street	Newtown	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8962905	151.1739522	1		notify busines/property owner	NE1	Secondary	LOW	\$ -
OB1011	Albermarle Street	Newtown	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8960037	151.1748796	1		refer to maintenance	NE1	Secondary	LOW	\$ -
OB1012	Albermarle Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.8959622	151.1748708	1		no action	NE1	Secondary	LOW	\$ -
OB1013	Albermarle Street	Newtown	Local Road		obstruction	overhanging vegetation narrows footpath	-33.89591	151.175226	1		refer to maintenance	NE4	Secondary	LOW	\$ -
OB1014	Albermarle Street	Newtown	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8958588	151.1753749	1		refer to maintenance	NE4	Secondary	LOW	\$ -
OB1015	Alice Street	Newtown	Regional Road		obstruction	overhanging vegetation - property	-33.9032953	151.1778925	1		notify busines/property owner	NE10	Primary	LOW	\$ -
OB1016	Alice Street	Newtown	Regional Road		obstruction	bus shelter narrows footpath	-33.9034664	151.1774601	1		relocate or remove bus shelter	NE10	Primary	LOW	\$ 5,000
OB1017	Alice Street	Newtown	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.9042196	151.1752092	1		notify busines/property owner	NE7	Secondary	LOW	\$ -
OB1018	Alice Street	Newtown	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.9047157	151.1739743	1		notify busines/property owner	NE6	Secondary	LOW	\$ -
OB1019	Alice Street	Newtown	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.9047195	151.1738559	1		notify busines/property owner	NE6	Secondary	LOW	\$ -
OB1020	Alice Street	Newtown	Regional Road		obstruction	comms pillar narrows footpath	-33.9047307	151.1734838	1		no action	NE6	Secondary	LOW	\$ -
OB1021	Bailey Street	Newtown	Local Road		obstruction	bins narrows footpath	-33.8996049	151.1773721	1		no action	NE59	Secondary	LOW	\$ -
OB1022	Bedford Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.8975613	151.1778339	1		no action	NE15	Primary	LOW	\$ -
OB1023	Bedford Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.8975835	151.1776737	1		no action	NE15	Primary	LOW	\$ -
OB1024	Bedford Street	Newtown	Local Road		obstruction	concrete footing narrows footpath	-33.8976024	151.1775534	1		paint contrasting colour	NE15	Primary	LOW	\$ 150
OB1025	Bedford Street	Newtown	Local Road		obstruction	trees narrows footpath	-33.8975529	151.1767707	1		no action	NE20	Secondary	LOW	\$ -
OB1026	Bedford Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.8974423	151.1761944	1		no action	NE20	Secondary	LOW	\$ -
OB1027	Bedford Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.8973975	151.1759391	1		no action	NE20	Secondary	LOW	\$ -
OB1028	Bedford Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.8972185	151.1754697	1		no action	NE19	Secondary	LOW	\$ -
OB1029	Bedford Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.8971793	151.175317	1		no action	NE19	Secondary	LOW	\$ -
OB1030	Bedford Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.8971199	151.1751742	1		no action	NE19	Secondary	LOW	\$ -
OB1031	Bedford Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.8965732	151.1740712	1		no action	NE18	Secondary	LOW	\$ -
OB1032	Bedford Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.8965207	151.1739775	1		no action	NE18	Secondary	LOW	\$ -
OB1033	Bedford Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.8959901	151.1731695	1		no action	NE17	Secondary	LOW	\$ -
OB1034	Bedford Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.8959182	151.1730649	1		no action	NE17	Secondary	LOW	\$ -
OB1035	Bedford Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.8955819	151.1724248	1		no action	NE16	Secondary	LOW	\$ -
OB1036	Bedford Street	Newtown	Local Road		obstruction	signpost narrows footpath	-33.8953591	151.171898	1		relocate signpost	NE16	Secondary	LOW	\$ 300
OB1037	Bedford Street	Newtown	Local Road		obstruction	power pole narrows footpath	-33.895299	151.1717603	1		no action	NE16	Secondary	LOW	\$ -
OB1038	Edgeware Road	Newtown	Regional Road	Strategic Route	obstruction	overhanging vegetation - property	-33.9042634	151.1731404	1		notify busines/property owner	NE23	Primary	LOW	\$ -
OB1039	Edgeware Road	Newtown	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9068006	151.1742925	1		notify busines/property owner	NE32	Primary	LOW	\$ -
OB1040	Edgeware Road	Newtown	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9074105	151.1746107	1		notify busines/property owner	NE21	Primary	LOW	\$ -
OB1041	Edgeware Road	Newtown	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9060163	151.1737486	1		notify busines/property owner	NE31	Primary	LOW	\$ -
OB1042	Enmore Road	Newtown	State Road	Strategic Route	obstruction	store stand narrows footpath	-33.8981108	151.1776848	1		notify busines/property owner	NE34	Primary	LOW	\$ -

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
OB1043	King Street	Newtown	Local Road		obstruction	storefront narrows footpath - property	-33.9047636	151.1804842	1		notify busines/property owner	NE55	Primary	LOW	\$ -
OB1044	Lennox Street	Newtown	Local Road		obstruction	power pole narrows footpath	-33.8952058	151.1806102	1		no action	NE41	Secondary	LOW	\$ -
OB1045	Lennox Street	Newtown	Local Road		obstruction	empty pit narrows footpath	-33.895191	151.1804568		1	install new footpath	NE41	Secondary	LOW	\$ 200
OB1046	Lennox Street	Newtown	Local Road		obstruction	overhanging vegetation - property	-33.8957585	151.1787994	1		notify busines/property owner	NE42	Secondary	LOW	\$ -
OB1047	Lord Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.9074767	151.178559	1		no action	NE28	Primary	LOW	\$ -
OB1048	Station Street	Newtown	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.898797	151.176582	1		notify busines/property owner	NE58	Secondary	LOW	\$ -
OB1049	Station Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.8989086	151.1766249	1		no action	NE58	Secondary	LOW	\$ -
OB1050	Station Street	Newtown	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8993052	151.176773	1		refer to maintenance	NE58	Secondary	LOW	\$ -
OB1051	Station Street	Newtown	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8994363	151.1768739	1		refer to maintenance	NE59	Secondary	LOW	\$ -
OB1052	Station Street	Newtown	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8995828	151.1769145	1		refer to maintenance	NE59	Secondary	LOW	\$ -
OB1053	Station Street	Newtown	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8997232	151.1769362	1		refer to maintenance	NE59	Secondary	LOW	\$ -
OB1054	Station Street	Newtown	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.899714	151.1769981	1		notify busines/property owner	NE59	Secondary	LOW	\$ -
OB1055	Station Street	Newtown	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8997918	151.1770367	1		refer to maintenance	NE59	Secondary	LOW	\$ -
OB1056	Station Street	Newtown	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8995264	151.1768189	1		notify busines/property owner	NE59	Secondary	LOW	\$ -
OB1057	Wells Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.9054511	151.1797118	1		no action	NE60	Secondary	LOW	\$ -
OB1058	Wells Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.9057539	151.1787735	1		no action	NE65	Secondary	LOW	\$ -
OB1059	Wells Street	Newtown	Local Road		obstruction	tree narrows footpath	-33.9063074	151.1770312	1		no action	NE63	Secondary	LOW	\$ -
OB1060	Wells Street	Newtown	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9067002	151.1757499	1		notify busines/property owner	NE62	Secondary	LOW	\$ -
OB1061	Wells Street	Newtown	Local Road		obstruction	signpost narrows footpath	-33.9069265	151.1750422	1		relocate signpost	NE61	Secondary	LOW	\$ 300
OB1062	Brighton Street	Petersham	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8924219	151.1568401	1		notify busines/property owner	PE11	Secondary	LOW	\$ -
OB1063	Brighton Street	Petersham	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8925337	151.1523272	1		refer to maintenance	PE7	Tertiary	LOW	\$ -
OB1064	Brighton Street	Petersham	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8925498	151.1524993	1		refer to maintenance	PE6	Tertiary	LOW	\$ -
OB1065	Brighton Street	Petersham	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8926937	151.15202	1		refer to maintenance	PE7	Tertiary	LOW	\$ -
OB1066	Brighton Street	Petersham	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8928891	151.1514653	1		notify busines/property owner	PE7	Tertiary	LOW	\$ -
OB1067	Brighton Street	Petersham	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8930423	151.1509652	1		refer to maintenance	PE5	Secondary	LOW	\$ -
OB1068	Livingstone Road	Petersham	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9003552	151.1533727	1		notify busines/property owner	PE26	Secondary	LOW	\$ -
OB1069	Livingstone Road	Petersham	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9000818	151.1534222	1		notify busines/property owner	PE26	Secondary	LOW	\$ -
OB1070	Livingstone Road	Petersham	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8978679	151.1538009	1		notify busines/property owner	PE24	Secondary	LOW	\$ -
OB1071	Livingstone Road	Petersham	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8983479	151.1535139	1		notify busines/property owner	PE24	Secondary	LOW	\$ -
OB1072	Livingstone Road	Petersham	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8991837	151.1534552	1		notify busines/property owner	PE25	Primary	LOW	\$ -
OB1073	Livingstone Road	Petersham	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8998397	151.1535737	1		notify busines/property owner	PE26	Secondary	LOW	\$ -
OB1074	Livingstone Road	Petersham	State Road	Strategic Route	obstruction	overhanging vegetation - property	-33.899741	151.1535984	1		notify busines/property owner	PE26	Secondary	LOW	\$ -
OB1075	New Canterbury Road	Petersham	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8959239	151.1553141	1		notify busines/property owner	PE30	Primary	LOW	\$ -
OB1076	Palace Street	Petersham	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8902538	151.1542887	1		notify busines/property owner	PE41	Primary	LOW	\$ -
OB1077	Palace Street	Petersham	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8905446	151.1544379	1		notify busines/property owner	PE42	Secondary	LOW	\$ -
OB1078	Palace Street	Petersham	Local Road	Strategic Route	obstruction	overhanging vegetation - property	-33.8902403	151.1544474	1		notify busines/property owner	PE41	Primary	LOW	\$ -
OB1079	Palace Street	Petersham	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8898622	151.1544578	1		notify busines/property owner	PE41	Primary	LOW	\$ -
OB1080	Railway Terrace	Petersham	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8941497	151.1502657	1		notify busines/property owner	PE48	Primary	LOW	\$ -
OB1081	Terminus Street	Petersham	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.893439	151.1549219	1		notify busines/property owner	PE59	Primary	LOW	\$ -
OB1082	Trafalgar Street	Petersham	Regional Road		obstruction	tree narrows footpath	-33.8935268	151.156418	1		no action	PE58	Primary	LOW	\$ -
OB1083	Trafalgar Street	Petersham	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8934902	151.1567048	1		notify busines/property owner	PE58	Primary	LOW	\$ -
OB1084	Trafalgar Street	Petersham	Regional Road		obstruction	overhanging vegetation narrows footpath - property	-33.8948378	151.1518504	1		notify busines/property owner	PE64	Secondary	LOW	\$ -
OB1085	West Street	Petersham	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8933426	151.1503412	1		notify busines/property owner	PE65	Secondary	LOW	\$ -
OB1086	York Crescent	Petersham	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8934846	151.1580181	1		notify busines/property owner	PE21	Secondary	LOW	\$ -
OB1087	York Crescent	Petersham	Local Road		obstruction	overhanging vegetation	-33.8937359	151.1585267	1		refer to maintenance	PE21	Secondary	LOW	\$ -
OB1088	York Crescent	Petersham	Local Road		obstruction	damaged fence narrows footpath	-33.8938236	151.1587525	1		notify property owner	SM15	Secondary	LOW	\$ -
OB1089	Anzac Bridge	Rozelle	State Road	Strategic Route	obstruction	light post narrows footpath	-33.8680026	151.1822664	1		relocate light post	RO8	Secondary	LOW	\$ 10,000
OB1090	Anzac Bridge	Rozelle	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8681749	151.1811536	1		refer to maintenance	RO7	Secondary	LOW	\$ -
OB1091	Darling Street	Rozelle	Local Road		obstruction	bus shelter narrows footpath	-33.8633407	151.1703312	1		relocate or remove bus shelter	RO24	Primary	LOW	\$ 5,000
OB1092	Darling Street	Rozelle	Local Road		obstruction	storefront narrows footpath - property	-33.8627198	151.1708184	1		notify busines/property owner	RO18	Primary	LOW	\$ -
OB1093	Denison Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8691649	151.1691083	1		notify busines/property owner	RO31	Tertiary	LOW	\$ -
OB1094	Denison Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8691152	151.1691703	1		notify busines/property owner	RO31	Tertiary	LOW	\$ -
OB1095	Denison Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8678339	151.168842	1		notify busines/property owner	RO30	Secondary	LOW	\$ -
OB1096	Denison Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8672641	151.1685475	1		notify busines/property owner	RO33	Secondary	LOW	\$ -
OB1097	Denison Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8666622	151.1682217	1		notify busines/property owner	RO29	Secondary	LOW	\$ -
OB1098	Denison Street	Rozelle	Local Road		obstruction	overhanging vegetation - property	-33.8662949	151.1680876	1		notify busines/property owner	RO29	Secondary	LOW	\$ -
OB1099	Denison Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8702496	151.1704238	1		notify busines/property owner	RO28	Tertiary	LOW	\$ -
OB1100	Denison Street	Rozelle	Local Road		obstruction	vehicle narrows footpath	-33.8695556	151.1695746	6		install new wheel stops	RO28	Tertiary	LOW	\$ 9,000
OB1101	Denison Street	Rozelle	Local Road		obstruction	vehicle narrows footpath	-33.869651	151.1697958	22		install new wheel stops	RO28	Tertiary	LOW	\$ 33,000
OB1102	Evans Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8657053	151.1718013	1		refer to maintenance	RO36	Primary	LOW	\$ -
OB1103	Evans Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8658821	151.1714642	1		notify busines/property owner	RO36	Primary	LOW	\$ -
OB1104	Evans Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8668296	151.1699574	1		notify busines/property owner	RO35	Secondary	LOW	\$ -
OB1105	Evans Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8673136	151.1691436	1		notify busines/property owner	RO35	Secondary	LOW	\$ -
OB1106	Evans Street	Rozelle	Local Road		obstruction	tree narrows footpath	-33.8672686	151.1691795	1		no action	RO35	Secondary	LOW	\$ -
OB1107	Evans Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8669357	151.1695175	1		notify busines/property owner	RO35	Secondary	LOW	\$ -
OB1108	Evans Street	Rozelle	Local Road		obstruction	tree narrows footpath	-33.8666712	151.1698979	1		no action	RO35	Secondary	LOW	\$ -
OB1109	Evans Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8657042	151.1715337	1		refer to maintenance	RO36	Primary	LOW	\$ -
OB1110	Gordon Street	Rozelle	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8684266	151.1728354	1		notify busines/property owner	RO40	Secondary	LOW	\$ -
OB1111	James Craig Road	Rozelle	Local Road		obstruction	power pole narrows footpath	-33.8700324	151.1752471	1		no action	RO44	Secondary	LOW	\$ -
OB1112	James Craig Road	Rozelle	Local Road		obstruction	vehicles narrows footpath	-33.8700937	151.1752907	1		no action	RO44	Secondary	LOW	\$ -
OB1113	Lilyfield Road	Rozelle	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8686142	151.1725957	1		notify busines/property owner	RO41	Secondary	LOW	\$ -
OB1114	Lilyfield Road	Rozelle	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8682514	151.1754362	1		notify busines/property owner	RO44	Secondary	LOW	\$ -
OB1115	Lilyfield Road	Rozelle	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8683284	151.1753643	1		notify busines/property owner	RO44	Secondary	LOW	\$ -
OB1116	Lilyfield Road	Rozelle	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8685349	151.1744671	1		refer to maintenance	RO42	Secondary	LOW	\$ -
OB1117	Lilyfield Road	Rozelle	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8709206	151.1701588	1		refer to maintenance	RO45	Secondary	LOW	\$ -
OB1118	Lilyfield Road	Rozelle	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.871061	151.1699773	1		refer to maintenance	RO45	Secondary	LOW	\$ -
OB1119	Lilyfield Road	Rozelle	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8712522	151.1696665	1		refer to maintenance	RO45	Secondary	LOW	\$ -
OB1120	Lilyfield Road	Rozelle	Regional Road	Strategic Route	obstruction	power pole narrows path	-33.8715682	151.1695047	1		no action	RO45	Secondary	LOW	\$ -
OB1121	Lilyfield Road	Rozelle	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8706148	151.1707097	1		refer to maintenance	LF98	Secondary	LOW	\$ -
OB1122	Manning Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8626698	151.1643049	1		refer to maintenance	RO50	Tertiary	LOW	\$ -
OB1123	Manning Street	Rozelle	Local Road		obstruction	power pole narrows footpath	-33.864892	151.1659752	1		no action	RO49	Secondary	LOW	\$ -
OB1124	Manning Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8654943	151.1665255	1		notify busines/property owner	RO52	Secondary	LOW	\$ -

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
OB1125	Mullens Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8630437	151.1764947	1		notify busines/property owner	RO53	Primary	LOW	\$ -
OB1126	Mullens Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8654936	151.1770227	1		notify busines/property owner	RO55	Tertiary	LOW	\$ -
OB1127	Mullens Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8658194	151.1768858	1		notify busines/property owner	RO58	Tertiary	LOW	\$ -
OB1128	Mullens Street	Rozelle	Local Road		obstruction	power pole narrows footpath	-33.8665256	151.1755931	1		no action	RO57	Secondary	LOW	\$ -
OB1129	Robert Street	Rozelle	Local Road		obstruction	vehicles and signpost narrows footpath	-33.8655187	151.1779495	1		relocate signpost	RO61	Tertiary	LOW	\$ 300
OB1130	Robert Street	Rozelle	Local Road		obstruction	damaged signpost narrows footpath	-33.8658149	151.1775204	1		install new signpost	RO58	Tertiary	LOW	\$ 250
OB1131	Robert Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8640877	151.1804002	1		refer to maintenance	RO59	Tertiary	LOW	\$ -
OB1132	Robert Street	Rozelle	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8641364	151.1803256	1		refer to maintenance	RO59	Tertiary	LOW	\$ -
OB1133	Robert Street	Rozelle	Local Road		obstruction	vehicle narrows footpath	-33.8652008	151.178691	1		no action	RO61	Tertiary	LOW	\$ -
OB1134	Robert Street	Rozelle	Local Road		obstruction	power pole narrows footpath	-33.8653063	151.1785731	1		no action	RO61	Tertiary	LOW	\$ -
OB1135	Robert Street	Rozelle	Local Road		obstruction	power pole narrows footpath	-33.8654928	151.1779017	1		no action	RO58	Tertiary	LOW	\$ -
OB1136	Terry Street	Rozelle	Local Road		obstruction	comms pillar narrows footpath	-33.8606451	151.1688986	1		no action	RO68	Secondary	LOW	\$ -
OB1137	Terry Street	Rozelle	Local Road		obstruction	electricity box narrows footpath	-33.860716	151.1693484	1		no action	RO68	Secondary	LOW	\$ -
OB1138	The Crescent	Rozelle	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.869623	151.175255	1		refer to maintenance	RO44	Secondary	LOW	\$ -
OB1139	Victoria Road	Rozelle	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8609642	151.1647915	1		refer to maintenance	RO84	Secondary	LOW	\$ -
OB1140	Victoria Road	Rozelle	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8669092	151.1750566	1		refer to maintenance	RO74	Primary	LOW	\$ -
OB1141	Victoria Road	Rozelle	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8661753	151.1739747	1		refer to maintenance	RO73	Secondary	LOW	\$ -
OB1142	Victoria Road	Rozelle	State Road	Strategic Route	obstruction	signpost narrows footpath	-33.8671305	151.1752532	1		relocate signpost	RO70	Primary	LOW	\$ 300
OB1143	Victoria Road	Rozelle	State Road	Strategic Route	obstruction	signpost narrows footpath	-33.8669648	151.1754947	1		relocate signpost	RO57	Secondary	LOW	\$ 300
OB1144	Victoria Road	Rozelle	State Road	Strategic Route	obstruction	signpost narrows footpath	-33.867299	151.1757409	1		relocate signpost	RO70	Primary	LOW	\$ 300
OB1145	Victoria Road	Rozelle	State Road	Strategic Route	obstruction	signpost narrows footpath	-33.8673601	151.1757531	1		relocate signpost	RO70	Primary	LOW	\$ 300
OB1146	Victoria Road	Rozelle	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.8674443	151.1758943	1		refer to maintenance	RO70	Primary	LOW	\$ -
OB1147	Victoria Road	Rozelle	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8675727	151.1760243	1		notify busines/property owner	RO70	Primary	LOW	\$ -
OB1148	Victoria Road	Rozelle	State Road	Strategic Route	obstruction	light post narrows footpath	-33.8675847	151.1760326	1		relocate light post	RO70	Primary	LOW	\$ 10,000
OB1149	Campbell Street	St Peters	Regional Road		obstruction	vehicle narrows footpath	-33.912418	151.1790644	1		no action	SP2	Secondary	LOW	\$ -
OB1150	Church Street	St Peters	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9122162	151.178483	1		refer to maintenance	SP6	Secondary	LOW	\$ -
OB1151	Church Street	St Peters	Local Road		obstruction	electricity box narrows footpath	-33.9122713	151.1784134	1		no action	SP6	Secondary	LOW	\$ -
OB1152	Church Street	St Peters	Local Road		obstruction	power pole narrows footpath	-33.9124215	151.1784548	1		no action	SP6	Secondary	LOW	\$ -
OB1153	Church Street	St Peters	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9124415	151.1783798	1		notify busines/property owner	SP6	Secondary	LOW	\$ -
OB1154	Church Street	St Peters	Local Road		obstruction	power pole narrows footpath	-33.9129851	151.1778887	1		no action	SP7	Secondary	LOW	\$ -
OB1155	Church Street	St Peters	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9130991	151.1777236	1		notify busines/property owner	SP7	Secondary	LOW	\$ -
OB1156	Church Street	St Peters	Local Road		obstruction	power pole narrows footpath	-33.9131598	151.1777361	1		no action	SP7	Secondary	LOW	\$ -
OB1157	Church Street	St Peters	Local Road		obstruction	electricity box narrows footpath	-33.9133771	151.1775393	1		no action	SP7	Secondary	LOW	\$ -
OB1158	Edith Street	St Peters	Local Road		obstruction	vehicle narrows footpath	-33.9125381	151.1734653	1		no action	SP35	Tertiary	LOW	\$ -
OB1159	Edith Street	St Peters	Local Road		obstruction	bin narrows footpath	-33.9129031	151.1738216	1		no action	SP35	Tertiary	LOW	\$ -
OB1160	Edith Street	St Peters	Local Road		obstruction	overhanging vegetation - property	-33.9143773	151.1752946	1		notify busines/property owner	SP21	Primary	LOW	\$ -
OB1161	Edith Street	St Peters	Local Road		obstruction	tree narrows footpath	-33.9146574	151.1755681	1		no action	SP21	Primary	LOW	\$ -
OB1162	Edith Street	St Peters	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9146655	151.1755796	1		notify busines/property owner	SP21	Primary	LOW	\$ -
OB1163	King Street	St Peters	Local Road		obstruction	signpost narrows footpath	-33.9077036	151.1813183	1		relocate signpost	SP11	Primary	LOW	\$ 300
OB1164	Princes Highway	St Peters	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.9177237	151.1715433	1		refer to maintenance	SP8	Secondary	LOW	\$ -
OB1165	Princes Highway	St Peters	State Road	Strategic Route	obstruction	double pole signpost narrows footpath	-33.9144977	151.1772648	1		review and relocate double pole signp	SP19	Primary	LOW	\$ 500
OB1166	Princes Highway	St Peters	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.913733	151.1780119	1		notify busines/property owner	SP18	Primary	LOW	\$ -
OB1167	Princes Highway	St Peters	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9118391	151.1797423	1		notify busines/property owner	SP15	Secondary	LOW	\$ -
OB1168	St Peters Street	St Peters	Local Road		obstruction	trees narrows footpath	-33.9119315	151.1775125	1		no action	SP31	Secondary	LOW	\$ -
OB1169	St Peters Street	St Peters	Local Road		obstruction	overhanging vegetation - property	-33.9120746	151.1774912	1		notify busines/property owner	SP31	Secondary	LOW	\$ -
OB1170	St Peters Street	St Peters	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9123025	151.1772895	1		refer to maintenance	SP30	Secondary	LOW	\$ -
OB1171	St Peters Street	St Peters	Local Road		obstruction	overhanging vegetation - property	-33.9124748	151.1770643	1		notify busines/property owner	SP30	Secondary	LOW	\$ -
OB1172	St Peters Street	St Peters	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9127681	151.1768603	1		refer to maintenance	SP30	Secondary	LOW	\$ -
OB1173	Unwins Bridge Road	St Peters	Local Road		obstruction	overhanging vegetation - property	-33.9104579	151.1751536	1		notify busines/property owner	SP32	Secondary	LOW	\$ -
OB1174	Unwins Bridge Road	St Peters	Local Road		obstruction	bins narrows footpath	-33.9104561	151.1751777	1		no action	SP32	Secondary	LOW	\$ -
OB1175	Aubery Street	Stanmore	Local Road		obstruction	overgrown vegetation	-33.8952874	151.1615472	1		refer to maintenance	SM14	Primary	LOW	\$ -
OB1176	Percival Road	Stanmore	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8904274	151.1652824	1		notify busines/property owner	SM29	Primary	LOW	\$ -
OB1177	Carlton Crescent	Summer Hill	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8897894	151.1318682	1		notify busines/property owner	SH8	Secondary	LOW	\$ -
OB1178	Carlton Crescent	Summer Hill	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8898663	151.1326898	1		notify busines/property owner	SH9	Secondary	LOW	\$ -
OB1179	Carlton Crescent	Summer Hill	Regional Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8901935	151.1377988	1		notify busines/property owner	SH14	Primary	LOW	\$ -
OB1180	Clissold Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8958502	151.1321921	1		notify busines/property owner	AF46	Tertiary	LOW	\$ -
OB1181	Clissold Street	Summer Hill	Local Road		obstruction	signposts narrows footpath	-33.8958807	151.1322652	1		relocate signpost	AF46	Tertiary	LOW	\$ 300
OB1182	Frenchs Lane	Summer Hill	Local Road		obstruction	power pole narrows footpath	-33.8898277	151.1446404	1		no action	SH16	Secondary	LOW	\$ -
OB1183	Frenchs Lane	Summer Hill	Local Road		obstruction	power pole narrows footpath	-33.8900308	151.1444895	1		no action	SH16	Secondary	LOW	\$ -
OB1184	Frenchs Lane	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8902618	151.1443151	1		notify busines/property owner	SH16	Secondary	LOW	\$ -
OB1185	Frenchs Lane	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8903668	151.1442602	1		notify busines/property owner	SH16	Secondary	LOW	\$ -
OB1186	Frenchs Lane	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8903172	151.1441501	1		notify busines/property owner	SH16	Secondary	LOW	\$ -
OB1187	Grosvenor Crescent	Summer Hill	Local Road		obstruction	signpost narrows footpath	-33.8906136	151.1403825	1		relocate signpost	SH22	Secondary	LOW	\$ 300
OB1188	Grosvenor Crescent	Summer Hill	Local Road		obstruction	signpost narrows footpath	-33.8899578	151.1384377	1		relocate signpost	SH20	Primary	LOW	\$ 300
OB1189	Grosvenor Crescent	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8899966	151.1385558	1		refer to maintenance	SH20	Primary	LOW	\$ -
OB1190	Grosvenor Crescent	Summer Hill	Local Road		obstruction	overhanging vegetation - property	-33.8894495	151.1340941	1		notify busines/property owner	SH29	Secondary	LOW	\$ -
OB1191	Haig Avenue	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8908627	151.1445213	1		notify busines/property owner	SH16	Secondary	LOW	\$ -
OB1192	Haig Avenue	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8907348	151.1443642	1		notify busines/property owner	SH16	Secondary	LOW	\$ -
OB1193	Haig Avenue	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8906611	151.1442684	1		notify busines/property owner	SH16	Secondary	LOW	\$ -
OB1194	Hardie Avenue	Summer Hill	Local Road		obstruction	signpost narrows footpath	-33.8914539	151.1372354	1		relocate signpost	SH34	Primary	LOW	\$ 300
OB1195	Henson Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8964096	151.1346362	1		notify busines/property owner	SH35	Secondary	LOW	\$ -
OB1196	Henson Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.896975	151.1345888	1		refer to maintenance	SH35	Secondary	LOW	\$ -
OB1197	Herbert Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8963962	151.1344136	1		refer to maintenance	SH37	Secondary	LOW	\$ -
OB1198	Herbert Street	Summer Hill	Local Road		obstruction	overhanging vegetation - property	-33.8963623	151.133802	1		notify busines/property owner	SH37	Secondary	LOW	\$ -
OB1199	Herbert Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8963297	151.1332311	1		refer to maintenance	SH37	Secondary	LOW	\$ -
OB1200	Herbert Street	Summer Hill	Local Road		obstruction	tree narrows footpath	-33.8963164	151.1328602	1		no action	SH37	Secondary	LOW	\$ -
OB1201	James Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.897406	151.135099	1		notify busines/property owner	SH38	Secondary	LOW	\$ -
OB1202	James Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8973792	151.1347774	1		refer to maintenance	SH38	Secondary	LOW	\$ -
OB1203	Junction Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8950187	151.1337759	1		notify busines/property owner	SH41	Secondary	LOW	\$ -
OB1204	Junction Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8950329	151.1340175	1		notify busines/property owner	SH41	Secondary	LOW	\$ -
OB1205	Junction Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8954036	151.1382908	1		refer to maintenance	SH44	Primary	LOW	\$ -
OB1206	Junction Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.895484	151.1380974	1		notify busines/property owner	SH44	Primary	LOW	\$ -

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
OB1207	Junction Road	Summer Hill	Local Road		obstruction	comms pillar narrows footpath	-33.8954841	151.1377172	1		no action	SH44	Primary	LOW	\$ -
OB1208	Junction Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8953943	151.136947	1		refer to maintenance	SH39	Secondary	LOW	\$ -
OB1209	Junction Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8951617	151.1344464	1		notify busines/property owner	SH41	Secondary	LOW	\$ -
OB1210	Junction Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8950716	151.132938	1		notify busines/property owner	SH40	Secondary	LOW	\$ -
OB1211	Liverpool Road	Summer Hill	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.8886235	151.1341658	1		notify busines/property owner	AF95	Primary	LOW	\$ -
OB1212	Nowranie Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8938035	151.1388758	1		notify busines/property owner	SH50	Secondary	LOW	\$ -
OB1213	Nowranie Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8946877	151.1386651	1		notify busines/property owner	SH53	Secondary	LOW	\$ -
OB1214	Nowranie Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8949366	151.138693	1		notify busines/property owner	SH53	Secondary	LOW	\$ -
OB1215	Old Canterbury Road	Summer Hill	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8961763	151.1375924	1		notify busines/property owner	SH56	Primary	LOW	\$ -
OB1216	Old Canterbury Road	Summer Hill	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8956355	151.1384071	1		notify busines/property owner	SH56	Primary	LOW	\$ -
OB1217	Old Canterbury Road	Summer Hill	State Road		obstruction	overhanging vegetation - property	-33.8993073	151.133269	1		notify busines/property owner	SH61	Secondary	LOW	\$ -
OB1218	Old Canterbury Road	Summer Hill	State Road		obstruction	overhanging vegetation - property	-33.898725	151.1339944	1		notify busines/property owner	SH60	Tertiary	LOW	\$ -
OB1219	Old Canterbury Road	Summer Hill	State Road		obstruction	overhanging vegetation narrows footpath	-33.8986127	151.1341771	1		refer to maintenance	SH60	Tertiary	LOW	\$ -
OB1220	Old Canterbury Road	Summer Hill	State Road		obstruction	overhanging vegetation	-33.8980996	151.134903	1		refer to maintenance	SH59	Tertiary	LOW	\$ -
OB1221	Old Canterbury Road	Summer Hill	State Road		obstruction	overhanging vegetation narrows footpath - property	-33.8977877	151.1353258	1		notify busines/property owner	SH59	Tertiary	LOW	\$ -
OB1222	Prospect Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8915281	151.1324672	1		notify busines/property owner	SH65	Secondary	LOW	\$ -
OB1223	Prospect Road	Summer Hill	Local Road		obstruction	overhanging vegetation - property	-33.8910343	151.1323487	1		notify busines/property owner	SH65	Secondary	LOW	\$ -
OB1224	Prospect Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.890204	151.1322874	1		notify busines/property owner	SH64	Secondary	LOW	\$ -
OB1225	Prospect Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8902249	151.13239	1		notify busines/property owner	SH64	Secondary	LOW	\$ -
OB1226	Prospect Road	Summer Hill	Local Road		obstruction	double pole signpost narrows footpath	-33.8957802	151.1323501	1		review and relocate double pole signp	SH70	Secondary	LOW	\$ 500
OB1227	Prospect Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8956919	151.1323445	1		notify busines/property owner	SH70	Secondary	LOW	\$ -
OB1228	Prospect Road	Summer Hill	Local Road		obstruction	double pole signpost narrows footpath	-33.8943409	151.1323527	1		review and relocate double pole signp	SH69	Secondary	LOW	\$ 500
OB1229	Prospect Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8924458	151.1323761	1		notify busines/property owner	SH66	Secondary	LOW	\$ -
OB1230	Prospect Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8930736	151.1324561	1		notify busines/property owner	SH67	Secondary	LOW	\$ -
OB1231	Prospect Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8950823	151.1324579	1		notify busines/property owner	SH70	Secondary	LOW	\$ -
OB1232	Prospect Road	Summer Hill	Local Road		obstruction	overhanging vegetation - property	-33.8959168	151.1324848	1		notify busines/property owner	SH71	Tertiary	LOW	\$ -
OB1233	Prospect Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8974602	151.1322999	1		notify busines/property owner	SH72	Tertiary	LOW	\$ -
OB1234	Prospect Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8960939	151.1323242	1		notify busines/property owner	SH71	Tertiary	LOW	\$ -
OB1235	Prospect Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8983809	151.1321883	1		refer to maintenance	SH73	Secondary	LOW	\$ -
OB1236	Prospect Road	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9007524	151.131985	1		refer to maintenance	AF126	Primary	LOW	\$ -
OB1237	Smith Street	Summer Hill	Local Road		obstruction	overhanging vegetation - property	-33.892613	151.1414826	1		notify busines/property owner	SH88	Secondary	LOW	\$ -
OB1238	Smith Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8925669	151.1436289	1		refer to maintenance	SH89	Secondary	LOW	\$ -
OB1239	Smith Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8927497	151.1433534	1		refer to maintenance	SH89	Secondary	LOW	\$ -
OB1240	Smith Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8926869	151.1413991	1		notify busines/property owner	SH88	Secondary	LOW	\$ -
OB1241	Smith Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8926552	151.1412066	1		refer to maintenance	SH88	Secondary	LOW	\$ -
OB1242	Smith Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8923983	151.1399726	1		notify busines/property owner	SH87	Secondary	LOW	\$ -
OB1243	Smith Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8922802	151.1396227	1		notify busines/property owner	SH86	Secondary	LOW	\$ -
OB1244	Smith Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8916264	151.1356913	1		notify busines/property owner	SH82	Secondary	LOW	\$ -
OB1245	Smith Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8916819	151.1333572	1		notify busines/property owner	SH80	Secondary	LOW	\$ -
OB1246	Smith Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.8917173	151.1330946	1		refer to maintenance	SH80	Secondary	LOW	\$ -
OB1247	Smith Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.8916584	151.1325166	1		notify busines/property owner	SH80	Secondary	LOW	\$ -
OB1248	Smith Street	Summer Hill	Local Road		obstruction	overhanging vegetation narrows footpath	-33.891625	151.1326858	1		refer to maintenance	SH80	Secondary	LOW	\$ -
OB1249	George Street	Sydenham	Local Road		obstruction	overhanging vegetation narrows footpath	-33.914928	151.1673963	1		refer to maintenance	SY3	Secondary	LOW	\$ -
OB1250	George Street	Sydenham	Local Road		obstruction	overhanging vegetation	-33.9151366	151.1678116	1		refer to maintenance	SY3	Secondary	LOW	\$ -
OB1251	George Street	Sydenham	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9150553	151.1677	1		notify busines/property owner	SY3	Secondary	LOW	\$ -
OB1252	George Street	Sydenham	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9148829	151.167527	1		notify busines/property owner	SY3	Secondary	LOW	\$ -
OB1253	Railway Road	Sydenham	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.917867	151.1679316	1		notify busines/property owner	SY8	Primary	LOW	\$ -
OB1254	Railway Road	Sydenham	Local Road		obstruction	traffic post narrows footpath	-33.9178158	151.1678863	1	5	widen footpath	SY8	Primary	LOW	\$ 1,000
OB1255	Griffiths Street	Tempe	Local Road		obstruction	signpost narrows footpath	-33.9251143	151.1565414	1		relocate signpost	TE32	Secondary	LOW	\$ 300
OB1256	Griffiths Street	Tempe	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9248092	151.1567938	1		notify busines/property owner	TE31	Secondary	LOW	\$ -
OB1257	Griffiths Street	Tempe	Local Road		obstruction	overhanging vegetation narrows footpath - property	-33.9252566	151.1564705	1		notify busines/property owner	TE32	Secondary	LOW	\$ -
OB1258	Griffiths Street	Tempe	Local Road		obstruction	tree narrows footpath	-33.9255527	151.1562397	1		no action	TE32	Secondary	LOW	\$ -
OB1259	Griffiths Street	Tempe	Local Road		obstruction	tree narrows footpath	-33.9256476	151.1562082	1		no action	TE32	Secondary	LOW	\$ -
OB1260	Princes Highway	Tempe	State Road	Strategic Route	obstruction	power pole narrows footpath	-33.9205106	151.1678215	1		no action	SP29	Secondary	LOW	\$ -
OB1261	Princes Highway	Tempe	State Road	Strategic Route	obstruction	overhanging vegetation narrows footpath	-33.927547	151.1580591	1		refer to maintenance	TE30	Secondary	LOW	\$ -
OB1262	Princes Highway	Tempe	State Road	Strategic Route	obstruction	power pole narrows footpath	-33.9271214	151.1583863	1		no action	TE34	Primary	LOW	\$ -
OB1263	Richardson Crescent	Tempe	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9227357	151.156358	1		refer to maintenance	MV175	Secondary	LOW	\$ -
OB1264	Richardson Crescent	Tempe	Local Road		obstruction	overhanging vegetation narrows footpath	-33.9223804	151.156466	1		refer to maintenance	MV175	Secondary	LOW	\$ -
OB1265	Union Street	Tempe	Local Road		obstruction	vehicles narrows footpath	-33.9221945	151.1611651	1		no action	TE18	Secondary	LOW	\$ -
OB1266	Unwins Bridge Road	Tempe	Local Road		obstruction	double pole signpost narrows footpath	-33.9213415	151.159594	1		review and relocate double pole signp	TE22	Primary	LOW	\$ 500
OB1267	Unwins Bridge Road	Tempe	Local Road		obstruction	double pole signpost narrows footpath	-33.919024	151.1628818	1		review and relocate double pole signp	TE27	Secondary	LOW	\$ 500
OB1268	View Street	Tempe	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9266905	151.1580797	1		notify busines/property owner	TE34	Primary	LOW	\$ -
OB1269	View Street	Tempe	Local Road	Strategic Route	obstruction	overhanging vegetation narrows footpath - property	-33.9266583	151.1580978	1		notify busines/property owner	TE34	Primary	LOW	\$ -
SA1	Annandale Street	Annandale	Local Road	Strategic Route	safety issue	potential raised pedestrian crossing - school	-33.877992	151.17063	1		install raised pedestrian crossing	AN7	Secondary	LOW	\$ 50,000
SA2	Booth Street	Annandale	Regional Road	Strategic Route	safety issue	potential HPAA	-33.8818227	151.1717741	1		investigate HPAA implementation	AN20	Primary	LOW	\$ 15,000
SA3	Chester Street	Annandale	Local Road	Strategic Route	safety issue	steep crossfall	-33.8856739	151.1749959	1		re-construct footpath pavement	AN29	Secondary	LOW	\$ 200
SA4	Chester Street	Annandale	Local Road	Strategic Route	safety issue	steep crossfall	-33.8841319	151.1728915	1		further investigation required	AN31	Primary	LOW	-
SA5	Chester Street	Annandale	Local Road	Strategic Route	safety issue	steep crossfall	-33.8841365	151.1729167	1		further investigation required	AN31	Primary	LOW	-
SA6	Collins Street	Annandale	Local Road		safety issue	potential raised pedestrian crossing - school	-33.884096	151.171073	1		install raised pedestrian crossing	AN32	Secondary	LOW	\$ 50,000
SA7	Johnston Street	Annandale	State Road	Strategic Route	safety issue	poor visibility of waiting pedestrians and crossing	-33.8780172	151.1722303	1		install kerb extension - pair	AN48	Primary	LOW	\$ 20,000
SA8	Nelson Street	Annandale	Local Road	Strategic Route	safety issue	steep crossfall	-33.8833981	151.1732198	1		re-construct footpath pavement	AN72	Primary	LOW	\$ 200
SA9	Rose Street	Annandale	Local Road		safety issue	poor lighting	-33.8773763	151.1761126	1		install new lighting	AN95	Secondary	LOW	\$ 10,000
SA10	Taylor Street	Annandale	Local Road		safety issue	vegetation obscures pedestrians	-33.8829908	151.1746467	1		refer to maintenance	AN58	Secondary	LOW	\$ -
SA11	Trafalgar Street	Annandale	Regional Road		safety issue	corner obstructs pedestrian	-33.8772577	151.1743217	1		install pavement warning message	AN103	Secondary	LOW	\$ 150
SA12	Trafalgar Street	Annandale	Regional Road		safety issue	potential raised pedestrian crossing - school	-33.886017	151.170286	1		install raised pedestrian crossing	AN101	Secondary	LOW	\$ 50,000
SA13	Trafalgar Street	Annandale	Regional Road		safety issue	potential raised pedestrian crossing - school	-33.884198	151.171128	1		install raised pedestrian crossing	AN109	Secondary	LOW	\$ 50,000
SA14	Alt Street	Ashfield	Local Road		safety issue	poor sight lines between pedestrians and approaching ve	-33.8807154	151.128337	1		relocate no stopping signage	AF3	Tertiary	LOW	\$ 300
SA15	Alt Street	Ashfield	Local Road		safety issue	potential raised pedestrian crossing - school	-33.883612	151.124286	1		install raised pedestrian crossing	AF7	Secondary	LOW	\$ 50,000
SA16	Bland Street	Ashfield	Local Road		safety issue	potential raised pedestrian crossing - school	-33.8855351	151.1253665	1		install raised pedestrian crossing	AF18	Secondary	LOW	\$ 50,000
SA17	Brown Street	Ashfield	Local Road		safety issue	potential HPAA	-33.8893057	151.1261441	1		investigate HPAA implementation	AF30	Primary	LOW	\$ 15,000
SA18	Elizabeth Street	Ashfield	Regional Road		safety issue	corner obscures pedestrians	-33.8883802	151.1293891	1		install pavement warning message	AF63	Secondary	LOW	\$ 150
SA19	Elizabeth Street	Ashfield	Regional Road		safety issue	potential HPAA	-33.8869102	151.1262801	1		investigate HPAA implementation	AF58	Primary	LOW	\$ 15,000

Issue ID	Street	Suburb	Classification	Strategic Route	Category	Issue	Latitude	Longitude	Quantity	Length	Recommendation	Segment ID	Segment Hierarchy	Treatment Priority	Cost
SA20	Frederick Street	Ashfield	State Road	Strategic Route	safety issue	poor drainage	-33.8852416	151.1196865	1		refer to maintenance	AF76	Primary	LOW	\$ -
SA21	Markham Avenue	Ashfield	Local Road		safety issue	bollards of low contrasting colour	-33.8874919	151.1232421	1		repaint bollards	AF110	Secondary	LOW	\$ 150
SA22	Prospect Road	Ashfield	Local Road		safety issue	potential raised pedestrian crossing - school	-33.899418	151.132148	1		install raised pedestrian crossing	SH74	Secondary	LOW	\$ 50,000
SA23	Victoria Street	Ashfield	Local Road		safety issue	steep crossfall	-33.9032179	151.1291443	1		re-construct footpath pavement	AF164	Secondary	LOW	\$ 200
SA24	Glassop Street	Balmain	Local Road		safety issue	vehicles obscure pedestrians	-33.8540313	151.175489	1		install kerb extension	BA65	Secondary	LOW	\$ 10,000
SA25	Terry Street	Balmain	Local Road		safety issue	corner obscures pedestrians	-33.8568419	151.1712054	1		install pavement warning message	BA69	Secondary	LOW	\$ 150
SA26	Constitution Road	Dulwich Hill	Local Road		safety issue	pedestrian desireline	-33.901519	151.1372514	1		investigate providing pedestrian cross	DH16	Secondary	LOW	\$ 15,000
SA27	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	safety issue	narrow pedestrian refuge island across busy road	-33.9049375	151.130535	1		re-construct refuge island	DH91	Secondary	LOW	\$ 15,000
SA28	New Canterbury Road	Dulwich Hill	State Road	Strategic Route	safety issue	poor drainage	-33.905	151.1317748	1		refer to maintenance	DH90	Secondary	LOW	\$ -
SA29	Liberty Street	Enmore	Local Road		safety issue	vehicles obscure pedestrians	-33.8963985	151.1710637	1		install no stopping sign and signpost	EN11	Tertiary	LOW	\$ 300
SA30	Phillip Street	Enmore	Local Road		safety issue	poor drainage - severe ponding	-33.8969206	151.1733204	1		refer to maintenance	NE45	Secondary	LOW	\$ -
SA31	Bland Street	Haberfield	Local Road		safety issue	low visibility to crossing from both approaches	-33.8789263	151.1344096	1		install raised pedestrian crossing	HA20	Secondary	LOW	\$ 50,000
SA32	Bland Street	Haberfield	Local Road		safety issue	floodlights orientated incorrectly	-33.8789378	151.1343804	1		adjust flood light orientation	HA20	Secondary	LOW	\$ 1,000
SA33	Dalhousie Street	Haberfield	Local Road	Strategic Route	safety issue	potential raised pedestrian crossing - school	-33.8788497	151.1399996	1		install raised pedestrian crossing	HA32	Primary	LOW	\$ 50,000
SA34	Waratah Street	Haberfield	Local Road		safety issue	potential raised pedestrian crossing - school	-33.874858	151.140362	1		install raised pedestrian crossing	HA107	Secondary	LOW	\$ 50,000
SA35	Darley Road	Leichardt	State Road		safety issue	potential pedestrian crossing point	-33.880175	151.147661	1		investigate providing raised pedestrian	LH30	Secondary	LOW	\$ 15,000
SA36	Foster Street	Leichardt	State Road		safety issue	missing refuge island	-33.880444	151.147681	1		install new refuge island	LH69	Secondary	LOW	\$ 15,000
SA37	Lord Street	Leichardt	Local Road		safety issue	potential pedestrian crossing point	-33.886054	151.147004	1		investigate providing raised pedestrian	LH87	Secondary	LOW	\$ 15,000
SA38	Lord Street	Leichardt	Local Road		safety issue	fencing requires flare at end	-33.886244	151.144377	1		re-construct fence	LH85	Secondary	LOW	\$ 150
SA39	Allen Street	Leichhardt	Local Road		safety issue	vehicles approach crossing point at speed	-33.8803295	151.1521195	1		install kerb extension	LH6	Secondary	LOW	\$ 10,000
SA40	Allen Street	Leichhardt	Local Road		safety issue	vehicles approach at speed - insufficient deflection	-33.8803617	151.1521241	1		install new refuge island	LH6	Secondary	LOW	\$ 15,000
SA41	Allen Street	Leichhardt	Local Road		safety issue	vehicles exit roundabout at speed	-33.8803876	151.1519684	1		install kerb extension	LH5	Tertiary	LOW	\$ 10,000
SA42	Allen Street	Leichhardt	Local Road		safety issue	vehicles approach at speed - insufficient deflection	-33.8803638	151.1519464	1		install new refuge island	LH5	Tertiary	LOW	\$ 15,000
SA43	Balmain Road	Leichhardt	Local Road		safety issue	steep crossfall	-33.8788791	151.1595113	1		re-construct footpath pavement	LH12	Primary	LOW	\$ 200
SA44	Balmain Road	Leichhardt	Local Road		safety issue	further investigation required	-33.8792358	151.1594447	1			LH12	Primary	LOW	-
SA45	Balmain Road	Leichhardt	Local Road		safety issue	floodlights orientated incorrectly	-33.8820592	151.1588698	1		adjust flood light orientation	LH21	Primary	LOW	\$ 1,000
SA46	Balmain Road	Leichhardt	Local Road		safety issue	vehicles approach crossing at speed	-33.8820595	151.1588728	1		install raised pedestrian crossing	LH21	Primary	LOW	\$ 50,000
SA47	Derbyshire Road	Leichhardt	Local Road		safety issue	potential raised pedestrian crossing - school	-33.8796416	151.1585778	1		install raised pedestrian crossing	LH41	Secondary	LOW	\$ 50,000
SA48	Flood Street	Leichhardt	Local Road		safety issue	potential raised pedestrian crossing - school	-33.885805	151.149843	1		install raised pedestrian crossing	LH59	Secondary	LOW	\$ 50,000
SA49	Lords Road	Leichhardt	Local Road		safety issue	potential raised pedestrian crossing - school	-33.885707	151.149733	1		install raised pedestrian crossing	LH89	Primary	LOW	\$ 50,000
SA50	Styles Street	Leichhardt	Regional Road		safety issue	poor lighting	-33.8826793	151.1663908	1		install new lighting	AN33	Tertiary	LOW	\$ 10,000
SA51	White Creek	Leichhardt	Local Road	Strategic Route	safety issue	missing lighting	-33.8800795	151.1673544	1		install new lighting	AN113	Secondary	LOW	\$ 10,000
SA52	William Street	Leichhardt	Local Road		safety issue	poor drainage - severe ponding	-33.8772718	151.1574645	1		refer to maintenance	LH170	Secondary	LOW	\$ -
SA53	William Street	Leichhardt	Local Road		safety issue	poor sight lines to approaching traffic - build out kerb	-33.8776526	151.1517276	1		install kerb extension - pair	LH173	Secondary	LOW	\$ 20,000
SA54	Thomas Street	Lewisham	Local Road	Strategic Route	safety issue	missing lighting	-33.8932678	151.1481911	1		install new lighting	LW34	Primary	LOW	\$ 10,000
SA55	Thomas Street	Lewisham	Local Road	Strategic Route	safety issue	missing lighting	-33.8933413	151.1483827	1		install new lighting	LW34	Primary	LOW	\$ 10,000
SA56	Toothill Street	Lewisham	Regional Road		safety issue	potential raised pedestrian crossing - school	-33.895634	151.145199	1		install raised pedestrian crossing	LW36	Primary	LOW	\$ 50,000
SA57	Victoria Street	Lewisham	Local Road		safety issue	potential HPAA	-33.8937221	151.1475876	1		investigate HPAA implementation	LW24	Primary	LOW	\$ 15,000
SA58	Byrnes Street	Marrickville	Local Road		safety issue	vehicles approach crossing at speed	-33.9137027	151.1554313	1		install new speed cushions	MV188	Secondary	LOW	\$ 3,000
SA59	Byrnes Street	Marrickville	Local Road		safety issue	poor lighting	-33.9137163	151.15543	1		install new lighting	MV188	Secondary	LOW	\$ 10,000
SA60	Illawarra Road	Marrickville	Regional Road	Strategic Route	safety issue	deep tree pit	-33.9097034	151.1572452	1		top up tree pit	MV81	Secondary	LOW	\$ 150
SA61	Illawarra Road	Marrickville	Regional Road	Strategic Route	safety issue	steep crossfall	-33.9139856	151.1529107	1		re-construct footpath pavement	MV92	Primary	LOW	\$ 200
SA62	Illawarra Road	Marrickville	Regional Road	Strategic Route	safety issue	corner obscures pedestrians	-33.9118629	151.1549562	1		install pavement warning message	MV90	Primary	LOW	\$ 150
SA63	Illawarra Road	Marrickville	Regional Road	Strategic Route	safety issue	corner obscures pedestrians	-33.9118385	151.1549949	1		install pavement warning message	MV90	Primary	LOW	\$ 150
SA64	Illawarra Road	Marrickville	Regional Road	Strategic Route	safety issue	vehicles approach crossing at speed	-33.9116353	151.1552973	1		install raised pedestrian crossing	MV90	Primary	LOW	\$ 50,000
SA65	Illawarra Road	Marrickville	Regional Road	Strategic Route	safety issue	missing pedestrian crossing signage	-33.9112516	151.1556223	1		install pedestrian crossing signage	MV89	Primary	LOW	\$ 200
SA66	Illawarra Road	Marrickville	Regional Road	Strategic Route	safety issue	potential HPAA	-33.9109678	151.1559133	1		investigate HPAA implementation	MV89	Primary	LOW	\$ 15,000
SA67	Marrickville Road	Marrickville	Regional Road		safety issue	missing lighting	-33.9148145	151.1640908	1		install new lighting	MV131	Primary	LOW	\$ 10,000
SA68	Marrickville Road	Marrickville	Regional Road		safety issue	corner obscures pedestrians	-33.9129555	151.1615065	1		install pavement warning message	MV128	Secondary	LOW	\$ 150
SA69	Marrickville Road	Marrickville	Regional Road		safety issue	poor lighting	-33.9100575	151.1553996	1		install new lighting	MV140	Primary	LOW	\$ 10,000
SA70	Marrickville Road	Marrickville	Regional Road		safety issue	vehicles approach crossing at speed	-33.9100866	151.1554309	1		install raised pedestrian crossing	MV140	Primary	LOW	\$ 50,000
SA71	Marrickville Road	Marrickville	Regional Road		safety issue	floodlights orientated incorrectly	-33.9101113	151.1554833	1		adjust flood light orientation	MV140	Primary	LOW	\$ 1,000
SA72	Marrickville Road	Marrickville	Regional Road		safety issue	tree obstructs floodlight	-33.9118647	151.1592331	1		refer to maintenance	MV136	Primary	LOW	\$ -
SA73	Marrickville Road	Marrickville	Regional Road		safety issue	vehicles approach crossing at speed	-33.9118973	151.1592248	1		install raised pedestrian crossing	MV136	Primary	LOW	\$ 50,000
SA74	Marrickville Road	Marrickville	Regional Road		safety issue	roadside furniture obstructs sightlines	-33.9118505	151.1592033	1		re-construct pedestrian fencing	MV136	Primary	LOW	\$ 5,000
SA75	O'Hara Park	Marrickville	Local Road		safety issue	missing lighting	-33.9138064	151.1558572	1		install new lighting	MV187	Secondary	LOW	\$ 10,000
SA76	Richardson Crescent	Marrickville	Local Road		safety issue	damaged fence obstructs footpath	-33.9208892	151.1555317	1		notify property owner	MV173	Tertiary	LOW	\$ -
SA77	Sydenham Road	Marrickville	State Road	Strategic Route	safety issue	substation obstructs pedestrian vehicle sight lines	-33.912566	151.1658759	1		no action	MV203	Primary	LOW	\$ -
SA78	Sydney Steel St	Marrickville	Local Road		safety issue	construction site with no gate control	-33.9101062	151.169868	1		notify business owner	MV207	Tertiary	LOW	\$ -
SA79	Wardell Road	Marrickville	Regional Road		safety issue	poor visibility of pedestrians from workshop, no warning c	-33.9118831	151.1402926	1		install new warning pavement marking	MV238	Primary	LOW	\$ 500
SA80	Edgeware Road	Newtown	Regional Road	Strategic Route	safety issue	shared path signage conflict	-33.907574	151.1745529	1		install shared path signage	NE21	Primary	LOW	\$ 300
SA81	Edinburgh Road	Newtown	Local Road		safety issue	shared path signage required	-33.9079156	151.1744841	1		install new shared path signage	MV17	Secondary	LOW	\$ 350
SA82	Enmore Road	Newtown	State Road	Strategic Route	safety issue	pole blocks sight lines to high pedestrian traffic area	-33.8988539	151.1736132	1		no action	NE37	Primary	LOW	\$ -
SA83	Enmore Road	Newtown	State Road	Strategic Route	safety issue	pedestrian waiting area too small - narrowed by cafe sea	-33.8976023	151.1784722	1		review footpath trading	NE33	Primary	LOW	\$ -
SA84	King Street	Newtown	Local Road		safety issue	cars do not give way to pedestrians	-33.8972139	151.179099	1		install new shared zone signage and	NE12	Primary	LOW	\$ 500
SA85	Liberty Street	Newtown	Local Road		safety issue	shared path signage conflict	-33.8949879	151.1716246	1		review and replace shared path signa	NE43	Tertiary	LOW	\$ 500
SA86	Liberty Street	Newtown	Local Road		safety issue	bicycle pavement marking with no shared path signage	-33.8952746	151.1715782	1		install new shared path signage	NE43	Tertiary	LOW	\$ 350
SA87	Audley Street	Petersham	Local Road		safety issue	potential HPAA	-33.8959378	151.1541437	1		investigate HPAA implementation	PE38	Primary	LOW	\$ 15,000
SA88	New Canterbury Road	Petersham	State Road	Strategic Route	safety issue	vehicles obscures pedestrians	-33.8959153	151.1554358	1		install no stopping sign and signpost	PE30	Primary	LOW	\$ 300
SA89	Stanmore Road	Petersham	State Road	Strategic Route	safety issue	poor drainage - severe ponding	-33.8956115	151.1569936	1		refer to maintenance	PE54	Primary	LOW	\$ -
SA90	York Crescent	Petersham	Local Road		safety issue	missing lighting	-33.8937443	151.1585301	1		install new lighting	PE21	Secondary	LOW	\$ 10,000
SA91	Beattie Street	Rozelle	Local Road		safety issue	corner obscures pedestrians	-33.8605783	151.1722915	1		install pavement warning message	RO17	Secondary	LOW	\$ 150
SA92	Darling Street	Rozelle	Regional Road	Strategic Route	safety issue	potential HPAA	-33.8640417	151.1698368	1		investigate HPAA implementation	RO26	Primary	LOW	\$ 15,000
SA93	Terry Street	Rozelle	Local Road		safety issue	refuge island provides no protection from traffic	-33.8608041	151.1695755	1		install new refuge island	RO68	Secondary	LOW	\$ 15,000
SA94	Terry Street	Rozelle	Local Road		safety issue	refuge island provides no protection for pedestrians	-33.8606781	151.1699641	1		install new refuge island	RO66	Secondary	LOW	\$ 15,000
SA95	Bedwin Road	St Peters	Regional Road		safety issue	steep crossfall	-33.9091311	151.1751374	1		re-construct footpath pavement	MV18	Secondary	LOW	\$ 200
SA96	Aubery Street	Stanmore	Local Road		safety issue	missing lighting	-33.8953706	151.1613981	1		install new lighting	SM50	Primary	LOW	\$ 10,000
SA97	Holt Street	Stanmore	Local Road		safety issue	potential raised pedestrian crossing - school	-33.894953	151.164314	1		install raised pedestrian crossing	SM26	Primary	LOW	\$ 50,000
SA98	Holt Street	Stanmore	Local Road		safety issue	potential HPAA	-33.8951917	151.1642208	1		investigate HPAA implementation	SM26	Primary	LOW	\$ 15,000
SA99	Liberty Street	Stanmore	Local Road		safety issue	potential raised pedestrian crossing - school	-33.8973303	151.1703843	1		install raised pedestrian crossing	EN12	Secondary	LOW	\$ 50,000
SA100	Merchant Street	Stanmore	Local Road		safety issue	poor drainage - severe ponding	-33.8958725	151.1674623	1		refer to maintenance	SM20	Secondary	LOW	\$ -
SA101	Percival Road	Stanmore	Local Road	Strategic Route	safety issue	potential HPAA	-33.8926512	151.1645687	1		investigate HPAA implementation	SM32	Primary	LOW	\$ 15,000

